

**ASBESTOS SURVEY – 2022**  
**Fargo VA Medical Center – Building 9**

**2101 Elm Street North  
Fargo, ND 58102**



**PREPARED FOR:**

**Ron Tollefson (VA COR)  
2101 Elm Street North  
Fargo, ND 58102**

**PREPARED BY:**

**TRINE Environmental, Inc. (SDVOSB)  
6678 Morningdale Dr.  
Brighton, MI**

**Dan Johnson  
Asbestos Inspector (ND 6804)**

**John R Rogers  
President**



# Table of Contents

1.0 – INTRODUCTION .....	3
2.0 – SITE HISTORY & DESCRIPTION .....	3
3.0 – METHODS & LIMITATIONS.....	3
3.1 – Asbestos Survey Methods.....	3
3.2 – Laboratory Analytical Methods .....	5
3.3 – Limitations .....	5
4.0 – SURVEY RESULTS .....	6
4.1 – Asbestos Analysis Results .....	6
Table 1 – Analytical Results .....	8
Table 2 – Room by Room .....	9
4.2 – Additional Observations .....	62
4.3 – Cost Estimate for Asbestos Abatement.....	62
5.0 – RECOMMENDATIONS .....	62
5.1 – Recommendations for Regulated ACM (RACM).....	62
5.2 – Recommendations for Category I Non-Friable ACM (C1NF).....	62
5.3 – Recommendations for Category II Non-Friable ACM (C2NF) .....	63
5.4 – General Recommendations.....	63
6.0 – SIGNATURE PAGE.....	64
APPENDIX A – LABORATORY CERTIFICATE OF ANALYSIS .....	65
APPENDIX B – ASBESTOS INSPECTOR CERTIFICATION .....	70

## 1.0 – INTRODUCTION

An asbestos survey was conducted at the Veterans Administration Medical Center (VAMC) Fargo Health Care System (HCS), 2101 Elm Street North Fargo, ND 58102. The survey was conducted between February 28th and March 31st, 2022, by Dan Johnson of TRINE Environmental, Inc., an EPA-certified building inspector in the state of North Dakota.

The purpose of this asbestos survey was to identify the presence, and extent of asbestos containing materials (ACM) in seventeen (17) buildings, incorporate previously performed asbestos survey, and create a new database in support of future plans to renovate which may require demolition activities. Each building was considered a separate homogenous area (HA).

The inspection was performed by a certified EPA asbestos building inspector, experienced in identifying and sampling suspect ACM. All areas of Building 9 were accessed and inspected.

Suspect materials were sampled to determine asbestos content.

All samples collected were analyzed at EMSL Analytical, Inc., (EMSL) an AIHA and NVLAP accredited asbestos laboratory, using either Polarized Light Microscopy (PLM) methods or Transmission Electron Microscopy (TEM) methods. A total of twenty-three (23) samples were collected and analyzed.

Laboratory Certificates of Analysis are located in Appendix A of this report. Company and individual licenses and certifications are located in Appendix B.

## 2.0 – SITE HISTORY & DESCRIPTION

The Fargo VA HCS campus is made up of 17 buildings that first started construction in 1929 with major expansions in 1945 and 1983 but have also been under constant renovations of various magnitudes over the last 92 years. Currently the campus has approximately 576,000 interior gross square feet (GSF).

## 3.0 – METHODS & LIMITATIONS

### 3.1 – Asbestos Survey Methods

The site was inspected for suspect ACM, unless otherwise noted. Each observed suspect material was assigned a material identification within the homogenous area (HA), such as ceiling tile (CT), floor tile (FT), Thermal System Insulation (TSI) or miscellaneous (MISC), described, and measured. Each observed suspect material was sampled except for those that were confirmed positive from previous sampling events or determined to non-suspect material. Samples of suspect ACM were collected using procedures established by the United States Environmental Protection Agency (USEPA) Code of Federal Regulations (CFR) Title 40 Part 763 Subpart E, Asbestos Containing Materials in Schools.

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Upon completing an initial walkthrough, the asbestos inspector began a thorough inspection identifying probable ACM and categorizing by material identification. Each material identification represented a group of material having similar characteristics such as appearance, color and manner in which it was used.

ACM's were divided into three categories:

1. **Surfacing Materials:** material that is sprayed-on, troweled on, or otherwise applied to surfaces, such as acoustical plaster on ceilings and fireproofing materials on structural members, or other materials on surfaces for acoustical, fireproofing or other purposes
2. **Thermal System Insulation (TSI):** material applied to pipes, fittings, boilers, breeching, tanks, ducts, or other structural components to prevent heat loss or gain, or water condensation, or for other purposes
3. **Miscellaneous ACM:** interior building material on structural components, structural members or fixtures, such as floor and ceiling tiles, and does not include surfacing material or thermal insulation

ACM's inventoried in this survey are classified as either friable or non-friable. Friable ACM can be crumbled or reduced to powder by hand pressure whereas non-friable ACM cannot.

The EPA asbestos NESHAP regulation further classifies non-friable ACM into two categories:

1. **Category I:** Non-friable ACM includes any asbestos-containing packing, gasket, resilient floor covering or asphalt roofing product
2. **Category II:** Non-friable ACM includes any non-friable ACM other than Category I non-friable ACM

Samples were collected in airtight sealed bags for transportation to EMSL. for analysis. Standard Operating Procedures dictated samples were collected in manner consistent with health and safety protocols, using personal hygiene methods, using wet methods as required, and donning proper Personal Protective Equipment (PPE). These methods were used to prevent asbestos airborne contamination from being introduced to the hospital's atmosphere and to minimize employee, staff, and patient exposure.

Lab data pertaining to the samples analyzed is located in Appendix A of this report and each sample is listed as follows:

- Date Analyzed
- Field Sample #
- Lab Sample #
- Sample Location
- Asbestos Content
- Non-Asbestos Content

Samples were analyzed using PLM methods and Point Count Methods for any sample returning a  $\leq 5\%$  (less than or equal to) result, excluding non-detects.

### 3.2 – Laboratory Analytical Methods

All samples collected during the survey were analyzed at EMSL, an A.I.H.A. and NVLAP certified laboratory. Upon arrival at the laboratory, the samples were logged-in and submitted for analysis.

PLM samples were analyzed utilizing the Environmental Protection Agency’s test method: Methods for the determination of Asbestos in Bulk Building Materials (EPA 600/R-93/116, July 1993) and the McCrone Research Institute’s The Asbestos Particle Atlas as the principal analytical references. Additional treatment and tests may be required to accurately define composition (i.e. ashing, extraction, acetone treatment, and TEM).

The PLM method utilizes a light microscope equipped with polarizing filters. The identification of asbestos fiber bundles is determined by the visual properties displayed when the sample is treated with various dispersion staining liquids. Identification is substantiated by the actual structure of the fiber and the effect of polarized light on the fiber, all of which is viewed by a trained technician. The limit of detection of asbestos by PLM is about one percent (1%) by area. Samples containing lower levels of asbestos are not reliably detectable by this technique.

Analysis was performed by using the bulk sample for visual observation and slide preparation(s) for microscopic examination and identification. The samples were analyzed for asbestos (chrysotile, amosite, crocidolite, anthophyllite, and actinolite/tremolite), fibrous non-asbestos constituents (cellulose, synthetic, etc.) and non-fibrous constituents. Using a stereoscope, the microscopist visually estimated relative amounts of each constituent by determining the volume of each constituent in proportion to the total volume of the sample.

The asbestos National Emission Standards for Hazardous Air Pollutants (NESHAP) recommends that asbestos bulk samples that are less than 10% by PLM are to be analyzed by point counting for friable ACM and mandates point counting when PLM results for friable ACM are in trace amounts (< 1%) in order to declare that the material is non-asbestos containing. The point-count procedure mandated by NESHAP is in the EPA “Interim” Bulk Method. For each layer to be point counted, eight mounts are made by dispersing 8 pinches of sample in suitable fluid. Each of the mounts is examined under the polarizing light microscope using an eyepiece reticule that superimposes a grid of points over the field of view. Fifty non-empty points are examined for each mount, yielding 400 points – some of which would be identified as asbestos and the rest as non-asbestos material.

Transmission Electron Microscopy (TEM) analysis is used to quantify and identify asbestos structures using electron diffraction and energy dispersive X-ray (EDX) analysis. Identification of chrysotile or amphibole crystalline structures can be consistently determined via the electron-diffraction capabilities of modern TEMs. The five amphibole types can be differentiated based on their elemental composition when EDX analysis is combined with their electron diffraction patterns.

### 3.3 – Limitations

This asbestos survey report has been prepared by TRINE in a manner consistent with that level of care and skill ordinarily exercised by members of the profession currently practicing under similar conditions. No other warranty expressed or implied is made. The intent of this survey report is to assist the building owner or management in locating ACM. This document is not intended to be utilized as a proposal or a project design document for the remediation of asbestos materials discovered during this investigation.

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

The survey was conducted to identify suspect ACM on the interior areas of Building 9. Some ACM may not have been discovered due to inaccessibility. Any suspect materials discovered subsequent to the issue of this survey report should be sampled and analyzed to determine asbestos content and to initiate appropriate responses.

TRINE's interpretations and recommendations are based upon the results of sample collection and analyses in compliance with environmental regulations, quality control and assurance standards, and the scope of work. The results, conclusions, and recommendations contained in this report pertain to conditions observed at the time of the survey.

The field observations, measurements, and research reported herein are considered sufficient in detail and scope to form a reasonable basis for an Asbestos Survey Report. The assessment, conclusions, and recommendations presented herein are based upon the sample analysis results of collected materials within the Homogenous Area. They may not represent all conditions at the subject site as they reflect the information gathered from specific locations. TRINE Environmental, Inc. warrants the findings and conclusions contained herein have been promulgated in accordance with generally accepted industrial hygiene methodology and only for the site described in this report.

Reliance on or use by any such third-party without explicit authorization in the report does not make said third-party a third-party beneficiary to TRINE's contract with the VA. Any such unauthorized reliance on or use of this report, including any of its information or conclusions, will be at third-party's risk. For the same reasons, no warranties or representations, expressed or implied in this report, are made to any such third party.

This report has been developed to provide the client with information regarding apparent conditions relating to the subject property. Although TRINE believes that the findings and conclusions provided in this report are reasonable, the report is necessarily limited to the conditions observed and to the information available at the time of the work. Due to the nature of the work, there is a possibility conditions exist that could not be identified within the scope of the inspection, or which were not apparent at the time of our site work. The report is also limited to information available from the client at the time it was conducted. It is also possible that the testing methods employed at the time of the report may later be superseded by other methods. TRINE does not accept responsibility for changes in the state of the art.

## **4.0 – SURVEY RESULTS**

### **4.1 – Asbestos Analysis Results**

A total of twenty-three (23) samples were collected and analyzed by PLM. The original laboratory report and certificate of analysis are located in Appendix A.

The following tables summarize the samples collected and quantity of materials that contain asbestos in amounts >1% (greater than). Table 1 provides the analytical results of the samples submitted to the laboratory. Table 2 provides a room-by-room breakdown of the materials identified and sample number associated with the analytical results.

**TABLE LEGEND**

**NAD: No Asbestos Detected**

**ACM Material with type and percent detected**

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

**Table 1 – Analytical Results**

Sample Numbers	Location / Homogenous Area	Material Description	Material Type	Exterior Description	Quantity	AHERA Material Category	Condition	Potential for Future Damage	Asbestos Content	Balance Material	Notes
09-001	BA-65 Renovation Area	12" x 12" Floor Tile		Gray/Brown /White	1				3% Chrysotile FT		FT-1
09-002	BA-65 Renovation Area	12" x 12" Floor Tile		Tan w/Brown and White Specks	1				None Detected		FT-2
09-003	BA-65 Renovation Area	Concrete Floor Trench Seam Caulk		Gray	1				None Detected		
09-004	BB-44	2' x 4' Ceiling Tile		Widthwise Fissures	1				None Detected		CT-1
09-005	BB-15B	2' x 4' Ceiling Tile		Vinyl Covered Sheetrock Look	1				None Detected		CT-2
09-006	BB-22			Long Fissures w/Pinholes	1				None Detected		CT-3
09-007	BB-55 Corridor	2' x 2' Ceiling Tile		Rough Texture	1				None Detected		CT-4
09-008A-C	BB-09	Spray-On Fireproofing		White Fluffy	3				None Detected		
09-009	BB-67 North/South Corridor	2' x 2' Ceiling Tile		Random Fissures	1				None Detected		CT-5
09-010	1A-30B	2' x 2' Ceiling Tile		Vinyl Covered Sheetrock Look	1				None Detected		CT-6
09-011	1B-73	12" x 12" Floor Tile		White w/Black Specks	1				None Detected		FT-3
09-012	2A-66 Corridor	12" x 12" Floor Tile		White w/Gold	1				4% Chrysotile (FT)/10% Chrysotile (Mastic)		FT-4
09-013	2A-34	2' x 4' Ceiling Tile		Random Fissures	1				None Detected		CT-7
09-014	4A-40 Corridor	12" x 12" Floor Tile		White w/Gray Streaks	1				None Detected		FT-5
09-015	Penhouse	Building Seam Filler		Gray	1				None Detected		
09-016	Penhouse	West Window Glazing		Gray	1				None Detected		
09-017	Penthouse	SE Mud at Floor Around Duct		White/Gray	1				None Detected		



**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Sample Numbers	Location / Homogenous Area	Material Description	Material Type	Exterior Description	Quantity	AHERA Material Category	Condition	Potential for Future Damage	Asbestos Content	Balance Material	Notes
09-018	Penthouse	Ceiling Fiberglass insulation Backing		Black	1				None Detected		
09-019	Penthouse	Tar Paper by Windows		Black	1				None Detected		
09-020	BA-65 Renovation Area	Fire Stop		Red	1				None Detected		
09-021A-C	Outside BA-65 Renovation Area in Corridor	Hard Plaster Ceiling		White/Gray	3				None Detected		<1,000 sf Left
09-022A-G	BA-65 Renovation Area	Hard Plaster Wall		White/Gray	7				None Detected		
09-023	BA-65 Renovation Area	Sheetrock/Tape/Compound		White	1				None Detected		

**Table 2 – Room by Room**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BA-03	B	No Suspect Material									
BA-05	B	No Suspect Material									
BA-07	B	No Suspect Material									
BA-07A	B	No Suspect Material									
<b>BA-09</b>	<b>B</b>	<b>Thermal System Insulation</b>			<b>Gray</b>	<b>12lf</b>		<b>Assumed</b>	<b>Friable</b>	<b>Assumed</b>	<b>In Floor Trench</b>
BA-09	B	No Suspect Material									
BA-10	B	No Suspect Material									
<b>BA-65 Renovation Area</b>	<b>B</b>	<b>12" x 12" Floor Tile and Mastic</b>	<b>FT-1</b>	<b>12"x12"</b>	<b>Gray/Brown /White</b>	<b>275 sf</b>		<b>3% Chrysotile (FT)</b>	<b>Non-Friable</b>	<b>09-001</b>	<b>FT-1</b>
BA-65 Renovation Area	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	375 sf		None Detected		09-002	FT-2

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BA-65 Renovation Area	B	Thermal System Insulation			Gray	100 lf		Assumed	Friable	Assumed	In Floor Trench
BA-65 Renovation Area	B	Concrete Floor Seam Caulk			Gray	100 lf		None Detected		09-003	
BB-09	B	Spray-On Fireproofing			White Fluffy	955 sf		None Detected		09-008A-C	
BB-09 Corridor	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	750 sf		None Detected		09-002	FT-2
BB-09 Corridor	B	Thermal System Insulation			Gray	200 lf		Assumed	Friable	Assumed	In Floor Trench
BB-10	B	Thermal System Insulation			Gray	10 lf		Assumed	Friable	Assumed	Above Hard Lid Ceiling
BB-12	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	200 sf		None Detected		09-004	CT-1
BB-12	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	200 sf		None Detected		09-002	FT-2
BB-15	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	2,000 sf		None Detected		09-005	CT-2
BB-15	B	Sheet Vinyl Floor			Gray	2,000 sf				Non-Suspect	New
BB-15A	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	150 sf		None Detected		09-005	CT-2
BB-15A	B	2" Ceramic Floor Tile			Gray	150 sf				Non-Suspect	New
BB-15A	B	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
BB-15A1	B	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
BB-15A-1	B	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
BB-15B	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	150 sf		None Detected		09-005	CT-2
BB-15B	B	2" Ceramic Floor Tile			Gray	150 sf				Non-Suspect	New
BB-15B	B	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
BB-15B1	B	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-15B1	B	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
BB-16A	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-005	CT-2
BB-16A	B	Sheet Vinyl Floor			Gray	50 sf				Non-Suspect	New
BB-16B	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-005	CT-2
BB-16B	B	Sheet Vinyl Floor			Gray	50 sf				Non-Suspect	New
BB-17	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	1,200 sf		None Detected		09-005	CT-2
BB-17	B	Sheet Vinyl Floor			Gray	1,200 sf				Non-Suspect	New
BB-17A	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	120 sf		None Detected		09-005	CT-2
BB-17A	B	Sheet Vinyl Floor			Gray	120 sf				Non-Suspect	New
BB-18A	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	40 sf		None Detected		09-005	CT-2
BB-18A	B	Sheet Vinyl Floor			Gray	40 sf				Non-Suspect	New
BB-18B	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-005	CT-2
BB-18B	B	Sheet Vinyl Floor			Gray	50 sf				Non-Suspect	New
BB-22	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	110 sf		None Detected		09-006	CT-3
BB-24	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	450 sf		None Detected		09-004	CT-1
BB-24	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	450 sf		None Detected		09-002	FT-2
BB-24 Corridor	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	750 sf		None Detected		09-002	FT-2
BB-26	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	110 sf		None Detected		09-006	CT-3
BB-27	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-28	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-30	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	170 sf		None Detected		09-006	CT-3
BB-31	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
BB-32	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	170 sf		None Detected		09-004	CT-1
BB-33	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-004	CT-1
BB-34	B	Spray-On Fireproofing			Gray	3,000 sf				Non-Suspect	New
BB-34A	B	Spray-On Fireproofing			Gray	100 sf				Non-Suspect	New
BB-34B	B	No Suspect Material									
BB-35	B	Need Access									
BB-44	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
BB-44	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-44A	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	50 sf		None Detected		09-006	CT-1
BB-44A	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
BB-44B	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	50 sf		None Detected		09-006	CT-1
BB-44B	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
BB-50	B	No Suspect Material									
BB-50 Mech	B	No Suspect Material									
BB-52	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
BB-53	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	240 sf		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-54	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
BB-55	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
BB-55 Corridor	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Rough Texture	550 sf		None Detected		09-007	CT-4
BB-55 Corridor	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	550 sf		None Detected		09-002	FT-2
BB-56	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	40 sf		None Detected		09-006	CT-3
BB-56	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	40 sf		None Detected		09-002	FT-2
BB-57	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	40 sf		None Detected		09-006	CT-3
BB-57	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	40 sf		None Detected		09-002	FT-2
BB-58	B	No Suspect Material									
BB-59	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
BB-59	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
BB-59A	B	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
BB-59A	B	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
BB-60	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
BB-60	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
BB-60A	B	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
BB-60A	B	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
BB-61	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-62	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-62	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-64	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
BB-64	B	2" Ceramic Floor Tile			Gray	150 sf				Non-Suspect	New
BB-64	B	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
BB-66	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
BB-66	B	2" Ceramic Floor Tile			Gray	120 sf				Non-Suspect	New
BB-66	B	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
BB-67	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-67 North/South Corridor	B	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	220 sf		None Detected		09-009	CT-5
BB-67 North/South Corridor	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	220 sf		None Detected		09-002	FT-2
BB-67A	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-67B	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-67C	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-67D	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-68	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
BB-68	B	2" Ceramic Floor Tile			Gray	120 sf				Non-Suspect	New
BB-68	B	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
BB-69	B	No Suspect Material									
BB-70	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	250 sf		None Detected		09-006	CT-1

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-82	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-82	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-84	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
BB-84	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-85	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
BB-85	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-85A	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
BB-85A	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-85B	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-05	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	360 sf		None Detected		09-006	CT-3
1A-05	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	360 sf		None Detected		09-002	FT-2
1A-05	1	<b>Thermal System Insulation</b>			<b>Gray</b>	<b>16 lf</b>	<b>Good</b>	<b>Assumed</b>	<b>Friable</b>	<b>Assumed</b>	<b>In Chase</b>
1A-05A	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	110 sf		None Detected		09-006	CT-3
1A-05A	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	110 sf		None Detected		09-002	FT-2
1A-05A	1	<b>Thermal System Insulation</b>			<b>Gray</b>	<b>32 lf</b>	<b>Good</b>	<b>Assumed</b>	<b>Friable</b>	<b>Assumed</b>	<b>In Chase</b>
1A-07	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	160 sf		None Detected		09-006	CT-3
1A-07	1	<b>Thermal System Insulation</b>			<b>Gray</b>	<b>16 lf</b>	<b>Good</b>	<b>Assumed</b>	<b>Friable</b>	<b>Assumed</b>	<b>In Chase</b>
1A-09	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
1A-09A	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1A-09A	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50		None Detected		09-002	FT-2
1A-11	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	160 sf		None Detected		09-006	CT-1
1A-11	1	2" Ceramic Floor Tile			Gray	160 sf				Non-Suspect	New
1A-11	1	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
1A-13	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	160 sf		None Detected		09-006	CT-1
1A-13	1	2" Ceramic Floor Tile			Gray	160 sf				Non-Suspect	New
1A-13	1	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
1A-15	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	85 sf		None Detected		09-006	CT-3
1A-15	1	<b>Thermal System Insulation</b>			<b>Gray</b>	<b>16 lf</b>	<b>Good</b>	<b>Assumed</b>	<b>Friable</b>	<b>Assumed</b>	<b>In Chase</b>
1A-19	1	No Suspect Material									
1A-20	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	250 sf		None Detected		09-006	CT-3
1A-22	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	100 sf		None Detected		09-010	CT-6
1A-22	1	Epoxy Floor			Gray	100 sf				Non-Suspect	
1A-23	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	100 sf		None Detected		09-010	CT-6
1A-23	1	Epoxy Floor			Gray	100 sf				Non-Suspect	
1A-24	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	100 sf		None Detected		09-010	CT-6
1A-24	1	Epoxy Floor			Gray	100 sf				Non-Suspect	
1A-24 Corridor	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	350 sf		None Detected		09-010	CT-6
1A-24 Corridor	1	Sheet Vinyl Floor			Cream	350 sf				Non-Suspect	New



**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1A-25	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-010	CT-6
1A-25	1	Sheet Vinyl Floor			Cream	50 sf				Non-Suspect	New
1A-27	1	No Suspect Material									
1A-28	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-010	CT-6
1A-28	1	Sheet Vinyl Floor			Cream	50 sf				Non-Suspect	New
1A-30	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	1,500 sf		None Detected		09-010	CT-6
1A-30	1	Sheet Vinyl Floor			Cream	1,500 sf				Non-Suspect	New
1A-30A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	300 sf		None Detected		09-006	CT-1
1A-30A	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	300 sf		None Detected		09-002	FT-2
1A-30B	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-010	CT-6
1A-30B	1	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
1A-30B	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1A-30C	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	350 sf		None Detected		09-010	CT-6
1A-30C	1	Sheet Vinyl Floor			Cream	350 sf				Non-Suspect	New
1A-30D	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	25 sf		None Detected		09-010	CT-6
1A-30D	1	Sheet Vinyl Floor			Cream	25 sf				Non-Suspect	New
1A-30E	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	250 sf		None Detected		09-006	CT-1
1A-30E	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	250 sf		None Detected		09-002	FT-2
1A-30F	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1A-30F	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
1A-30G	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	50 sf		None Detected		09-009	CT-5
1A-30G	1	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
1A-30G	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1A-30H	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	300 sf		None Detected		09-010	CT-6
1A-30H	1	Sheet Vinyl Floor			Cream	300 sf				Non-Suspect	New
1A-30I	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	600 sf		None Detected		09-010	CT-6
1A-30I	1	Sheet Vinyl Floor			Cream	600 sf				Non-Suspect	New
1A-30IA	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-010	CT-6
1A-30IA	1	Sheet Vinyl Floor			Cream	50 sf				Non-Suspect	New
1A-30J	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	700 sf		None Detected		09-010	CT-6
1A-30J	1	Sheet Vinyl Floor			Cream	700 sf				Non-Suspect	New
1A-31	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
1A-33	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	160 sf		None Detected		09-006	CT-1
1A-34	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-35	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-35	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
1A-36	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-37	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1A-38	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-39	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-40	1	No Suspect Material									
1A-41	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	180 sf		None Detected		09-010	CT-6
1A-50	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	460 sf		None Detected		09-006	CT-3
1A-52	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
1A-52	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
1A-54	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
1A-54	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
1A-55	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-57	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-58	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
1A-59	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
1A-59 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	1,200 sf		None Detected		09-006	CT-3
1A-60	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-62	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-63	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-63	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
1A-64	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	235 sf		None Detected		09-006	CT-1

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1A-66	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	235 sf		None Detected		09-006	CT-1
1A-67A	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	75 sf		None Detected		09-006	CT-3
1A-68	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	240 sf		None Detected		09-006	CT-1
1A-69	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	385 sf		None Detected		09-006	CT-1
1A-69A	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	75 sf		None Detected		09-006	CT-3
1A-69A	1	2" Ceramic Floor Tile			Gray	75 sf				Non-Suspect	New
1A-69A	1	4" Ceramic Wall Tile			Cream	125 sf				Non-Suspect	New
1A-70	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
1A-70	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	200 sf		None Detected		09-002	FT-2
1B-24	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
1B-25	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
1B-26	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	450 sf		None Detected		09-006	CT-3
1B-26 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	450 sf		None Detected		09-006	CT-3
1B-26 Corridor	1	12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	300 sf		None Detected		09-011	FT-3
1B-27A	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	75 sf		None Detected		09-002	FT-2
1B-27B	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	75 sf		None Detected		09-010	CT-6
1B-27B	1	2" Ceramic Floor Tile			Gray	75 sf				Non-Suspect	New
1B-27B	1	4" Ceramic Wall Tile			Cream	125 sf				Non-Suspect	New
1B-27C	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-010	CT-6

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-27C	1	Sheet Vinyl Floor			Cream	50 sf				Non-Suspect	New
1B-27C Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	440 sf		None Detected		09-006	CT-3
1B-27C Corridor	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	440 sf		None Detected		09-002	FT-2
1B-28	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	250 sf		None Detected		09-006	CT-3
1B-28	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	250 sf		None Detected		09-002	FT-2
1B-29	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	350 sf		None Detected		09-006	CT-1
1B-29	1	Sheet Vinyl Floor			Cream	350 sf				Non-Suspect	New
1B-29A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
1B-29A	1	Sheet Vinyl Floor			Cream	180 sf				Non-Suspect	New
1B-29B	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	60 sf		None Detected		09-006	CT-1
1B-29B	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	60 sf		None Detected		09-002	FT-2
1B-30	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	350 sf		None Detected		09-006	CT-1
1B-30	1	Sheet Vinyl Floor			Cream	350 sf				Non-Suspect	New
1B-30A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	60 sf		None Detected		09-006	CT-1
1B-30A	1	Sheet Vinyl Floor			Cream	60 sf				Non-Suspect	New
1B-31	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	250 sf		None Detected		09-009	CT-5
1B-31	1	Sheet Vinyl Floor			Cream	250 sf				Non-Suspect	New
1B-31A	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	100 sf		None Detected		09-009	CT-5
1B-31A	1	Sheet Vinyl Floor			Cream	100 sf				Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-32	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	25 sf		None Detected		09-009	CT-5
1B-32	1	Sheet Vinyl Floor			Cream	25 sf				Non-Suspect	New
1B-32 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	300 sf		None Detected		09-006	CT-3
1B-32 Corridor	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	300 sf		None Detected		09-002	FT-2
1B-33	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	100 sf		None Detected		09-006	CT-1
1B-33	1	Sheet Vinyl Floor			Cream	100 sf				Non-Suspect	New
1B-34	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	385 sf		None Detected		09-006	CT-3
1B-34	1	Sheet Vinyl Floor			Cream	385 sf				Non-Suspect	New
1B-34A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	85 sf		None Detected		09-006	CT-1
1B-34A	1	2" Ceramic Floor Tile			Gray	85 sf				Non-Suspect	New
1B-34A	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-35	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	385 sf		None Detected		09-006	CT-3
1B-35	1	Sheet Vinyl Floor			Cream	385 sf				Non-Suspect	New
1B-35A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	85 sf		None Detected		09-006	CT-1
1B-35A	1	2" Ceramic Floor Tile			Gray	85 sf				Non-Suspect	New
1B-35A	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-36	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	200 sf		None Detected		09-006	CT-1
1B-36	1	Sheet Vinyl Floor			Cream	200 sf				Non-Suspect	New
1B-37	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	325 sf		None Detected		09-009	CT-5

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-37	1	Sheet Vinyl Floor			Cream	325 sf				Non-Suspect	New
1B-37A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	85 sf		None Detected		09-006	CT-1
1B-37A	1	2" Ceramic Floor Tile			Gray	85 sf				Non-Suspect	New
1B-37A	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-38	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
1B-38	1	Sheet Vinyl Floor			Cream	150 sf				Non-Suspect	New
1B-39	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	235 sf		None Detected		09-006	CT-3
1B-41	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
1B-42	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
1B-44	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	175 sf		None Detected		09-009	CT-5
1B-45	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	150 sf		None Detected		09-009	CT-5
1B-45	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
1B-45A	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	100 sf		None Detected		09-009	CT-5
1B-45A	1	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
1B-45A	1	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
1B-47	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	150 sf		None Detected		09-009	CT-5
1B-47	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
1B-47A	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	100 sf		None Detected		09-009	CT-5
1B-47A	1	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-47A	1	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
1B-48	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	150 sf		None Detected		09-009	CT-5
1B-50	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	150 sf		None Detected		09-009	CT-5
1B-52	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	150 sf		None Detected		09-009	CT-5
1B-54	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	150 sf		None Detected		09-009	CT-5
1B-55	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	50 sf		None Detected		09-009	CT-5
1B-55	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
1B-60	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	385 sf		None Detected		09-006	CT-1
1B-60	1	Sheet Vinyl Floor			Cream	385 sf				Non-Suspect	New
1B-61	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
1B-61	1	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
1B-61	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-62	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	385 sf		None Detected		09-006	CT-1
1B-62	1	Sheet Vinyl Floor			Cream	385 sf				Non-Suspect	New
1B-63	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	200 sf		None Detected		09-010	CT-6
1B-63	1	Sheet Vinyl Floor			Cream	200 sf				Non-Suspect	New
1B-64	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
1B-64	1	Sheet Vinyl Floor			Cream	180 sf				Non-Suspect	New
1B-65	1	Need Access									



**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-65 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	300 sf		None Detected		09-006	CT-3
1B-65 Corridor	1	12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	300 sf		None Detected		09-011	FT-3
1B-66	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	385 sf		None Detected		09-010	CT-6
1B-66	1	Sheet Vinyl Floor			Cream	385 sf				Non-Suspect	New
1B-67	1	Need Access									
1B-68	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
1B-68	1	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
1B-68	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-69	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
1B-70	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
1B-70		12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	180 sf		None Detected		09-011	FT-3
1B-70 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	500 sf		None Detected		09-006	CT-3
1B-70 Corridor	1	12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	500 sf		None Detected		09-011	FT-3
1B-71	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
<b>1B-71</b>	<b>1</b>	<b>12" x 12" Floor Tile and Mastic</b>	<b>FT-1</b>	<b>12"x12"</b>	<b>Gray/Brown/White</b>	<b>180 sf</b>		<b>3% Chrysotile (FT)</b>	<b>Non-Friable</b>	<b>09-001</b>	<b>FT-1</b>
1B-71A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	80 sf		None Detected		09-006	CT-1
1B-71A	1	2" Ceramic Floor Tile			Gray	80 sf				Non-Suspect	New
1B-71A	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-72	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	150 sf		None Detected		09-010	CT-6

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-72	1	Sheet Vinyl Floor			Cream	150 sf				Non-Suspect	New
1B-73	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	300 sf		None Detected		09-006	CT-3
1B-73	1	12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	300 sf		None Detected		09-011	FT-3
1B-74	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
<b>1B-74</b>	<b>1</b>	<b>12" x 12" Floor Tile and Mastic</b>	<b>FT-1</b>	<b>12"x12"</b>	<b>Gray/Brown/White</b>	<b>180 sf</b>		<b>3% Chrysotile (FT)</b>	<b>Non-Friable</b>	<b>09-001</b>	<b>FT-1</b>
1B-75	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
1B-77 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	450 sf		None Detected		09-006	CT-3
1B-77 Corridor	1	12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	450 sf		None Detected		09-011	FT-3
1B-78	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
1B-78	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	200 sf		None Detected		09-002	FT-2
1B-78 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
1B-78 Corridor	1	12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	200 sf		None Detected		09-011	FT-3
1B-79	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	250 sf		None Detected		09-010	CT-6
1B-79	1	Sheet Vinyl Floor			Cream	250 sf				Non-Suspect	New
1B-79A	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	125 sf		None Detected		09-009	CT-5
1B-79A	1	2" Ceramic Floor Tile			Gray	125 sf				Non-Suspect	New
1B-79A	1	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
1B-80	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	500 sf		None Detected		09-010	CT-6
1B-80	1	Sheet Vinyl Floor			Cream	500 sf				Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-80A	1	Sheet Vinyl Floor			Cream	100 sf				Non-Suspect	New
1B-80B	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	125 sf		None Detected		09-010	CT-6
1B-80B	1	Sheet Vinyl Floor			Cream	125 sf				Non-Suspect	New
1B-80C	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	100 sf		None Detected		09-010	CT-6
1B-80C	1	Sheet Vinyl Floor			Cream	100 sf				Non-Suspect	New
1B-90	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	355 sf		None Detected		09-006	CT-3
1B-90	1	Sheet Vinyl Floor			Cream	355 sf				Non-Suspect	New
1B-90A	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
1B-90A	1	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
1B-90A	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-90B	1	Sheet Vinyl Floor			Cream	150 sf				Non-Suspect	New
1B-90F	1	Sheet Vinyl Floor			Cream	250 sf				Non-Suspect	New
2A-03	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
2A-03	2	<b>Thermal System Insulation</b>			<b>Gray</b>	<b>32 lf</b>	<b>Good</b>	<b>Assumed</b>	<b>Friable</b>	<b>Assumed</b>	<b>In Chase</b>
2A-03 Corridor	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	1,500 sf		None Detected		09-006	CT-3
2A-03 Corridor	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	1,500 sf		None Detected		09-002	FT-2
2A-05	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	230 sf		None Detected		09-006	CT-3
2A-05	2	<b>Thermal System Insulation</b>			<b>Gray</b>	<b>16 lf</b>	<b>Good</b>	<b>Assumed</b>	<b>Friable</b>	<b>Assumed</b>	<b>In Chase</b>
2A-05A	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2A-07	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	180 sf		None Detected		09-006	CT-3
2A-07	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-09	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	180 sf		None Detected		09-006	CT-3
2A-09	2	Thermal System Insulation			Gray	32 lf	Good	Assumed	Friable	Assumed	In Chase
2A-13	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
2A-13	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-13A	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	100 sf		None Detected		09-006	CT-1
2A-13A	2	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
2A-13A	2	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
2A-19	2	No Suspect Material									
2A-22	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
2A-22	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-22A	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
2A-22A	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-24	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
2A-24	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
2A-24	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-26	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	165 sf		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2A-28	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	165 sf		None Detected		09-006	CT-3
2A-28	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-29	2	Transite Panel/Pucks			Black	60 lf	Good	Assumed		Assumed	(6) Register Cabinets
2A-29		Thermal System Insulation			Gray	16 lf	POOR	Assumed	Friable	Assumed	In Wall/Open End
2A-29 Corridor	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	750 sf		None Detected		09-009	CT-5
2A-29 Corridor	2	12" x 12" Floor Tile and Mastic	FT-4	12"x12"	White w/Gold	750 sf		4% Chrysotile (FT)/10% Chrysotile (Mastic)	Non-Friable	09-012	FT-4
2A-30	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	165 sf		None Detected		09-006	CT-1
2A-30	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-32	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	165 sf		None Detected		09-006	CT-1
2A-32	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-34	2	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	165 sf		None Detected		09-013	CT-7
2A-34	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-36	2	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	100 sf		None Detected		09-013	CT-7
2A-36	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-38	2	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	165 sf		None Detected		09-013	CT-7
2A-40	2	No Suspect Material									
2A-40 Corridor	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	500 sf		None Detected		09-009	CT-5
2A-40 Corridor	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	500 sf		None Detected		09-002	FT-2

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2A-42	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	130 sf		None Detected		09-009	CT-5
2A-42	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-42	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
2A-43	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	130 sf		None Detected		09-009	CT-5
2A-43	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-43	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
2A-45	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	130 sf		None Detected		09-009	CT-5
2A-45	2	Thermal System Insulation			Gray	16 lf	POOR	Assumed	Friable	Assumed	In Chase/Open End
2A-45	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
2A-46	2	Transite Panel/Pucks			Black	20 lf	Good	Assumed		Assumed	(2) Register Cabinets
2A-46	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	250 sf		None Detected		09-009	CT-5
2A-46	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-47	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
2A-47	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	250 sf		None Detected		09-009	CT-5
2A-47	2	Thermal System Insulation			Gray	32 lf	POOR	Assumed	Friable	Assumed	In Chase/Open End
2A-48	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
2A-48	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
2A-48	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2A-50	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
2A-50	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	195 sf		None Detected		09-009	CT-5
2A-51	2	No Suspect Material									
2A-52	2	Transite Panel/Pucks			Black	20 lf	Good	Assumed		Assumed	(2) Register Cabinets
2A-52	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	350 sf		None Detected		09-006	CT-3
2A-52	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-52 Corridor	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	750 sf		None Detected		09-009	CT-5
2A-52 Corridor	2	12" x 12" Floor Tile and Mastic	FT-4	12"x12"	White w/Gold	750 sf		4% Chrysotile (FT)/10% Chrysotile (Mastic)	Non-Friable	09-012	FT-4
2A-56	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
2A-56	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2
2A-56	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-56	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
2A-57	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
2A-57	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-58	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
2A-58	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
2A-60	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	100 sf		None Detected		09-009	CT-5
2A-60	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2A-60	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-60	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
2A-61	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	300 sf		None Detected		09-006	CT-1
2A-61	2	2" Ceramic Floor Tile			Gray	300 sf				Non-Suspect	New
2A-61	2	4" Ceramic Wall Tile			Cream	500 sf				Non-Suspect	New
2A-62	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	130 sf		None Detected		09-009	CT-5
2A-62	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
2A-64	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	130 sf		None Detected		09-006	CT-1
2A-64	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-64	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
2A-65	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	300 sf		None Detected		09-006	CT-1
2A-65	2	2" Ceramic Floor Tile			Gray	300 sf				Non-Suspect	New
2A-65	2	4" Ceramic Wall Tile			Cream	500 sf				Non-Suspect	New
2A-66	2	Transite Panel/Pucks			Black	20 lf	Good	Assumed	Non-Friable	Assumed	(2) Register Cabinets
2A-66	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	300 sf		None Detected		09-006	CT-1
2A-66	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-70	2	Need Access									
2B-22	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	550 sf		None Detected		09-006	CT-3
2B-22	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	550 sf		None Detected		09-002	FT-2



**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-25	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	700 sf		None Detected		09-006	CT-3
2B-25	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	700 sf		None Detected		09-002	FT-2
2B-26	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	165 sf		None Detected		09-006	CT-3
2B-26	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	165 sf		None Detected		09-002	FT-2
2B-27	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	165 sf		None Detected		09-006	CT-3
2B-27	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	165 sf		None Detected		09-002	FT-2
2B-28	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
2B-28	2	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
2B-28	2	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
2B-29	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
2B-29	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
2B-31	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
2B-31	2	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
2B-31	2	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
2B-32	2	No Suspect Material									
2B-34	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
2B-34	2	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
2B-34	2	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
2B-35	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	165 sf		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-35	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	165 sf		None Detected		09-002	FT-2
2B-37	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	110 sf		None Detected		09-006	CT-3
2B-37	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	110 sf		None Detected		09-002	FT-2
2B-39	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	110 sf		None Detected		09-006	CT-3
2B-39	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	110 sf		None Detected		09-002	FT-2
2B-40	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	110 sf		None Detected		09-006	CT-3
2B-40	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	110 sf		None Detected		09-002	FT-2
2B-42	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	80 sf		None Detected		09-002	FT-2
2B-44	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	200 sf		None Detected		09-006	CT-1
2B-44	2	Sheet Vinyl Floor			Cream	200 sf				Non-Suspect	New
2B-44A	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
2B-44A	2	Sheet Vinyl Floor			Cream	150 sf				Non-Suspect	New
2B-45	2	Epoxy Floor								Non-Suspect	New
2B-45A	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	60 sf		None Detected		09-005	CT-2
2B-45A	2	Epoxy Floor								Non-Suspect	New
2B-45B	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	60 sf		None Detected		09-005	CT-2
2B-45B	2	Epoxy Floor								Non-Suspect	New
2B-46	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
2B-46	2	Sheet Vinyl Floor			Cream	150 sf				Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-47	2	Epoxy Floor								Non-Suspect	New
2B-48	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	300 sf		None Detected		09-005	CT-2
2B-48	2	Sheet Vinyl Floor			Cream	300 sf				Non-Suspect	New
2B-49	2	Epoxy Floor								Non-Suspect	New
2B-49A	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-005	CT-2
2B-49A	2	Epoxy Floor								Non-Suspect	New
2B-50	2	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	1,200 sf		None Detected		09-010	CT-6
2B-50	2	Sheet Vinyl Floor			Cream	1, 200 sf				Non-Suspect	New
2B-51	2	Epoxy Floor								Non-Suspect	New
2B-51A	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	110 sf		None Detected		09-005	CT-2
2B-51A	2	Epoxy Floor								Non-Suspect	New
2B-53	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	300 sf		None Detected		09-005	CT-2
2B-53	2	Sheet Vinyl Floor			Cream	300 sf				Non-Suspect	New
2B-55	2	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	750 sf		None Detected		09-010	CT-6
2B-55	2	Sheet Vinyl Floor			Cream	750 sf				Non-Suspect	New
2B-55A	2	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	110 sf		None Detected		09-010	CT-6
2B-55A	2	Epoxy Floor								Non-Suspect	New
2B-55B	2	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	110 sf		None Detected		09-010	CT-6
2B-55B	2	Epoxy Floor								Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-56	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	365 sf		None Detected		09-006	CT-1
2B-56	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	365 sf		None Detected		09-002	FT-2
2B-60	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	300 sf		None Detected		09-006	CT-3
2B-60	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	300 sf		None Detected		09-002	FT-2
2B-63	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	250 sf		None Detected		09-006	CT-3
2B-64	2	No Suspect Material									
2B-65	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
2B-65	2	12" x 12" Floor Tile and Mastic		12"x12"	Gray	150 sf				Non-Suspect	New
2B-66	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-66	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-67	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-67	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-68	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-68	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-69	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-69	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-70	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-70	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-71	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-71	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-72	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-72	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-73	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-73	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-74	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-74	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-75	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-75	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-76	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-76	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-77	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-77	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-78	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-78	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-79	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	50 sf		None Detected		09-006	CT-1
2B-79	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
2B-80	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	30 sf		None Detected		09-006	CT-1
2B-80	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	30 sf		None Detected		09-002	FT-2

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-82	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	30 sf		None Detected		09-006	CT-1
2B-82	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	30 sf		None Detected		09-002	FT-2
2B-83	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	30 sf		None Detected		09-006	CT-1
2B-83	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	30 sf		None Detected		09-002	FT-2
2B-84	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-84	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-85	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	30 sf		None Detected		09-006	CT-1
2B-85	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	30 sf		None Detected		09-002	FT-2
2B-86	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
2B-86	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
<b>2B-86</b>	<b>2</b>	<b>Transite Panel/Pucks</b>			<b>Black</b>	<b>10 lf</b>	<b>Good</b>	<b>Assumed</b>	<b>Non-Friable</b>	<b>Assumed</b>	<b>Register Cabinet</b>
2B-86A	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	30 sf		None Detected		09-006	CT-1
2B-86A	2	2" Ceramic Floor Tile			Gray	30 sf				Non-Suspect	New
2B-86A	2	4" Ceramic Wall Tile			Cream	80 sf				Non-Suspect	New
2B-86B	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	30 sf		None Detected		09-006	CT-3
2B-86B	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	30 sf		None Detected		09-002	FT-2
2B-87	2	No Suspect Material									
2B-88	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
2B-89	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-90	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
2B-90 Corridor	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	250 sf		None Detected		09-006	CT-3
2B-90 Corridor	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	250 sf		None Detected		09-002	FT-2
2B-95	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	350 sf		None Detected		09-006	CT-3
3A-03	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
<b>3A-03</b>	<b>3</b>	<b>Transite Panel/Pucks</b>			<b>Black</b>	<b>10 lf</b>	<b>Good</b>	<b>Assumed</b>	<b>Non-Friable</b>	<b>Assumed</b>	<b>Register Cabinet</b>
3A-03 Corridor	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	600 sf		None Detected		09-006	CT-3
3A-03 Corridor	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	600 sf		None Detected		09-002	FT-2
3A-05	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	75 sf		None Detected		09-006	CT-3
3A-05	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	75 sf		None Detected		09-002	FT-2
3A-07	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3A-07	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
<b>3A-07</b>	<b>3</b>	<b>Transite Panel/Pucks</b>			<b>Black</b>	<b>10 lf</b>	<b>Good</b>	<b>Assumed</b>	<b>Non-Friable</b>	<b>Assumed</b>	<b>Register Cabinet</b>
3A-09	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
3A-09	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
<b>3A-09</b>	<b>3</b>	<b>Transite Panel/Pucks</b>			<b>Black</b>	<b>10 lf</b>	<b>Good</b>	<b>Assumed</b>	<b>Non-Friable</b>	<b>Assumed</b>	<b>Register Cabinet</b>
3A-09A	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	80 sf		None Detected		09-006	CT-3
3A-11	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
3A-11	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3A-11	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-13	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
3A-13	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
3A-13	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
3A-13	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-14	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
3A-14	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
3A-14	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-15	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
3A-15	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-17	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3A-17	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3A-17	3	Thermal System Insulation			Gray	32 lf	Good	Assumed	Friable	Assumed	In Chase
3A-17	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-19	3	No Suspect Material									
3A-20	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
3A-22	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3A-22	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3A-22 Corridor	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	700 sf		None Detected		09-006	CT-3



**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3A-22 Corridor	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	700 sf		None Detected		09-002	FT-2
3A-22A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-22A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-23	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3A-24	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3A-24	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3A-24A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-24A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-25	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
3A-25	3	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
3A-25	3	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
3A-27	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	200 sf		None Detected		09-006	CT-1
3A-28	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3A-28	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3A-28A	3	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
3A-28A	3	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
3A-29	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	200 sf		None Detected		09-006	CT-1
3A-31	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	100 sf		None Detected		09-006	CT-1
3A-31	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3A-31	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-32	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3A-32	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3A-32A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-32A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-33	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3A-33	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3A-35	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	100 sf		None Detected		09-006	CT-1
3A-35	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2
3A-37	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	100 sf		None Detected		09-006	CT-1
3A-37	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2
3A-37A	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
3A-40	3	No Suspect Material									
3A-40A	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	50 sf		None Detected		09-006	CT-1
3A-40A	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
3A-42	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-42	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-42A	3	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
3A-42A	3	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3A-43	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
3A-43	3	12" x 12" Floor Tile and Mastic	FT-2 (Multiple Layers)	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2 (Multiple Layers)
3A-43A	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	40 sf		None Detected		09-006	CT-3
3A-43A	3	2" Ceramic Floor Tile			Gray	40 sf				Non-Suspect	New
3A-43A	3	4" Ceramic Wall Tile			Cream	80 sf				Non-Suspect	New
3A-46	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-46	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-46A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-46A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-47	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-47	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-48	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-48	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-48A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-48A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-50	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
3A-50	3	2" Ceramic Floor Tile			Gray	115 sf				Non-Suspect	New
3A-50	3	4" Ceramic Wall Tile			Cream	165 sf				Non-Suspect	New
3A-51	3	No Suspect Material									

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3A-52	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
3A-52	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-52 Corridor	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	650 sf		None Detected		09-006	CT-3
3A-52 Corridor	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	650 sf		None Detected		09-002	FT-2
3A-52A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-52A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-55	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	250 sf		None Detected		09-006	CT-3
3A-56	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-56	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-56A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-56A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-57	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-57	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-57A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-57A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-58	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-58	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-58A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-58A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3A-59	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-59	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-59A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-59A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-60	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
3A-60	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-60A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-60A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-61	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-61	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-61A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-61A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-65	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
3A-65	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	180 sf		None Detected		09-002	FT-2
3B-02	3	<b>Thermal System Insulation</b>			<b>Gray</b>	<b>32 lf</b>	<b>Good</b>	<b>Assumed</b>	<b>Friable</b>	<b>Assumed</b>	<b>Above Ceiling</b>
3B-02	3	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	150 sf		None Detected		09-013	CT-7
3B-02	3	2" Ceramic Floor Tile			Gray	150 sf				Non-Suspect	New
3B-02	3	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
3B-06	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	180 sf		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3B-06	3	12" x 12" Floor Tile and Mastic	FT-4	12"x12"	White w/Gold	180 sf		4% Chrysotile (FT)/10% Chrysotile (Mastic)	Non-Friable	09-012	FT-4
3B-06	3	12" Transite Pipe		12"	Gray	10 lf	Good	Assumed	Non-Friable	Assumed	In wall
3B-06A	3	2" Ceramic Floor Tile			Gray	40 sf				Non-Suspect	New
3B-06A	3	4" Ceramic Wall Tile			Cream	80 sf				Non-Suspect	New
3B-08	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
3B-08	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	145 sf		None Detected		09-002	FT-2
3B-10	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
3B-10	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
3B-10	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
3B-12	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	220 sf		None Detected		09-006	CT-3
3B-12	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	220 sf		None Detected		09-002	FT-2
3B-12	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
3B-16	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
3B-16	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	180 sf		None Detected		09-002	FT-2
3B-22	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3B-22	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3B-22A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-22A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3B-23	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2
3B-25	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
3B-26	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3B-26	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3B-26A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-26A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-27	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
3B-28	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3B-28	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3B-28A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-28A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-29	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
3B-31	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	100 sf		None Detected		09-006	CT-1
3B-31	3	1" Ceramic Floor Tile		1"	Gray	100 sf				Non-Suspect	New
3B-31	3	4" Ceramic Wall Tile			White	150 sf				Non-Suspect	New
3B-33	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-33	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-34	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3B-34	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3B-34A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-34A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-35	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	40 sf		None Detected		09-006	CT-3
3B-35	3	2" Ceramic Floor Tile			Gray	40 sf				Non-Suspect	New
3B-35	3	4" Ceramic Wall Tile			Cream	80 sf				Non-Suspect	New
3B-37	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	40 sf		None Detected		09-006	CT-3
3B-37	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	40 sf		None Detected		09-002	FT-2
3B-39	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
3B-39	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
3B-39A	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	40 sf		None Detected		09-006	CT-3
3B-39A	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	40 sf		None Detected		09-002	FT-2
3B-45	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
3B-45	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	180 sf		None Detected		09-002	FT-2
3B-45 Corridor	3	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	700 sf		None Detected		09-009	CT-5
3B-45 Corridor	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	700 sf		None Detected		09-002	FT-2
3B-47	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-47	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-47A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-47A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New



**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3B-48	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-48	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-48A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-48A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-49	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-49	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-49A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-49A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-50	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-50	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-50A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-50A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-51	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-51	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-51A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-51A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-52	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-52	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-52A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3B-52A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-54	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-54	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-54A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-54A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-55	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	250 sf		None Detected		09-006	CT-3
3B-56	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
3B-56	3	2" Ceramic Floor Tile			Gray	115 sf				Non-Suspect	New
3B-56	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-62	3	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	210 sf		None Detected		09-013	CT-7
3B-62	3	12" x 12" Floor Tile and Mastic	FT-2 (Under Carpet)	12"x12"	Tan w/Brown and White Specks	210 sf		None Detected		09-002	FT-2 (Under Carpet)
3B-64	3	2" Ceramic Floor Tile		2"	Gray	120 sf				Non-Suspect	New
3B-64	3	4" Ceramic Wall Tile		4"	Cream	180 sf				Non-Suspect	New
3B-64	3	2' x 4' Ceiling Tile		2'x4'	Vinyl Covered Sheetrock Look	120 sf		None Detected		09-005	
3B-72	3	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	120 sf		None Detected		09-013	CT-7
3B-73	3	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	250 sf		None Detected		09-013	CT-7
3B-74	3	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	250 sf		None Detected		09-013	CT-7
3B-74	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	250 sf		None Detected		09-002	FT-2
3C-40B	3	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	120 sf		None Detected		09-013	CT-7

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-40B	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
4A-01	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
4A-03	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
4A-05	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
4A-05	4	2" Ceramic Floor Tile		2"	Gray	180 sf				Non-Suspect	New
4A-05	4	4" Ceramic Wall Tile		4"	Cream	225 sf				Non-Suspect	New
4A-07	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
4A-07	4	2" Ceramic Floor Tile		2"	Gray	180 sf				Non-Suspect	New
4A-07	4	4" Ceramic Wall Tile		4"	Cream	225 sf				Non-Suspect	New
4A-15	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	420 sf		None Detected		09-006	CT-3
4A-16	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
4A-17	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
4A-17	4	4" Ceramic Wall Tile		4"	Cream	180 sf				Non-Suspect	New
4A-19	4	No Suspect Material									
4A-20	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
4A-20	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-22	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-22	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-22 Corridor	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	875 sf		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4A-22 Corridor	4	12" x 12" Floor Tile and Mastic	FT-5	12"x12"	White w/Gray Streaks	875 sf		None Detected		09-014	FT-5
4A-23	4	Transite Panel/Pucks			Black	30 lf	Good	Assumed	Non-Friable	Assumed	(3) Register Cabinets
4A-23	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	315 sf		None Detected		09-006	CT-3
4A-23A	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	20 sf		None Detected		09-006	CT-3
4A-24	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-24	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-26	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-26	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-27	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-27	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-28	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-28	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	145 sf		None Detected		09-002	FT-2
4A-28	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-29	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-29	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-30	4	Transite Panel/Pucks			Black	20 lf	Good	Assumed	Non-Friable	Assumed	(2) Register Cabinets
4A-30	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
4A-31	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-31	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4A-32	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-32	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-33	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-34	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-34	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-35	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	115 sf		None Detected		09-006	CT-3
4A-35	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-36	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	115 sf		None Detected		09-006	CT-3
4A-38	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	80 sf		None Detected		09-006	CT-3
4A-38	4	2" Ceramic Floor Tile		2"	Gray	80 sf				Non-Suspect	New
4A-38	4	4" Ceramic Wall Tile		4"	Gray	120 sf				Non-Suspect	New
4A-40	4	No Suspect Material									
4A-42	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
4A-42	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-42 Corridor	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	875 sf		None Detected		09-006	CT-3
4A-42 Corridor	4	12" x 12" Floor Tile and Mastic	FT-5	12"x12"	White w/Gray Streaks	875 sf		None Detected		09-014	FT-5
4A-43	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-43	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-44	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4A-44	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-45	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
4A-45	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-46	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
4A-46	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-47	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-47	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-48	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
4A-48	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-50	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
4A-50	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-51	4	No Suspect Material									
4A-52	4	No Access									
4A-53	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
4A-53	4	2" Ceramic Floor Tile		2"	Gray	100 sf				Non-Suspect	New
4A-53	4	4" Ceramic Wall Tile		4"	Gray	150 sf				Non-Suspect	New
4A-54	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	220 sf		None Detected		09-006	CT-3
4A-54	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-55	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4A-55	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-56	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-56	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-57	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-57	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-58	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-58	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-59	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-59	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-60	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-60	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-61	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-61	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-62	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-62	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-63	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-63	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-64	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-64	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4A-67	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-67	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-68	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-68	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-70	4	No Access									
4B-02	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
4B-04	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
4B-06	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
4B-10	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	115 sf		None Detected		09-006	CT-3
4B-12	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	130 sf		None Detected		09-006	CT-1
4B-14	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
4B-16	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	200 sf		None Detected		09-006	CT-1
4B-19	4	Occupied									
4B-20	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	300 sf		None Detected		09-006	CT-3
4B-23	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	125 sf		None Detected		09-006	CT-3
4B-23	4	12" x 12" Floor Tile and Mastic	FT-2 (Under Carpet)	12"x12"	Tan w/Brown and White Specks	125 sf		None Detected		09-002	FT-2 (Under Carpet)
4B-23 Corridor	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	430 sf		None Detected		09-006	CT-3
4B-23 Corridor	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	430 sf		None Detected		09-002	FT-2
4B-24	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	125 sf		None Detected		09-006	CT-3



**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4B-24	4	12" x 12" Floor Tile and Mastic	FT-2 (Under Carpet)	12"x12"	Tan w/Brown and White Specks	125 sf		None Detected		09-002	FT-2 (Under Carpet)
4B-26	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	125 sf		None Detected		09-006	CT-3
4B-26	4	12" x 12" Floor Tile and Mastic	FT-2 (Under Carpet)	12"x12"	Tan w/Brown and White Specks	125 sf		None Detected		09-002	FT-2 (Under Carpet)
4B-36	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
4B-36	4	12" x 12" Floor Tile and Mastic	FT-2 (Under Carpet)	12"x12"	Tan w/Brown and White Specks	200 sf		None Detected		09-002	FT-2 (Under Carpet)
4B-40	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	130 sf		None Detected		09-002	FT-2
4B-42	4	Sheet Vinyl Floor			Cream	100 sf				Non-Suspect	New
4B-42	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-43	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
4B-43	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-44	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
4B-44	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-45	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
4B-45	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-46	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
4B-46	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-47	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
4B-47	4	Sheet Vinyl Floor			Cream	100 sf				Non-Suspect	New
4B-48	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4B-48	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-49	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
4B-49	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-50	4	2" Ceramic Floor Tile		2"	Gray	100 sf				Non-Suspect	New
4B-50	4	4" Ceramic Wall Tile		4"	Cream	150 sf				Non-Suspect	New
4B-55	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	75 sf		None Detected		09-006	CT-3
4B-55A	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	115 sf		None Detected		09-006	CT-3
4B-57	4	Sheet Vinyl Floor			Gray Mosaic	130 sf				Non-Suspect	New
4B-57A	4	Epoxy Floor			Gray	45 sf				Non-Suspect	New
4B-58	4	Sheet Vinyl Floor			Gray Mosaic	130 sf				Non-Suspect	New
4B-58 Corridor	4	Sheet Vinyl Floor			Gray Mosaic	400 sf				Non-Suspect	New
4B-58A	4	Epoxy Floor			Gray	45 sf				Non-Suspect	New
4B-59	4	Sheet Vinyl Floor			Gray Mosaic	130 sf				Non-Suspect	New
4B-59A	4	Epoxy Floor			Gray	45 sf				Non-Suspect	New
4B-60	4	Sheet Vinyl Floor			Gray Mosaic	130 sf				Non-Suspect	New
4B-60A	4	Epoxy Floor			Gray	45 sf				Non-Suspect	New
4B-62	4	Sheet Vinyl Floor			Gray Mosaic	100 sf				Non-Suspect	New
4B-63	4	Sheet Vinyl Floor			Gray Mosaic	130 sf				Non-Suspect	New
4B-63A	4	Epoxy Floor			Gray	45 sf				Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4B-64	4	No Suspect Materials									
4B-64A	4	No Suspect Materials									
4B-65	4	Sheet Vinyl Floor			Gray Mosaic	220 sf				Non-Suspect	New
4B-66	4	Sheet Vinyl Floor			Gray Mosaic	50 sf				Non-Suspect	New
4B-67	4	Sheet Vinyl Floor			Gray Mosaic	50 sf				Non-Suspect	New
4B-70	4	Transite Panel/Pucks			Black	20 lf	Good	Assumed	Non-Friable	Assumed	(2) Register Cabinets
4B-70	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	400 sf		None Detected		09-006	CT-3
4B-70A	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	25 sf		None Detected		09-006	CT-3
4B-70A	4	2" Ceramic Floor Tile		2"	Gray	25 sf				Non-Suspect	New
4B-70A	4	4" Ceramic Wall Tile		4"	Cream	50 sf				Non-Suspect	New
4B-70B	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
4B-70B	4	Sheet Vinyl Floor			Gray Mosaic	130 sf				Non-Suspect	New
4B-71	4	No Suspect Materials									
4B-72	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	130 sf		None Detected		09-002	FT-2
4B-72A	4	Epoxy Floor			Gray	25 sf				Non-Suspect	New
4B-73	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	130 sf		None Detected		09-002	FT-2
4B-73A	4	Epoxy Floor			Gray	25 sf				Non-Suspect	New
4B-74	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	130 sf		None Detected		09-002	FT-2
4B-74A	4	Epoxy Floor			Gray	25 sf				Non-Suspect	New

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4B-75	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	130 sf		None Detected		09-002	FT-2
4B-75 Corridor	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	400 sf		None Detected		09-006	CT-3
4B-75 Corridor	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	400 sf		None Detected		09-002	FT-2
4B-75A	4	Epoxy Floor			Gray	25 sf				Non-Suspect	New
4B-76	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	130 sf		None Detected		09-002	FT-2
4B-76A	4	Epoxy Floor			Gray	25 sf				Non-Suspect	New
Stairwell #9	1	Thermal System Insulation			Gray	10 lf	Good	Assumed	Friable	Assumed	In Wall
Stairwell #9	2	Thermal System Insulation			Gray	10 lf	Good	Assumed	Friable	Assumed	In Wall
Stairwell #9	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Wall
Stairwell #9	1	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
Stairwell #9	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
Stairwell #9	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
Stairwell #9	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
Stairwell #10	1	Thermal System Insulation			Gray	10 lf	Good	Assumed	Friable	Assumed	In Wall
Stairwell #10	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Wall
Stairwell #10	1	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
Stairwell #10	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
Stairwell #13	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2
Stairwell #13	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
Stairwell #14	2	Sheet Vinyl Floor			Cream	200 sf				Non-Suspect	New
Stairwell #14	3	Sheet Vinyl Floor			Cream	120 sf				Non-Suspect	New
Stairwell #14	4	Sheet Vinyl Floor			Cream	120 sf				Non-Suspect	New
Stairwell #15	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	Above Hatch



## 4.2 – Additional Observations

No additional observations were noted.

## 4.3 – Cost Estimate for Asbestos Abatement

Material	Sample Reference	Location	Low Price Per sq/ln ft	High Price per ln/sq ft	Total Square/Linear Feet of ACM	Low End Removal Cost	High End Removal Cost
12"x12" Floor Tile and Mastic	09-001	BA-65 Renovation Area; 1B-71; 1B-74	\$7.00	\$9.00	635	\$4,445.00	\$5,715.00
12"x12" Floor Tile and Mastic	09-012	2A-29 Corridor, 2A-52 Corridor, 3B-06	\$7.00	\$9.00	1680	\$11,760.00	\$15,120.00
Transite Panels/Pucks	Assumed	Throughout	\$12.00	\$19.00	840	\$10,080.00	\$15,960.00
Thermal System Insulation	Assumed	Throughout	\$12.00	\$19.00	1066	\$12,792.00	\$20,254.00
12" Transite Pipe	Assumed	3B-06	\$12.00	\$19.00	10	\$120.00	\$190.00

## 5.0 – RECOMMENDATIONS

### 5.1 – Recommendations for Regulated ACM (RACM)

#### Thermal System Insulation (TSI):

If present, these materials must be removed prior to any activity that would release asbestos fibers from this material. Specifically, any renovation or demolition activity that will crush, abrade, or dissolve the matrix of this material must be performed by a North Dakota licensed Asbestos Contractor. If these materials are in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

### 5.2 – Recommendations for Category I Non-Friable ACM (C1NF)

#### Floor Tile and Floor Tile Mastic:

If present, these materials identified as Category I Non-Friable ACM are required to be removed by a North Dakota licensed asbestos contractor if proposed renovations or demolition will impact these materials in such a manner as to render them friable and thus RACM. Specifically, any renovation or demolition activity that will crush, abrade, or dissolve the matrix of these materials then they must first be removed by a North Dakota-licensed Asbestos Contractor. If these materials are in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

### 5.3 – Recommendations for Category II Non-Friable ACM (C2NF)

#### Transite™ Panels and Transite™ Panel Pucks

If present, these materials identified as Category II Non-friable ACM must be removed prior to any renovation or demolition activity that will crush, abrade, or dissolve the matrix of this material. The removal of this material must be performed by a North Dakota licensed Asbestos Contractor. If this material is in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

### 5.4 – General Recommendations

Based on the asbestos survey and sampling results, TRINE has the following recommendations:

- Each type of asbestos that will need to be removed as part of any renovation or demolition project in North Dakota are required to be removed, handled, and disposed of as ACM waste by a licensed North Dakota asbestos abatement contractor regardless if the material is a RACM, C1NF, or C2NF in accordance with the North Dakota Department of Environmental Quality (DEQ).
- The VA employ an independent industrial hygienist (VPIH/CPIH) consultant and/or use its own IH to perform various services of the VA. The VPIH/CPIH will perform the necessary monitoring, inspection, testing, and other support services to ensure that VA patients, employees, and visitors will not be adversely affected by the abatement work in accordance with ***Veterans Administration (VA), Section 02 82 11, Traditional Asbestos Abatement***
- TRINE recommends final air testing in addition to final visual inspection of abatement areas prior to deregulation of contained work areas.
- Suspect materials discovered after this inspection should be sampled and analyzed to determine asbestos content and to initiate appropriate responses.

North Dakota DEQ and the US Environmental Protection Agency require notification of intent to renovate or demolish when asbestos is present. Notification must be sent at least 10 working days prior to the start of any construction activities. The general contractor should also keep a copy of this survey at the construction site during the entire construction project as proof of compliance with 40 CFR 61 (NESHAP).

## 6.0 – SIGNATURE PAGE

Submitted by:



---

John R Rogers  
President  
Asbestos Building Inspector (NY) 16-11678



---

Dan Johnson  
Asbestos Building Inspector (ND) 6804



## APPENDIX A – LABORATORY CERTIFICATE OF ANALYSIS

**NOTE: Results for the above referenced samples are located on page 65 beginning with sample # 09-001**

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**



**EMSL Analytical, Inc.**  
 3410 Winnetka Avenue North New Hope, MN 55427  
 Tel/Fax: (763) 449-4922 / (763) 449-4924  
<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203398  
 Customer ID: TREV42  
 Customer PO:  
 Project ID:

**Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy**

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
01-057G-Skim Coat only 352203396-0024	BE-38 - Hard-Lid Plaster Ceiling (white/gray)	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-058 352203396-0025	BE-46 - Fire stop (red)	Red Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
09-001-Floor Tile 352203396-0026	BA-65 - 12"x12" Floor tile (Gray/Brown/white)	Tan Non-Fibrous Heterogeneous		97% Non-fibrous (Other)	3% Chrysotile
09-001-Tan Mastic 352203396-0026A	BA-65 - 12"x12" Floor tile (Gray/Brown/white)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-001-Black Mastic 352203396-0026B	BA-65 - 12"x12" Floor tile (Gray/Brown/white)	Black Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-002-Floor Tile 352203396-0027	BA-65 - 12"x12" Floor tile (Tan w/ Brown and white specks)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-002-Tan Mastic 352203396-0027A	BA-65 - 12"x12" Floor tile (Tan w/ Brown and white specks)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-002-Black Mastic 352203396-0027B	BA-65 - 12"x12" Floor tile (Tan w/ Brown and white specks)	Black Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-003 352203396-0028	BA-65 - Concrete Floor Trench Seam Caulk	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
09-004 352203396-0029	BB-44 - 2'x4' Ceiling Tile (widthwise fissures)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-005 352203396-0030	BB-15B - 2'x4' Ceiling Tile (vinyl covered sheetrock look)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-006 352203396-0031	BB-22 - 2'x2' ceiling Tile (Long fissures w/ Pinholes)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-007 352203396-0032	BB-55 Corridor - 2'x2' ceiling Tile (Rough Texture)	Tan/White Fibrous Homogeneous	95% Min. Wool	5% Non-fibrous (Other)	None Detected
09-008A 352203396-0033	BB-09 - spray-on fireproofing	White Fibrous Homogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
09-008B 352203396-0034	BB-09 - spray-on fireproofing	White Fibrous Homogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
09-008C 352203396-0035	BB-09 - spray-on fireproofing	White Fibrous Homogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
09-009 352203396-0036	BB-67 North/South Corridor - 2'x2' ceiling tile (Random fissures)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-010 352203396-0037	1A-30B - 2'x2' ceiling tile (vinyl covered sheetrock Look)	Tan/White Fibrous Homogeneous	40% Cellulose 40% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected

Initial report from: 04/21/2022 17:02:38



**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**



**EMSL Analytical, Inc.**  
 3410 Winnetka Avenue North New Hope, MN 55427  
 Tel/Fax: (763) 449-4922 / (763) 449-4924  
<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203398  
 Customer ID: TREV42  
 Customer PO:  
 Project ID:

**Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy**

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
09-011-Floor Tile 352203396-0038	1B-73 - 12"x12" Floor Tile (white w/ black specks)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-011-Mastic 352203396-0038A	1B-73 - 12"x12" Floor Tile (white w/ black specks)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-012-Floor Tile 352203396-0039	2A-66 Corridor - 12"x12" Floor tile (white w/ gold)	White Non-Fibrous Heterogeneous		96% Non-fibrous (Other)	4% Chrysotile
09-012-Mastic 352203396-0039A	2A-66 Corridor - 12"x12" Floor tile (white w/ gold)	Black Non-Fibrous Heterogeneous		90% Non-fibrous (Other)	10% Chrysotile
09-013 352203396-0040	2A-34 - 2'x4' Ceiling Tile (Random fissures)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-014-Floor Tile 352203396-0041	4A-40 Corridor - 12"x12" (white w/ gray streaks)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-014-Mastic 352203396-0041A	4A-40 Corridor - 12"x12" (white w/ gray streaks)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-015 352203396-0042	Penthouse - Building seam filler (gray)	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
09-016 352203396-0043	Penthouse - West old window glazing (Gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-017 352203396-0044	Penthouse - SE Mud at floor duct (white/gray)	Beige Fibrous Heterogeneous	20% Min. Wool	80% Non-fibrous (Other)	None Detected
09-018-Insulation 352203396-0045	Penthouse - Ceiling Fiberglass Insulation Backing (Black)	Pink Fibrous Heterogeneous	95% Min. Wool	5% Non-fibrous (Other)	None Detected
09-018-Wrap 352203396-0045A	Penthouse - Ceiling Fiberglass Insulation Backing (Black)	Tan/Black/Silver Fibrous Heterogeneous	50% Cellulose	50% Non-fibrous (Other)	None Detected
09-019 352203396-0046	Penthouse - Tar Paper by Windows (Black)	Black Fibrous Homogeneous	45% Cellulose	55% Non-fibrous (Other)	None Detected
09-020 352203396-0047	BA-65 - Fire Stop (Red)	Red Non-Fibrous Homogeneous	10% Glass	90% Non-fibrous (Other)	None Detected
09-021A-Skim Coat 352203396-0048	BA-65 (outside corridor) - Hard Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-021A-Plaster 352203396-0048A	BA-65 (outside corridor) - Hard Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-021B-Skim Coat 352203396-0049	BA-65 (outside corridor) - Hard Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-021B-Plaster 352203396-0049A	BA-65 (outside corridor) - Hard Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected

Initial report from: 04/21/2022 17:02:38

**ASBESTOS SURVEY – 2022**  
**Fargo VAMC – Building 9**



**EMSL Analytical, Inc.**  
 3410 Winnetka Avenue North New Hope, MN 55427  
 Tel/Fax: (763) 449-4922 / (763) 449-4924  
<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203398  
 Customer ID: TREV42  
 Customer PO:  
 Project ID:

**Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy**

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
09-021C-Skim Coat 352203398-0050	BA-65 (outside corridor) - Hard Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-021C-Plaster 352203398-0050A	BA-65 (outside corridor) - Hard Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022A-Skim Coat 352203398-0051	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022A-Plaster 352203398-0051A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022B-Skim Coat 352203398-0052	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022B-Plaster 352203398-0052A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022C-Skim Coat 352203398-0053	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022C-Plaster 352203398-0053A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022D-Skim Coat 352203398-0054	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022D-Plaster 352203398-0054A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022E-Skim Coat 352203398-0055	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022E-Plaster 352203398-0055A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022F-Skim Coat 352203398-0056	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022F-Plaster 352203398-0056A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022G-Skim Coat 352203398-0057	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022G-Plaster 352203398-0057A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-023 352203398-0058	BA-65 - Sheetrock/Tape/compound	Tan/White Fibrous Heterogeneous	10% Cellulose <1% Glass	<1% Mica 90% Non-fibrous (Other)	None Detected

*This is a composite result of wallboard, p. compound, and tape*

Initial report from: 04/21/2022 17:02:38

ASB\_PLM\_0008\_0001 - 1.78 Printed: 4/21/2022 4:02 PM

Page 5 of 6


ASBESTOS SURVEY – 2022  
Fargo VAMC – Building 9



**EMSL Analytical, Inc.**  
3410 Winnetka Avenue North New Hope, MN 55427  
Tel/Fax: (763) 449-4922 / (763) 449-4924  
<http://www.EMSL.com> / [minneapolislab@emsl.com](mailto:minneapolislab@emsl.com)

EMSL Order: 352203398  
Customer ID: TREV42  
Customer PO:  
Project ID:

Analyst(s)  
Lynn Scott (87)

  
Rachel Travis, Laboratory Manager  
or Other Approved Signatory


EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. New Hope, MN NVLAP Lab Code 200019-0 Colorado AL-24478

Initial report from: 04/21/2022 17:02:38



**APPENDIX B – ASBESTOS INSPECTOR CERTIFICATION**

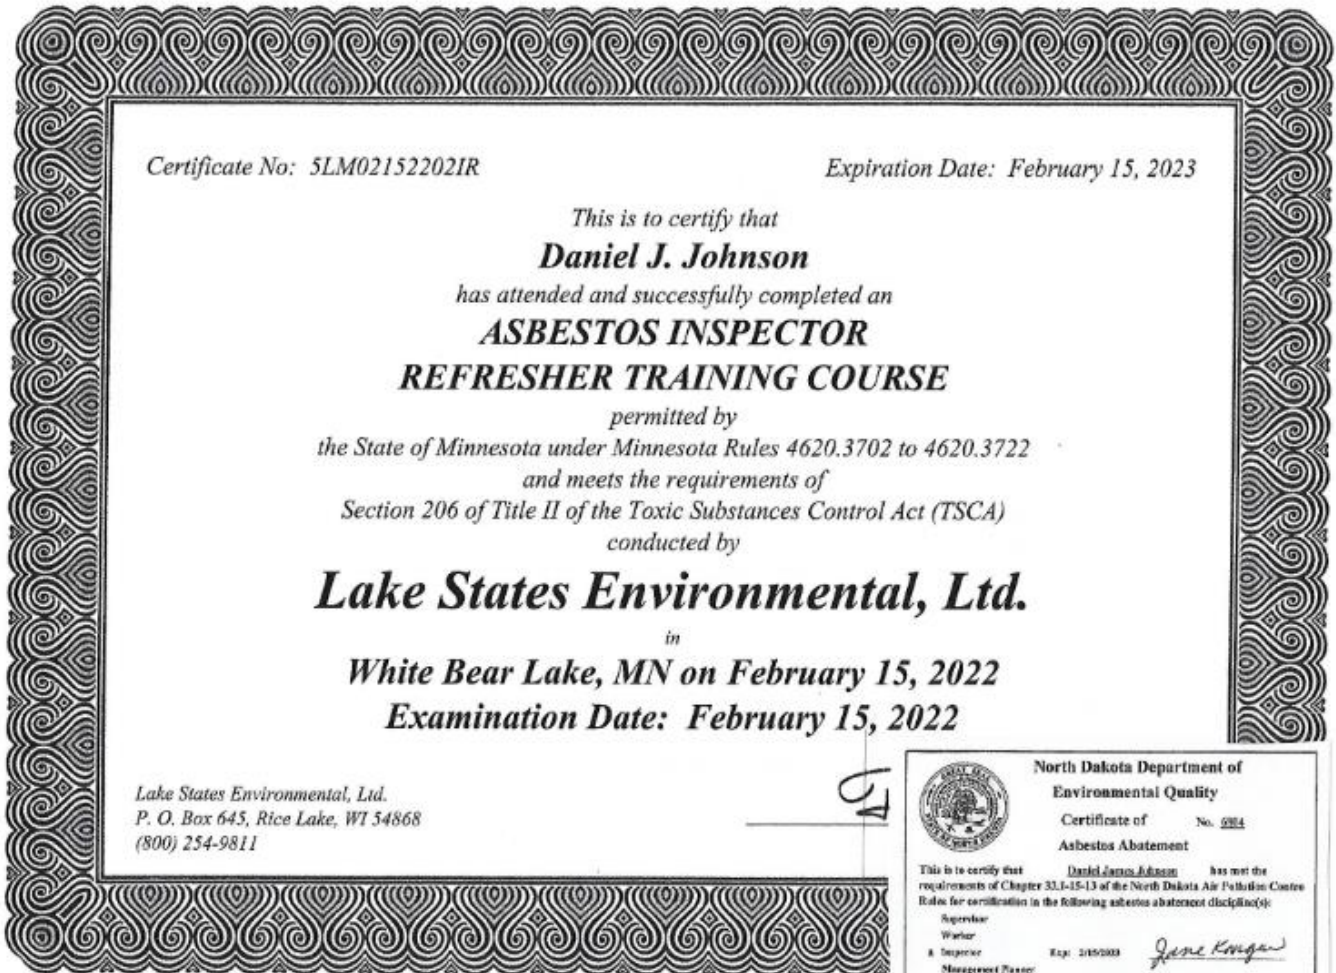

Certificate No: 5LM02152202IR

Expiration Date: February 15, 2023

This is to certify that

**Daniel J. Johnson**

has attended and successfully completed an

**ASBESTOS INSPECTOR  
REFRESHER TRAINING COURSE**

permitted by

the State of Minnesota under Minnesota Rules 4620.3702 to 4620.3722

and meets the requirements of

Section 206 of Title II of the Toxic Substances Control Act (TSCA)

conducted by

**Lake States Environmental, Ltd.**

in

**White Bear Lake, MN on February 15, 2022**

**Examination Date: February 15, 2022**

Lake States Environmental, Ltd.  
P. O. Box 645, Rice Lake, WI 54868  
(800) 254-9811

57

North Dakota Department of  
Environmental Quality  
Certificate of No. 0004  
Asbestos Abatement

This is to certify that **Daniel James Johnson** has met the requirements of Chapter 33.1-15-13 of the North Dakota Air Pollution Control Rules for certification in the following asbestos abatement discipline(s):

Supervisor  
Worker  
Inspector  
Management Planner  
Project Designer  
Project Monitor

Exp: 2/15/2023 *Jane Krizan*  
Asbestos Control Program