

ASBESTOS SURVEY – 2022
Fargo VA Medical Center – Building 46
2101 Elm Street North
Fargo, ND 58102



PREPARED FOR:

Ron Tollefson (VA COR)
2101 Elm Street North
Fargo, ND 58102

PREPARED BY:

TRINE Environmental, Inc. (SDVOSB)
6678 Morningdale Dr.
Brighton, MI

Dan Johnson
Asbestos Inspector (ND 6804)

John R Rogers
President



Table of Contents

1.0 – INTRODUCTION	3
2.0 – SITE HISTORY & DESCRIPTION	3
3.0 – METHODS & LIMITATIONS.....	3
3.1 – Asbestos Survey Methods.....	3
3.2 – Laboratory Analytical Methods	5
3.3 – Limitations	5
4.0 – SURVEY RESULTS	6
4.1 – Asbestos Analysis Results	6
Table 1 – Analytical Results	8
Table 2 – Room by Room	9
4.2 – Additional Observations	40
4.3 – Cost Estimate for Asbestos Abatement.....	40
5.0 – RECOMMENDATIONS	40
5.1 – Recommendations for Regulated ACM (RACM).....	40
5.2 – Recommendations for Category I Non-Friable ACM (C1NF).....	40
5.3 – Recommendations for Category II Non-Friable ACM (C2NF)	40
5.4 – General Recommendations.....	41
6.0 – SIGNATURE PAGE.....	41
APPENDIX A – LABORATORY CERTIFICATE OF ANALYSIS	42
APPENDIX B – ASBESTOS INSPECTOR CERTIFICATION	46

1.0 – INTRODUCTION

An asbestos survey was conducted at the Veterans Administration Medical Center (VAMC) Fargo Health Care System (HCS), 2101 Elm Street North Fargo, ND 58102. The survey was conducted between February 28th and March 31st, 2022, by Dan Johnson of TRINE Environmental, Inc., an EPA-certified building inspector in the state of North Dakota.

The purpose of this asbestos survey was to identify the presence, and extent of asbestos containing materials (ACM) in seventeen (17) buildings, incorporate previously performed asbestos survey, and create a new database in support of future plans to renovate which may require demolition activities. Each building was considered a separate homogenous area (HA).

The inspection was performed by a certified EPA asbestos building inspector, experienced in identifying and sampling suspect ACM. All areas of Building 46 were accessed and inspected.

Suspect materials were sampled to determine asbestos content.

All samples collected were analyzed at EMSL Analytical, Inc., (EMSL) an AIHA and NVLAP accredited asbestos laboratory, using either Polarized Light Microscopy (PLM) methods or Transmission Electron Microscopy (TEM) methods. A total of seventeen (17) samples were collected and analyzed.

Laboratory Certificates of Analysis are located in Appendix A of this report. Company and individual licenses and certifications are located in Appendix B.

2.0 – SITE HISTORY & DESCRIPTION

The Fargo VA HCS campus is made up of 17 buildings that first started construction in 1929 with major expansions in 1945 and 1983 but have also been under constant renovations of various magnitudes over the last 92 years. Currently the campus has approximately 576,000 interior gross square feet (GSF).

3.0 – METHODS & LIMITATIONS

3.1 – Asbestos Survey Methods

The site was inspected for suspect ACM, unless otherwise noted. Each observed suspect material was assigned a material identification within the homogenous area (HA), such as ceiling tile (CT), floor tile (FT), Thermal System Insulation (TSI) or miscellaneous (MISC), described, and measured. Each observed suspect material was sampled except for those that were confirmed positive from previous sampling events or determined to non-suspect material. Samples of suspect ACM were collected using procedures established by the United States Environmental Protection Agency (USEPA) Code of Federal Regulations (CFR) Title 40 Part 763 Subpart E, Asbestos Containing Materials in Schools.

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Upon completing an initial walkthrough, the asbestos inspector began a thorough inspection identifying probable ACM and categorizing by material identification. Each material identification represented a group of material having similar characteristics such as appearance, color and manner in which it was used.

ACM's were divided into three categories:

1. **Surfacing Materials:** material that is sprayed-on, troweled on, or otherwise applied to surfaces, such as acoustical plaster on ceilings and fireproofing materials on structural members, or other materials on surfaces for acoustical, fireproofing or other purposes
2. **Thermal System Insulation (TSI):** material applied to pipes, fittings, boilers, breeching, tanks, ducts, or other structural components to prevent heat loss or gain, or water condensation, or for other purposes
3. **Miscellaneous ACM:** interior building material on structural components, structural members or fixtures, such as floor and ceiling tiles, and does not include surfacing material or thermal insulation

ACM's inventoried in this survey are classified as either friable or non-friable. Friable ACM can be crumbled or reduced to powder by hand pressure whereas non-friable ACM cannot.

The EPA asbestos NESHAP regulation further classifies non-friable ACM into two categories:

1. **Category I:** Non-friable ACM includes any asbestos-containing packing, gasket, resilient floor covering or asphalt roofing product
2. **Category II:** Non-friable ACM includes any non-friable ACM other than Category I non-friable ACM

Samples were collected in airtight sealed bags for transportation to EMSL. for analysis. Standard Operating Procedures dictated samples were collected in manner consistent with health and safety protocols, using personal hygiene methods, using wet methods as required, and donning proper Personal Protective Equipment (PPE). These methods were used to prevent asbestos airborne contamination from being introduced to the hospital's atmosphere and to minimize employee, staff, and patient exposure.

Lab data pertaining to the samples analyzed is located in Appendix A of this report and each sample is listed as follows:

- Date Analyzed
- Field Sample #
- Lab Sample #
- Sample Location
- Asbestos Content
- Non-Asbestos Content

Samples were analyzed using PLM methods and Point Count Methods for any sample returning a $\leq 5\%$ (less than or equal to) result, excluding non-detects.

3.2 – Laboratory Analytical Methods

All samples collected during the survey were analyzed at EMSL, an A.I.H.A. and NVLAP certified laboratory. Upon arrival at the laboratory, the samples were logged-in and submitted for analysis.

PLM samples were analyzed utilizing the Environmental Protection Agency’s test method: Methods for the determination of Asbestos in Bulk Building Materials (EPA 600/R-93/116, July 1993) and the McCrone Research Institute’s The Asbestos Particle Atlas as the principal analytical references. Additional treatment and tests may be required to accurately define composition (i.e. ashing, extraction, acetone treatment, and TEM).

The PLM method utilizes a light microscope equipped with polarizing filters. The identification of asbestos fiber bundles is determined by the visual properties displayed when the sample is treated with various dispersion staining liquids. Identification is substantiated by the actual structure of the fiber and the effect of polarized light on the fiber, all of which is viewed by a trained technician. The limit of detection of asbestos by PLM is about one percent (1%) by area. Samples containing lower levels of asbestos are not reliably detectable by this technique.

Analysis was performed by using the bulk sample for visual observation and slide preparation(s) for microscopic examination and identification. The samples were analyzed for asbestos (chrysotile, amosite, crocidolite, anthophyllite, and actinolite/tremolite), fibrous non-asbestos constituents (cellulose, synthetic, etc.) and non-fibrous constituents. Using a stereoscope, the microscopist visually estimated relative amounts of each constituent by determining the volume of each constituent in proportion to the total volume of the sample.

The asbestos National Emission Standards for Hazardous Air Pollutants (NESHAP) recommends that asbestos bulk samples that are less than 10% by PLM are to be analyzed by point counting for friable ACM and mandates point counting when PLM results for friable ACM are in trace amounts (< 1%) in order to declare that the material is non-asbestos containing. The point-count procedure mandated by NESHAP is in the EPA “Interim” Bulk Method. For each layer to be point counted, eight mounts are made by dispersing 8 pinches of sample in suitable fluid. Each of the mounts is examined under the polarizing light microscope using an eyepiece reticule that superimposes a grid of points over the field of view. Fifty non-empty points are examined for each mount, yielding 400 points – some of which would be identified as asbestos and the rest as non-asbestos material.

Transmission Electron Microscopy (TEM) analysis is used to quantify and identify asbestos structures using electron diffraction and energy dispersive X-ray (EDX) analysis. Identification of chrysotile or amphibole crystalline structures can be consistently determined via the electron-diffraction capabilities of modern TEMs. The five amphibole types can be differentiated based on their elemental composition when EDX analysis is combined with their electron diffraction patterns.

3.3 – Limitations

This asbestos survey report has been prepared by TRINE in a manner consistent with that level of care and skill ordinarily exercised by members of the profession currently practicing under similar conditions. No other warranty expressed or implied is made. The intent of this survey report is to assist the building owner or management in locating ACM. This document is not intended to be utilized as a proposal or a project design document for the remediation of asbestos materials discovered during this investigation.

The survey was conducted to identify suspect ACM on the interior areas of Building 46. Some ACM may not have been discovered due to inaccessibility. Any suspect materials discovered subsequent to the issue of this survey report should be sampled and analyzed to determine asbestos content and to initiate appropriate responses.

TRINE's interpretations and recommendations are based upon the results of sample collection and analyses in compliance with environmental regulations, quality control and assurance standards, and the scope of work. The results, conclusions, and recommendations contained in this report pertain to conditions observed at the time of the survey.

The field observations, measurements, and research reported herein are considered sufficient in detail and scope to form a reasonable basis for an Asbestos Survey Report. The assessment, conclusions, and recommendations presented herein are based upon the sample analysis results of collected materials within the Homogenous Area. They may not represent all conditions at the subject site as they reflect the information gathered from specific locations. TRINE Environmental, Inc. warrants the findings and conclusions contained herein have been promulgated in accordance with generally accepted industrial hygiene methodology and only for the site described in this report.

Reliance on or use by any such third-party without explicit authorization in the report does not make said third-party a third-party beneficiary to TRINE's contract with the VA. Any such unauthorized reliance on or use of this report, including any of its information or conclusions, will be at third-party's risk. For the same reasons, no warranties or representations, expressed or implied in this report, are made to any such third party.

This report has been developed to provide the client with information regarding apparent conditions relating to the subject property. Although TRINE believes that the findings and conclusions provided in this report are reasonable, the report is necessarily limited to the conditions observed and to the information available at the time of the work. Due to the nature of the work, there is a possibility conditions exist that could not be identified within the scope of the inspection, or which were not apparent at the time of our site work. The report is also limited to information available from the client at the time it was conducted. It is also possible that the testing methods employed at the time of the report may later be superseded by other methods. TRINE does not accept responsibility for changes in the state of the art.

4.0 – SURVEY RESULTS

4.1 – Asbestos Analysis Results

A total of seventeen (17) samples were collected and analyzed by PLM. The original laboratory report and certificate of analysis are located in Appendix A.

The following tables summarize the samples collected and quantity of materials that contain asbestos in amounts >1% (greater than). Table 1 provides the analytical results of the samples submitted to the laboratory. Table 2 provides a room-by-room breakdown of the materials identified and sample number associated with the analytical results.

TABLE LEGEND

NAD: No Asbestos Detected

ACM Material with type and percent detected

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Table 1 – Analytical Results

Sample Numbers	Location / Homogeneous Area	Material Description	Material Type	Exterior Description	Quantity	AHERA Material Category	Condition	Potential for Future Damage	Asbestos Content	Notes
46-001	BA-01	Black Wall Mastic	Misc	Black	1	Miscellaneous	Good	Little/No	None Detected	
46-002	BB-80	2' x 2' Ceiling Tile	Misc	Long Fissures	1	Miscellaneous	Good	Little/No	None Detected	CT-1
46-003	BB-80	12" x 12" Floor Tile	Misc	White w/Gold	1	Miscellaneous	Good	Little/No	None Detected	FT-1
46-004	BB-75	12" x 12" Floor Tile	Misc	White w/Gray Streaks	1	Miscellaneous	Good	Little/No	None Detected	FT-2
46-005	Corridor by Stairwell #15	12" x 12" Floor Tile	Misc	Cream/Tan/ Brown	1	Miscellaneous	Good	Little/No	None Detected	FT-3
46-006	Corridor Outside BB-70	2' x 2' Ceiling Tile	Misc	Random Fissure	1	Miscellaneous	Good	Little/No	None Detected	CT-2
46-007	Corridor Outside BC-41	12" x 12" Floor Tile	Misc	Cream Specks	1	Miscellaneous	Good	Little/No	None Detected	FT-4
46-008	BB-96	2' x 4' Ceiling Tile	Misc	Random Fissure	1	Miscellaneous	Good	Little/No	None Detected	CT-3
46-009	Corridor Outside 1C-17	12" x 12" Floor Tile	Misc	White w/Black Specks	1	Miscellaneous	Good	Little/No	None Detected	FT-5
46-010	Corridor by 1C-11	2' x 2' Ceiling Tile	Misc	Random Fissure (Drop in)	1	Miscellaneous	Good	Little/No	None Detected	CT-4
46-011	1C-06	2' x 4' Ceiling Tile	Misc	Widthwise Fissure	1	Miscellaneous	Good	Little/No	None Detected	CT-5
46-012	1B-128B	2' x 2' Ceiling Tile	Misc	Vinyl Covered Sheetrock Look	1	Miscellaneous	Good	Little/No	None Detected	CT-6
46-013	2B-10	12" x 12" Floor Tile	Misc	White w/Red Streaks	1	Miscellaneous	Good	Little/No	None Detected	FT-6
46-014	3C-10	2' x 2' Ceiling Tile	Misc	Rough Texture	1	Miscellaneous	Good	Little/No	None Detected	CT-7
46-015A-G	BC-20 Throughout	Spray On Fireproofing	Misc	White/Gray	1	Surfacing Material	Good	Little/No	None Detected	
46-016	4C-05	12" x 12" Vinyl Floortile	Misc	Brn/Green/Red/Blk Specks (stick down)	1	Miscellaneous	Good	Little/No	None Detected	FT-7
46-017	BC-20	Sheetrock/Tape/Compound	Misc	White	1	Surfacing Material	Good	Little/No	None Detected	

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Table 2 – Room by Room

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BA-01	B	Black Wall Mastic	Misc		Black	300 sf	Good	None Detected		46-001	
BA-01A	B	No Suspect Material									
BA-01B	B	No Suspect Material									
BA-01 Corridor	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	250 sf	Good	None Detected		46-005	FT-3
BC-01	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
BC-01	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
BC-02	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
BC-02	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
BC-05	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	1,100 sf	Good	None Detected		46-002	CT-1
BC-05A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-05B	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-05C	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-10	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	410 sf	Good	None Detected		46-002	CT-1
BC-11	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	200 sf	Good	None Detected		46-002	CT-1
BC-11A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-12	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-13	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-15	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	1,000 sf	Good	None Detected		46-002	CT-1



ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BC-15A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	125 sf	Good	None Detected		46-002	CT-1
BC-20	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	3,100 sf	Good	None Detected		46-002	CT-1
BC-20A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-20B	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-20 Corridor	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	1,200 sf	Good	None Detected		46-006	CT-2
BC-20 Corridor	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	1,200 sf	Good	None Detected		46-005	FT-3
BC-24	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	25 sf	Good	None Detected		46-006	CT-2
BC-24	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	25 sf	Good	None Detected		46-005	FT-3
BC-30	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
BC-30 Corridor	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-30 Corridor	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
BC-32	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
BC-34	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
BC-41	B	No Suspect Material									
BC-43	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-44	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-44	B	12" x 12" Floortile	Misc	12"	Cream Specks	300 sf	Good	None Detected		46-007	FT-4
BC-45	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-45	B	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BC-46	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-46	B	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
BC-47	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	300 sf	Good	None Detected		46-002	CT-1
BC-47	B	12" x 12" Floortile	Misc	12"	Cream Specks	300 sf	Good	None Detected		46-007	FT-4
BC-47 Corridor	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	525 sf	Good	None Detected		46-002	CT-1
BC-47 Corridor	B	12" x 12" Floortile	Misc	12"	Cream Specks	525 sf	Good	None Detected		46-007	FT-4
BC-50	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	450 sf	Good	None Detected		46-002	CT-1
BC-50	B	12" x 12" Floortile	Misc	12"	Cream Specks	450 sf	Good	None Detected		46-007	FT-4
BC-50A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	250 sf	Good	None Detected		46-002	CT-1
BC-50A	B	12" x 12" Floortile	Misc	12"	Cream Specks	250 sf	Good	None Detected		46-007	FT-4
BC-52	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-54	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-54A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	200 sf	Good	None Detected		46-002	CT-1
BC-56	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-56	B	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
BC-58	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-58	B	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
BC-59	B	No Suspect Material									
BC-60	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	450 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-72A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
BB-72A	B	12" x 12" Floortile	Misc	12"	White w/Gold	120 sf	Good	None Detected		46-003	FT-1
BB-75	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	500 sf	Good	None Detected		46-002	CT-1
BB-75	B	12" x 12" Floortile	Misc	12"	White w/Gray Streaks	500 sf	Good	None Detected		46-004	FT-2
BB-76	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	330 sf	Good	None Detected		46-002	CT-1
BB-76	B	12" x 12" Floortile	Misc	12"	Cream Specks	330 sf	Good	None Detected		46-007	FT-4
BB-78	B	Sheet Vinyl Floor	Misc		Gray	200 sf	Good			Non-Suspect	New
BB-79	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
BB-79	B	12" x 12" Floortile	Misc	12"	White w/Gold	150 sf	Good	None Detected		46-003	FT-1
BB-80	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	2,100 sf	Good	None Detected		46-002	CT-1
BB-80	B	12" x 12" Floortile	Misc	12"	White w/Gold	2,100 sf	Good	None Detected		46-003	FT-1
BB-80A	B	12" x 12" Floortile	Misc	12"	White w/Gold	120 sf	Good	None Detected		46-003	FT-1
BB-80B	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	40 sf	Good	None Detected		46-012	CT-6
BB-80B	B	2" Ceramic Flooring	Misc	2"	Gray	40 sf	Good			Non-Suspect	New
BB-80B	B	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
BB-80C	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	30 sf	Good	None Detected		46-002	CT-1
BB-80C	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	30 sf	Good	None Detected		46-005	FT-3
BB-90	B	Sheet Vinyl Floor	Misc		Gray	140 sf	Good			Non-Suspect	New
BB-90A	B	Sheet Vinyl Floor	Misc		Gray	200 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-90B	B	Sheet Vinyl Floor	Misc		Gray	150 sf	Good			Non-Suspect	New
BB-91	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	25 sf	Good	None Detected		46-006	CT-2
BB-91	B	12" x 12" Floortile	Misc	12"	Cream Specks	25 sf	Good	None Detected		46-007	FT-4
BB-92	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
BB-92	B	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
BB-93	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	200 sf	Good	None Detected		46-006	CT-2
BB-93	B	12" x 12" Floortile	Misc	12"	Cream Specks	200 sf	Good	None Detected		46-007	FT-4
BB-93 Corridor	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	400 sf	Good	None Detected		46-006	CT-2
BB-93 Corridor	B	12" x 12" Floortile	Misc	12"	Cream Specks	400 sf	Good	None Detected		46-007	FT-4
BB-94	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	145 sf	Good	None Detected		46-006	CT-2
BB-94	B	12" x 12" Floortile	Misc	12"	Cream Specks	145 sf	Good	None Detected		46-007	FT-4
BB-95	B	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	1,650 sf	Good	None Detected		46-008	CT-3
BB-95	B	Rubber Floor	Misc		Black	1,650 sf	Good			Non-Suspect	New
BB-95A	B	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	265 sf	Good	None Detected		46-008	CT-3
BB-95A	B	2" Ceramic Flooring	Misc	2"	Gray	265 sf	Good			Non-Suspect	New
BB-95A	B	4" Ceramic Wall Tile	Misc	4"	Cream	400 sf	Good			Non-Suspect	New
BB-95B	B	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	265 sf	Good	None Detected		46-008	CT-3
BB-95B	B	2" Ceramic Flooring	Misc	2"	Gray	265 sf	Good			Non-Suspect	New
BB-95B	B	4" Ceramic Wall Tile	Misc	4"	Cream	400 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-96	B	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	670 sf	Good	None Detected		46-008	CT-3
BB-96	B	Rubber Floor	Misc		Black	670 sf	Good			Non-Suspect	New
BB-97	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
BB-97	B	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
BB-100	B	No Suspect Material									
1A-01	1	No Suspect Material									
1A-01 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	300 sf	Good	None Detected		46-002	CT-1
1A-01 Corridor	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	300 sf	Good	None Detected		46-005	FT-3
1C-01	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-01	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-02	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-02	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-03	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-03	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-04	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	115 sf	Good	None Detected		46-002	CT-1
1C-05	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
1C-05	1	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
1C-05	1	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
1C-06	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	40 sf	Good	None Detected		46-011	CT-5

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-06	1	2" Ceramic Flooring	Misc	2"	Gray	40 sf	Good			Non-Suspect	New
1C-06	1	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
1C-07	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-07	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-08	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-08	1	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
1C-09	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	50 sf	Good	None Detected		46-008	CT-3
1C-09	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	50 sf	Good	None Detected		46-009	FT-5
1C-10	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	120 sf	Good	None Detected		46-010	CT-4
1C-10	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	120 sf	Good	None Detected		46-009	FT-5
1C-10 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	300 sf	Good	None Detected		46-010	CT-4
1C-10 Corridor	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	300 sf	Good	None Detected		46-009	FT-5
1C-11	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	100 sf	Good	None Detected		46-010	CT-4
1C-11	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-11 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	300 sf	Good	None Detected		46-010	CT-4
1C-11 Corridor	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	300 sf	Good	None Detected		46-009	FT-5
1C-13	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	100 sf	Good	None Detected		46-010	CT-4
1C-13	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-14	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-14	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	120 sf	Good	None Detected		46-005	FT-3
1C-14A	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
1C-14A	1	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
1C-14A	1	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
1C-15	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	100 sf	Good	None Detected		46-010	CT-4
1C-15	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-16	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	180 sf	Good	None Detected		46-002	CT-1
1C-16	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	180 sf	Good	None Detected		46-005	FT-3
1C-17	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	75 sf	Good	None Detected		46-002	CT-1
1C-17	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	75 sf	Good	None Detected		46-009	FT-5
1C-18	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	80 sf	Good	None Detected		46-002	CT-1
1C-18	1	Sheet Vinyl Floor	Misc		Blue/Pink/Gray/White	80 sf	Good			Non-Suspect	New
1C-19	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	130 sf	Good	None Detected		46-002	CT-1
1C-19	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	130 sf	Good	None Detected		46-005	Under Carpet
1C-20	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	115 sf	Good	None Detected		46-002	CT-1
1C-20	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	115 sf	Good	None Detected		46-005	FT-3
1C-20	1	4" Ceramic Wall Tile	Misc	4"	Cream	150 sf	Good			Non-Suspect	New
1C-21	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-21	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-22	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-22	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-23	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	300 sf	Good	None Detected		46-006	CT-2
1C-23	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	300 sf	Good	None Detected		46-009	FT-5
1C-23A	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	50 sf	Good	None Detected		46-006	CT-2
1C-23A	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	50 sf	Good	None Detected		46-009	FT-5
1C-23 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	450 sf	Good	None Detected		46-010	CT-4
1C-23 Corridor	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	450 sf	Good	None Detected		46-009	FT-5
1C-24	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	300 sf	Good	None Detected		46-010	CT-4
1C-24	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	300 sf	Good	None Detected		46-005	FT-3
1C-25	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	350 sf	Good	None Detected		46-010	CT-4
1C-26	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	100 sf	Good	None Detected		46-010	CT-4
1C-26	1	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
1C-32	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	545 sf	Good	None Detected		46-008	CT-3
1C-33	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	200 sf	Good	None Detected		46-008	CT-3
1C-33	1	18" Ceramic Floortile	Misc	18"	Gray	200 sf	Good			Non-Suspect	New
1C-33	1	2" x 6" Ceramic Wall Tile	Misc	2" x 6"	Gray	250 sf	Good			Non-Suspect	New
1C-34	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	200 sf	Good	None Detected		46-008	CT-3
1C-34	1	18" Ceramic Floortile	Misc	18"	Gray	200 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-34	1	2" x 6" Ceramic Wall Tile	Misc	2" x 6"	Gray	250 sf	Good			Non-Suspect	New
1C-35	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	250 sf	Good	None Detected		46-006	CT-2
1C-35A	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
1C-35B	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	25 sf	Good	None Detected		46-006	CT-2
1C-35C	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	35 sf	Good	None Detected		46-006	CT-2
1C-35D	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	150 sf	Good	None Detected		46-006	CT-2
1C-35E	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	150 sf	Good	None Detected		46-006	CT-2
1C-35F	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
1C-35FA	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	50 sf	Good	None Detected		46-006	CT-2
1C-36	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	7,500 sf	Good	None Detected		46-006	CT-2
1C-36	1	18" Ceramic Floortile	Misc	18"	Gray	7,000 sf	Good			Non-Suspect	New
1C-38	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	115 sf	Good	None Detected		46-006	CT-2
1C-38	1	18" Ceramic Floortile	Misc	18"	Gray	115 sf	Good			Non-Suspect	New
1C-39	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	40 sf	Good	None Detected		46-006	CT-2
1C-39	1	18" Ceramic Floortile	Misc	18"	Gray	40 sf	Good			Non-Suspect	New
1C-40	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	115 sf	Good	None Detected		46-006	CT-2
1C-100	1	18" Ceramic Floortile	Misc	18"	Gray	1,200 sf	Good			Non-Suspect	New
1C-101	1	18" Ceramic Floortile	Misc	18"	Gray	125 sf	Good			Non-Suspect	New
1B-82	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-82	1	Sheet Vinyl Floor	Misc		Gray	100 sf	Good			Non-Suspect	New
1B-90	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	2,260 sf	Good	None Detected		46-002	CT-1
1B-90	1	Sheet Vinyl Floor	Misc		Gray	2,260 sf	Good			Non-Suspect	New
1B-90C	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	140 sf	Good	None Detected		46-002	CT-1
1B-90C	1	Sheet Vinyl Floor	Misc		Gray	140 sf	Good			Non-Suspect	New
1B-90D	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	25 sf	Good	None Detected		46-002	CT-1
1B-90D	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	25 sf	Good	None Detected		46-009	FT-5
1B-90E	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	140 sf	Good	None Detected		46-002	CT-1
1B-90E	1	Sheet Vinyl Floor	Misc		Gray	140 sf	Good			Non-Suspect	New
1B-90F	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
1B-90F	1	Sheet Vinyl Floor	Misc		Gray	150 sf	Good			Non-Suspect	New
1B-90 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	600 sf	Good	None Detected		46-002	CT-1
1B-90 Corridor	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	600 sf	Good	None Detected		46-009	FT-5
1B-97	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	160 sf	Good	None Detected		46-008	CT-3
1B-98	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	25 sf	Good	None Detected		46-009	FT-5
1B-98	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	25 sf	Good	None Detected		46-008	CT-3
1B-99	1	No Suspect Material									
1B-99 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	225 sf	Good	None Detected		46-006	CT-2
1B-99 Corridor	1	12" x 12" Floortile	Misc	12"	Cream Specks	225 sf	Good	None Detected		46-007	FT-4

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-100	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	300 sf	Good	None Detected		46-008	CT-3
1B-100	1	Sheet Vinyl Floor	Misc		Cream	300 sf	Good			Non-Suspect	New
1B-100A	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
1B-100A	1	Sheet Vinyl Floor	Misc		Cream	100 sf	Good			Non-Suspect	New
1B-100 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	450 sf	Good	None Detected		46-006	CT-2
1B-100 Corridor	1	Sheet Vinyl Floor	Misc		Cream	450 sf	Good			Non-Suspect	New
1B-101	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	165 sf	Good	None Detected		46-008	CT-3
1B-101	1	Sheet Vinyl Floor	Misc		Cream	165 sf	Good			Non-Suspect	New
1B-102	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	125 sf	Good	None Detected		46-006	CT-2
1B-102	1	Sheet Vinyl Floor	Misc		Cream	125 sf	Good			Non-Suspect	New
1B-103	1	Sheet Vinyl Floor	Misc		Cream	125 sf	Good			Non-Suspect	New
1B-104	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	200 sf	Good	None Detected		46-012	CT-6
1B-104	1	Sheet Vinyl Floor	Misc		Cream	200 sf	Good			Non-Suspect	New
1B-106	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	150 sf	Good	None Detected		46-012	CT-6
1B-106	1	Sheet Vinyl Floor	Misc		Cream	150 sf	Good			Non-Suspect	New
1B-107	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	150 sf	Good	None Detected		46-012	CT-6
1B-107	1	Sheet Vinyl Floor	Misc		Cream	150 sf	Good			Non-Suspect	New
1B-107A	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	50 sf	Good	None Detected		46-012	CT-6
1B-107A	1	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-107A	1	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
1B-108	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	50 sf	Good	None Detected		46-008	CT-3
1B-108	1	2" Ceramic Flooring	Misc	2"	Gray	50 f	Good			Non-Suspect	New
1B-108	1	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
1B-109	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	120 sf	Good	None Detected		46-006	CT-2
1B-109	1	12" x 12" Floortile	Misc	12"	Cream Specks	120 sf	Good	None Detected		46-007	FT-4
1B-110	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	50 sf	Good	None Detected		46-012	CT-6
1B-110	1	Sheet Vinyl Floor	Misc		Cream	50 sf	Good			Non-Suspect	New
1B-112	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	40 sf	Good	None Detected		46-006	CT-2
1B-112	1	2" Ceramic Flooring	Misc	2"	Gray	40 sf	Good			Non-Suspect	New
1B-112	1	4" Ceramic Wall Tile	Misc	4"	Cream	80 sf	Good			Non-Suspect	New
1B-114	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	150 sf	Good	None Detected		46-008	CT-3
1B-114	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	150 sf	Good	None Detected		46-005	FT-3
1B-115	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	100 sf	Good	None Detected		46-008	CT-3
1B-116	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	240 sf	Good	None Detected		46-012	CT-6
1B-116	1	4" Ceramic Wall Tile	Misc	4"	Cream	300 sf	Good			Non-Suspect	New
1B-120	1	No Suspect Material									
1B-121A	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	50 sf	Good	None Detected		46-005	FT-3
1B-121B	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	50 sf	Good	None Detected		46-005	FT-3
1B-122	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	50 sf	Good	None Detected		46-012	CT-6
1B-122	1	Sheet Vinyl Floor	Misc		Cream	50 sf	Good			Non-Suspect	New
1B-124	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	100 sf	Good	None Detected		46-012	CT-6
1B-124	1	Sheet Vinyl Floor	Misc		Cream	100 sf	Good			Non-Suspect	New
1B-125	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	120 sf	Good	None Detected		46-008	CT-3
1B-125	1	Sheet Vinyl Floor	Misc		Cream	120 sf	Good			Non-Suspect	New
1B-126	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	120 sf	Good	None Detected		46-008	CT-3
1B-126	1	Sheet Vinyl Floor	Misc		Cream	120 sf	Good			Non-Suspect	New
1B-127	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	244 sf	Good	None Detected		46-012	CT-6
1B-127	1	Sheet Vinyl Floor	Misc		Cream	244 sf	Good			Non-Suspect	New
1B-128	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	244 sf	Good	None Detected		46-012	CT-6
1B-128	1	Sheet Vinyl Floor	Misc		Cream	244 sf	Good			Non-Suspect	New
2A-01	2	No Suspect Material									
2D-12	2	No Suspect Material									
2A-04	2	Sheet Vinyl Floor	Misc		Cream	250 sf	Good			Non-Suspect	New
2A-26	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	250 sf	Good	None Detected		46-002	CT-1
2A-27	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	200 sf	Good	None Detected		46-002	CT-1
2B-03	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-03	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	60 sf	Good	None Detected		46-005	FT-3
2B-03	2	4" Ceramic Wall Tile	Misc	4"	Cream	80 sf	Good			Non-Suspect	New
2B-05	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	75 sf	Good	None Detected		46-011	CT-5
2B-05	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	75 sf	Good	None Detected		46-005	FT-3
2B-05	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2B-06	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	30 sf	Good	None Detected		46-011	CT-5
2B-06	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	30 sf	Good	None Detected		46-005	FT-3
2B-08	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5
2B-09	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	40 sf	Good	None Detected		46-011	CT-5
2B-09	2	2" Ceramic Flooring	Misc	2"	Cream	40 sf	Good			Non-Suspect	New
2B-09	2	4" Ceramic Wall Tile	Misc	4"	Cream	80 sf	Good			Non-Suspect	New
2B-10	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	1,200 sf	Good	None Detected		46-011	CT-5
2B-10	2	12" x 12" Floortile	Misc	12"	White w/Red Streaks	1,200 sf	Good	None Detected		46-013	FT-6
2B-10	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	120 sf	Good	None Detected		46-005	FT-3
2B-13	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	40 sf	Good	None Detected		46-011	CT-5
2B-13	2	2" Ceramic Flooring	Misc	2"	Gray	40 sf	Good			Non-Suspect	New
2B-13	2	4" Ceramic Wall Tile	Misc	4"	Cream	80 sf	Good			Non-Suspect	New
2B-14	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	100 sf	Good	None Detected		46-011	CT-5
2B-15	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	120 sf	Good	None Detected		46-011	CT-5

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-15 Corridor	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	420 sf	Good	None Detected		46-002	CT-1
2B-15 Corridor	2	12" x 12" Floortile	Misc	12"	Cream Specks	420 sf	Good	None Detected		46-007	FT-4
2C-05	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	200 sf	Good	None Detected		46-002	CT-1
2C-05 Corridor	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	900 sf	Good	None Detected		46-002	CT-1
2C-05 Corridor	2	12" x 12" Floortile	Misc	12"	Cream Specks	900 sf	Good	None Detected		46-007	FT-4
2C-06	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
2C-06	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	150 sf	Good	None Detected		46-005	FT-3
2C-06A	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	30 sf	Good	None Detected		46-002	CT-1
2C-06A	2	2" Ceramic Flooring	Misc	2"	Gray	30 sf	Good			Non-Suspect	New
2C-06A	2	4" Ceramic Wall Tile	Misc	4"	Cream	60 sf	Good			Non-Suspect	New
2C-07	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	250 sf	Good	None Detected		46-012	CT-6
2C-07	2	Sheet Vinyl Floor	Misc		Gray	250 sf	Good			Non-Suspect	New
2C-08	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-08	2	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
2C-08	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2C-10	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	300 sf	Good	None Detected		46-012	CT-6
2C-10	2	Sheet Vinyl Floor	Misc		Gray	300 sf	Good			Non-Suspect	New
2C-11	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	250 sf	Good	None Detected		46-012	CT-6
2C-11	2	Sheet Vinyl Floor	Misc		Gray	250 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-12	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	130 sf	Good	None Detected		46-002	CT-1
2C-12	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	130 sf	Good	None Detected		46-005	FT-3
2C-14	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	120 sf	Good	None Detected		46-008	CT-2
2C-14	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	120 sf	Good	None Detected		46-011	FT-4
2C-15	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	250 sf	Good	None Detected		46-012	CT-6
2C-15	2	Sheet Vinyl Floor	Misc		Gray	250 sf	Long Fissures			Non-Suspect	New
2C-17	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	80 sf	Good	None Detected		46-012	CT-6
2C-17	2	Sheet Vinyl Floor	Misc		Gray	80 sf	Good			Non-Suspect	New
2C-18	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
2C-18	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	120 sf	Good	None Detected		46-005	FT-3
2C-19	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	40 sf	Good	None Detected		46-012	CT-6
2C-19	2	Sheet Vinyl Floor	Misc		Gray	40 sf	Good			Non-Suspect	New
2C-19A	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	20 sf	Good	None Detected		46-012	CT-6
2C-19A	2	Sheet Vinyl Floor	Misc		Gray	20 sf	Good			Non-Suspect	New
2C-20	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
2C-21	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	75 sf	Good	None Detected		46-002	CT-1
2C-21	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	75 sf	Good	None Detected		46-005	FT-3
2C-21A	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-21A	2	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-21A	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2C-23	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	85 sf	Good	None Detected		46-002	CT-1
2C-23	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	85 sf	Good	None Detected		46-005	FT-3
2C-23A	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-23A	2	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
2C-23A	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2C-25	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	300 sf	Good	None Detected		46-005	FT-3
2C-28	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	270 sf	Good	None Detected		46-002	CT-1
2C-28	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	270 sf	Good	None Detected		46-005	FT-3
2C-29	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	290 sf	Good	None Detected		46-008	CT-1
2C-29	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	290 sf	Good	None Detected		46-011	FT-4
2C-30	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	75 sf	Good	None Detected		46-002	CT-1
2C-31	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	125 sf	Good	None Detected		46-002	CT-1
2C-32	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	125 sf	Good	None Detected		46-002	CT-1
2C-33	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
2C-33	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	120 sf	Good	None Detected		46-005	FT-3
2C-34	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
2C-34	2	2" Ceramic Flooring	Misc	2"	Gray	100 sf	Good			Non-Suspect	New
2C-34	2	4" Ceramic Wall Tile	Misc	4"	Cream	150 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-35	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	
2C-36	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
2C-36	2	2" Ceramic Flooring	Misc	2"	Gray	100 sf	Good			Non-Suspect	New
2C-36	2	4" Ceramic Wall Tile	Misc	4"	Cream	150 sf	Good			Non-Suspect	New
2C-37	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-37	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	50 sf	Good	None Detected		46-011	FT-4
2C-38	2	No Suspect Material									
2C-39	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	75 sf	Good	None Detected		46-002	CT-1
2C-39	2	2" Ceramic Flooring	Misc	2"	Gray	75 sf	Good			Non-Suspect	New
2C-39	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2C-40	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	30 sf	Good	None Detected		46-002	CT-1
2C-40	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	30 sf	Good	None Detected		46-011	FT-4
2C-40A	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	25 sf	Good	None Detected		46-002	CT-1
2C-40A	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	25 sf	Good	None Detected		46-011	FT-4
2C-41	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	100 sf	Good	None Detected		46-011	CT-5
2C-41	2	12" x 12" Floortile	Misc	12"	White w/Red Streaks	100 sf	Good	None Detected		46-013	FT-6
2C-41A	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
2C-41A	2	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
2C-41A	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-42	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-42	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	50 sf	Good	None Detected		46-011	FT-4
2C-43	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
2C-43	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	150 sf	Good	None Detected		46-011	FT-4
2C-44	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
2C-44	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	150 sf	Good	None Detected		46-011	FT-4
2C-45	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	300 sf	Good	None Detected		46-002	CT-1
2C-45	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	300 sf	Good	None Detected		46-011	FT-4
2C-46	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	100 sf	Good	None Detected		46-011	CT-5
2C-46	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
2C-47	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	225 sf	Good	None Detected		46-011	CT-5
2C-47	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	225 sf	Good	None Detected		46-011	FT-4
2C-48	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
2C-48	2	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
2C-48	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2C-49	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-49	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	50 sf	Good	None Detected		46-011	FT-4
2C-51	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	150 sf	Good	None Detected		46-012	CT-6
2C-51	2	2" Ceramic Flooring	Misc	2"	Gray	150 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-51	2	4" Ceramic Wall Tile	Misc	4"	Cream	200 sf	Good			Non-Suspect	New
2C-52	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-52	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	50 sf	Good	None Detected		46-011	FT-4
2C-55	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	700 sf	Good	None Detected		46-008	CT-1
2C-55	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	700 sf	Good	None Detected		46-011	FT-4
2C-55A	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
2C-55A	2	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
2C-55A	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2C-56	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
2C-57	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	40 sf	Good	None Detected		46-002	CT-1
2C-57	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	40 sf	Good	None Detected		46-011	FT-4
2C-58	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	180 sf	Good	None Detected		46-002	CT-1
2C-58A	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	25 sf	Good	None Detected		46-002	CT-1
2C-58A	2	2" Ceramic Flooring	Misc	2"	Gray	25 sf	Good			Non-Suspect	New
2C-58A	2	4" Ceramic Wall Tile	Misc	4"	Cream	50 sf	Good			Non-Suspect	New
2C-59	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	40 sf	Good	None Detected		46-011	CT-5
2C-59	2	2" Ceramic Flooring	Misc	2"	Gray	40 sf	Good			Non-Suspect	New
2C-59	2	4" Ceramic Wall Tile	Misc	4"	Cream	80 sf	Good			Non-Suspect	New
2C-60	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	200 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-60 Corridor	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	700 sf	Good	None Detected		46-002	CT-1
2C-60 Corridor	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	700 sf	Good	None Detected		46-011	FT-4
2C-61	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
2C-63	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
2C-63	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-011	FT-4
3A-03	3	No Suspect Material									
3A-03 Corridor	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	250 sf	Good	None Detected		46-008	CT-1
3A-03 Corridor	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	250 sf	Good	None Detected		46-009	FT-5
3C-01	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	110 sf	Good	None Detected		46-011	CT-5
3C-01 Corridor	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	300 sf	Good	None Detected		46-002	CT-1
3C-01 Corridor	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	300 sf	Good	None Detected		46-011	CT-5
3C-03	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5
3C-03	3	2" Ceramic Flooring	Misc	2"	Gray	60 sf	Good			Non-Suspect	New
3C-03	3	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
3C-04	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
3C-04A	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
3C-04B	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	120 sf	Good	None Detected		46-002	CT-1
3C-05	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	40 sf	Good	None Detected		46-011	CT-5
3C-05	3	2" Ceramic Flooring	Misc	2"	Gray	40 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-05	3	4" Ceramic Wall Tile	Misc	4"	Cream	80 sf	Good			Non-Suspect	New
3C-07	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5
3C-07	3	2" Ceramic Flooring	Misc	2"	Gray	60 sf	Good			Non-Suspect	New
3C-07	3	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
3C-09	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5
3C-09	3	2" Ceramic Flooring	Misc	2"	Gray	60 sf	Good			Non-Suspect	New
3C-09	3	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
3C-10	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	240 sf	Good	None Detected		46-010	
3C-10	3	Spray On Texture	Surface		White	400 sf	Good		Non-Friable	Assumed	To High to Sample
3C-12	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	85 sf	Good	None Detected		46-002	CT-1
3C-13	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	75 sf	Good	None Detected		46-011	CT-5
3C-13	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	75 sf	Good	None Detected		46-005	FT-3
3C-14	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	95 sf	Good	None Detected		46-002	CT-1
3C-15	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
3C-15	3	12" x 12" Floortile	Misc	12"	White w/Gold	100 sf	Good	None Detected		46-003	FT-1
3C-16	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	275 sf	Good	None Detected		46-011	CT-5
3C-16	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	275 sf	Good	None Detected		46-005	FT-3
3C-17	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	75 sf	Good	None Detected		46-002	CT-1
3C-17	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	75 sf	Good	None Detected		46-005	FT-3

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-20	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	125 sf	Good	None Detected		46-011	CT-5
3C-20	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	125 sf	Good	None Detected		46-009	FT-5
3C-21	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	120 sf	Good	None Detected		46-011	CT-5
3C-22	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	300 sf	Good	None Detected		46-011	CT-5
3C-22	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	300 sf	Good	None Detected		46-005	FT-3
3C-23	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	70 sf	Good	None Detected		46-011	CT-5
3C-23	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	70 sf	Good	None Detected		46-009	FT-5
3C-24	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	70 sf	Good	None Detected		46-011	CT-5
3C-24	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	70 sf	Good	None Detected		46-009	FT-5
3C-25	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	250 sf	Good	None Detected		46-002	CT-1
3C-25	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	250 sf	Good	None Detected		46-009	FT-5
3C-26	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	150 sf	Good	None Detected		46-011	CT-5
3C-26	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	150 sf	Good	None Detected		46-005	FT-3
3C-26A	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	40 sf	Good	None Detected		46-011	CT-5
3C-26A	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	40 sf	Good	None Detected		46-005	FT-3
3C-28	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	250 sf	Good	None Detected		46-011	CT-5
3C-28	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	250 sf	Good	None Detected		46-009	FT-5
3C-29	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	160 sf	Good	None Detected		46-011	CT-5
3C-29	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	160 sf	Good	None Detected		46-009	FT-5

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-30	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	150 sf	Good	None Detected		46-011	CT-5
3C-30	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	150 sf	Good	None Detected		46-005	FT-3
3C-32	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	110 sf	Good	None Detected		46-011	CT-5
3C-32	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	110 sf	Good	None Detected		46-005	FT-3
3C-34	3	No Suspect Material									
3C-37	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	270 sf	Good	None Detected		46-002	CT-1
3C-38	3	No Suspect Material									
3C-40	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	250 sf	Good	None Detected		46-008	CT-3
3C-40A	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	140 sf	Good	None Detected		46-008	CT-3
3C-41	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	180 sf	Good	None Detected		46-008	CT-3
3C-41 Corridor	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	450 sf	Good	None Detected		46-006	CT-2
3C-41 Corridor	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	450 sf	Good	None Detected		46-009	FT-5
3C-42	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	250 sf	Good	None Detected		46-012	CT-6
3C-42	3	Sheet Vinyl Floor	Misc		Gray	250 sf	Good			Non-Suspect	New
3C-43	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	285 sf	Good	None Detected		46-008	CT-3
3C-43	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	285 sf	Good	None Detected		46-009	FT-5
3C-44	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	130 sf	Good	None Detected		46-012	CT-6
3C-44	3	Sheet Vinyl Floor	Misc		Gray	130 sf	Good			Non-Suspect	New
3C-44 Corridor	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	900 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-44 Corridor	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	900 sf	Good	None Detected		46-009	FT-5
3C-48	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	40 sf	Good	None Detected		46-006	CT-2
3C-48	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	40 sf	Good	None Detected		46-009	FT-5
3C-50	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	1,200 sf	Good	None Detected		46-006	CT-2
3C-50	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	1,200 sf	Good	None Detected		46-009	FT-5
3C-50A	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	275 sf	Good	None Detected		46-006	CT-2
3C-50A	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	275 sf	Good	None Detected		46-009	Under Carpet
3C-51	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	275 sf	Good	None Detected		46-006	CT-2
3C-51	3	Sheet Vinyl Floor	Misc		Gray	275 sf	Good			Non-Suspect	New
3C-52	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	330 sf	Good	None Detected		46-012	CT-6
3C-52	3	Sheet Vinyl Floor	Misc		Gray	330 sf	Good			Non-Suspect	New
3C-52A	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	100 sf	Good	None Detected		46-008	CT-3
3C-52A	3	Sheet Vinyl Floor	Misc		Gray	100 sf	Good			Non-Suspect	New
3C-53	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	430 sf	Good	None Detected		46-006	CT-2
3C-53	3	Sheet Vinyl Floor	Misc		Gray	430 sf	Good			Non-Suspect	New
3C-54	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	430 sf	Good	None Detected		46-006	CT-2
3C-54	3	Sheet Vinyl Floor	Misc		Gray	430 sf	Good			Non-Suspect	New
3C-55	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	275 sf	Good	None Detected		46-006	CT-2
3C-55	3	Sheet Vinyl Floor	Misc		Gray	275 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-56	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	50 sf	Good	None Detected		46-006	CT-2
3C-56	3	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
3C-56	3	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
3C-72	3	No Suspect Material									
3D-04	3	No Suspect Material									
3D-04A	3	No Suspect Material									
4C-01	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	10 sf	Good	None Detected		46-002	CT-1
4C-01	4	Sheet Vinyl Floor	Misc		Gray	10 sf	Good			Non-Suspect	New
4C-02	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	40 sf	Good	None Detected		46-002	CT-1
4C-02	4	Sheet Vinyl Floor	Misc		Gray	40 sf	Good			Non-Suspect	New
4C-03	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
4C-03	4	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
4C-03	4	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
4C-05	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	75 sf	Good	None Detected		46-011	CT-5
4C-05	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	75 sf	Good	None Detected		46-016	FT-7
4C-06	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
4C-06	4	Sheet Vinyl Floor	Misc		Brown	50 sf	Good			Non-Suspect	New
4C-07	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	220 sf	Good	None Detected		46-011	CT-5
4C-07 Corridor	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	350 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4C-07 Corridor	4	Sheet Vinyl Floor	Misc		Multi-color Mosaic	350 sf	Good			Non-Suspect	New
4C-08	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
4C-08	4	Sheet Vinyl Floor	Misc		Brown	50 sf	Good			Non-Suspect	New
4C-10	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-10	4	Sheet Vinyl Floor	Misc		Gray	115 sf	Good			Non-Suspect	New
4C-11	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5
4C-11	4	Sheet Vinyl Floor	Misc		Gray	140 sf	Good			Non-Suspect	New
4C-12	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5
4C-12	4	Sheet Vinyl Floor	Misc		Brown	140 sf	Good			Non-Suspect	New
4C-13	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5
4C-13	4	Sheet Vinyl Floor	Misc		Brown	140 sf	Good			Non-Suspect	New
4C-14	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5
4C-14	4	Sheet Vinyl Floor	Misc		Brown	140 sf	Good			Non-Suspect	New
4C-15	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	300 sf	Good	None Detected		46-002	CT-1
4C-15 Corridor	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	300 sf	Good	None Detected		46-002	CT-1
4C-15 Corridor	4	Sheet Vinyl Floor	Misc		Multi-color Mosaic	300 sf	Good			Non-Suspect	New
4C-16	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5
4C-16	4	Sheet Vinyl Floor	Misc		Brown	140 sf	Good			Non-Suspect	New
4C-17	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4C-17	4	Sheet Vinyl Floor	Misc		Brown	140 sf	Good			Non-Suspect	New
4C-18	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-18	4	Sheet Vinyl Floor	Misc		Brown	115 sf	Good			Non-Suspect	New
4C-20	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-20	4	Sheet Vinyl Floor	Misc		Brown	115 sf	Good			Non-Suspect	New
4C-21	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-21	4	Sheet Vinyl Floor	Misc		Brown	115 sf	Good			Non-Suspect	New
4C-22	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-22	4	Sheet Vinyl Floor	Misc		Brown	115 sf	Good			Non-Suspect	New
4C-23	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	125 sf	Good	None Detected		46-011	CT-5
4C-23	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	125 sf	Good	None Detected		46-016	FT-7
4C-23A	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
4C-23A	4	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
4C-23A	4	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
4C-24	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	100 sf	Good	None Detected		46-011	CT-5
4C-24	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	100 sf	Good	None Detected		46-016	FT-7
4C-24 Corridor	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	900 sf	Good	None Detected		46-002	CT-1
4C-24 Corridor	4	Sheet Vinyl Floor	Misc		Multi-color Mosaic	900 sf	Good			Non-Suspect	New
4C-25	4	No Suspect Material									2' x 2' Metal Ceiling

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4C-26	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	120 sf	Good	None Detected		46-011	CT-5
4C-27	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	120 sf	Good	None Detected		46-016	FT-7
4C-28	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	120 sf	Good	None Detected		46-011	CT-5
4C-29	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	120 sf	Good	None Detected		46-011	CT-5
4C-30	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	350 sf	Good	None Detected		46-002	CT-1
4C-31	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5
4C-32	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5
4C-33	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5
4C-34	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	130 sf	Good	None Detected		46-011	CT-5
4C-35	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	130 sf	Good	None Detected		46-011	CT-5
4C-39	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	250 sf	Good	None Detected		46-002	CT-1
4C-40	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	480 sf	Good	None Detected		46-002	CT-1
4C-40 Corridor	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	1,030 sf	Good	None Detected		46-002	CT-1
4C-40 Corridor	4	Sheet Vinyl Floor	Misc		Multi-color Mosaic	1,030 sf	Good			Non-Suspect	New
4C-44	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	150 sf	Good	None Detected		46-011	CT-5
4C-45	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	250 sf	Good	None Detected		46-011	CT-5
4C-46	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
4C-46	4	Sheet Vinyl Floor	Misc		Brown	50 sf	Good			Non-Suspect	New
4C-47	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4C-47	4	Sheet Vinyl Floor	Misc		Brown	50 sf	Good			Non-Suspect	New
4C-48	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	240 sf	Good	None Detected		46-011	CT-5
4C-49	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	155 sf	Good	None Detected		46-011	CT-5
4C-49	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	155 sf	Good	None Detected		46-016	FT-7
4C-50	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	155 sf	Good	None Detected		46-011	CT-5
4C-50	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	155 sf	Good	None Detected		46-016	FT-7
4C-51	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	130 sf	Good	None Detected		46-011	CT-5
4C-51	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	130 sf	Good	None Detected		46-016	FT-7
4C-52	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	100 sf	Good	None Detected		46-011	CT-5
4C-52	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	100 sf	Good	None Detected		46-016	FT-7
4C-55	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-55	4	2" Ceramic Flooring	Misc	2"	Gray	115 sf	Good			Non-Suspect	New
4C-55	4	4" Ceramic Wall Tile	Misc	4"	Cream	200 sf	Good			Non-Suspect	New
4C-56	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-56	4	2" Ceramic Flooring	Misc	2"	Gray	115 sf	Good			Non-Suspect	New
4C-56	4	4" Ceramic Wall Tile	Misc	4"	Cream	200 sf	Good			Non-Suspect	New
4D-04	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	75 sf	Good	None Detected		46-011	CT-5
4D-04	4	2" Ceramic Flooring	Misc	2"	Gray	75 sf	Good			Non-Suspect	New
4D-04	4	4" Ceramic Wall Tile	Misc	4"	Cream	150 sf	Good			Non-Suspect	New

4.2 – Additional Observations

No additional observations were noted.

4.3 – Cost Estimate for Asbestos Abatement

Material	Sample Reference	Location	Low End Price Per sq/ln ft	High End Price per ln/sq ft	Total Square/Linear Feet of ACM	Low End Removal Cost	High End Removal Cost
Spray on Texture	Assumed	3C-10	\$12.00	\$19.00	400	\$4,800.00	\$7,600.00

5.0 – RECOMMENDATIONS

5.1 – Recommendations for Regulated ACM (RACM)

None observed during this inspection.

If present, these materials must be removed prior to any activity that would release asbestos fibers from this material. Specifically, any renovation or demolition activity that will crush, abrade, or dissolve the matrix of this material must be performed by a North Dakota licensed Asbestos Contractor. If these materials are in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

5.2 – Recommendations for Category I Non-Friable ACM (C1NF)

None observed during this inspection.

If present, these materials identified as Category I Non-Friable ACM are required to be removed by a North Dakota licensed asbestos contractor if proposed renovations or demolition will impact these materials in such a manner as to render them friable and thus RACM. Specifically, any renovation or demolition activity that will crush, abrade, or dissolve the matrix of these materials then they must first be removed by a North Dakota-licensed Asbestos Contractor. If these materials are in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

5.3 – Recommendations for Category II Non-Friable ACM (C2NF)

Spray-on Texture:

If present, these materials identified as Category II Non-friable ACM must be removed prior to any renovation or demolition activity that will crush, abrade, or dissolve the matrix of this material. The removal of this material must be performed by a North Dakota licensed Asbestos Contractor. If this material is in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

5.4 – General Recommendations


Based on the asbestos survey and sampling results, TRINE has the following recommendations:

- Each type of asbestos that will need to be removed as part of any renovation or demolition project in North Dakota are required to be removed, handled, and disposed of as ACM waste by a licensed North Dakota asbestos abatement contractor regardless if the material is a RACM, C1NF, or C2NF in accordance with the North Dakota Department of Environmental Quality (DEQ).
- The VA employ an independent industrial hygienist (VPIH/CPIH) consultant and/or use its own IH to perform various services of the VA. The VPIH/CPIH will perform the necessary monitoring, inspection, testing, and other support services to ensure that VA patients, employees, and visitors will not be adversely affected by the abatement work in accordance with ***Veterans Administration (VA), Section 02 82 11, Traditional Asbestos Abatement***
- TRINE recommends final air testing in addition to final visual inspection of abatement areas prior to deregulation of contained work areas.
- Suspect materials discovered after this inspection should be sampled and analyzed to determine asbestos content and to initiate appropriate responses.


North Dakota DEQ and the US Environmental Protection Agency require notification of intent to renovate or demolish when asbestos is present. Notification must be sent at least 10 working days prior to the start of any construction activities. The general contractor should also keep a copy of this survey at the construction site during the entire construction project as proof of compliance with 40 CFR 61 (NESHAP).

Submitted by:

6.0 – SIGNATURE PAGE



John R Rogers
President
Asbestos Building Inspector (NY) 16-11678



Dan Johnson
Asbestos Building Inspector (ND) 6804

APPENDIX A – LABORATORY CERTIFICATE OF ANALYSIS

NOTE: Results for the above referenced samples are located on the following pages.

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46



EMSL Analytical, Inc.
 3410 Winnetka Avenue North New Hope, MN 55427
 Tel/Fax: (763) 449-4922 / (763) 449-4924
<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203414
Customer ID: TREV42
Customer PO:
Project ID:

Attention: John Rogers
 Trine Environmental
 6678 Morningdale Drive
 Brighton, MI 48116
Phone: (810) 986-0536
Fax:
Received Date: 04/14/2022 1:30 PM
Analysis Date: 04/21/2022 - 04/22/2022
Collected Date:
Project: Fargo VA Inspection

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
46-001 352203414-0001	Black Wall Mastic - BA-01	Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-002 352203414-0002	2'x2' Ceiling Tile (Long Fissures) - BB-80	Gray/White Fibrous Heterogeneous	60% Cellulose 20% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
46-003-Floor Tile 352203414-0003	12"x12" Floor tile (White w/Gold) - BB-80	Gray/White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-003-Mastic 352203414-0003A	12"x12" Floor tile (White w/Gold) - BB-80	Tan/Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-004-Floor Tile 352203414-0004	12"x12" Floor tile (White w/Gray Streaks) - BB-75	Gray/White Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-004-Mastic 352203414-0004A	12"x12" Floor tile (White w/Gray Streaks) - BB-75	Tan/Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-005-Floor Tile 352203414-0005	12"x12" Floor tile (cream/Tan/Brown) - Corridor outside stairwell #15	Gray/White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-005-Mastic 352203414-0005A	12"x12" Floor tile (cream/Tan/Brown) - Corridor outside stairwell #15	Tan/Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-006 352203414-0006	2'x2' Ceiling Tile (Random Fissure) - Corridor outside BB-70	Gray/White Fibrous Heterogeneous	50% Cellulose 30% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
46-007-Floor Tile 352203414-0007	12"x12" Floor tile (cream specks) - Corridor Outside BC-41	Gray/White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-007-Mastic 352203414-0007A	12"x12" Floor tile (cream specks) - Corridor Outside BC-41	Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Initial report from: 04/22/2022 17:07:25



ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46



EMSL Analytical, Inc.
 3410 Winnetka Avenue North New Hope, MN 55427
 Tel/Fax: (763) 449-4922 / (763) 449-4924
<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203414
 Customer ID: TREV42
 Customer PO:
 Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
46-008 352203414-0008	12"x12" Ceiling Tile (Random Fissure) - BB-06	Gray/White Fibrous Heterogeneous	40% Cellulose 40% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-009-Floor Tile 352203414-0009	12"x12" Floor tile (white w/Black specks) - Corridor Outside 1C-17	Gray/White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-009-Mastic 352203414-0008A	12"x12" Floor tile (white w/Black specks) - Corridor Outside 1C-17	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-010 352203414-0010	2"x2' Ceiling Tile (Random Fissure(Drop in)) - Corridor by 1C-11	Gray/White Fibrous Heterogeneous	60% Cellulose 20% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-011 352203414-0011	2"x4' Ceiling Tile (widthwise Fissure) - 1C-05	Gray/White Fibrous Heterogeneous	60% Cellulose 20% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-012 352203414-0012	2"x2' Ceiling Tile (Vinyl Covered Sheetrock Look) - 1B-128B	Gray/White Fibrous Heterogeneous	40% Cellulose 40% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-013-Floor Tile 352203414-0013	12"x12" Floor tile (White w/Red Streaks) - 2B-10	Gray/White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-013-Mastic 352203414-0013A	12"x12" Floor tile (White w/Red Streaks) - 2B-10	Tan/Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-014 352203414-0014	2"x2' Ceiling Tile (Rough Texture) - 3C-10	Brown/White Fibrous Heterogeneous	30% Cellulose 50% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-015A 352203414-0015	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-015B 352203414-0016	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-015C 352203414-0017	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-015D 352203414-0018	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-fibrous (Other)	None Detected
HA, Bldg 46					
46-015E 352203414-0019	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-fibrous (Other)	None Detected

Initial report from: 04/22/2022 17:07:25



ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46



EMSL Analytical, Inc.
 3410 Winnetka Avenue North, New Hope, MN 55427
 Tel/Fax: (763) 449-4922 / (763) 449-4924
<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203414
 Customer ID: TREV42
 Customer PO:
 Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
46-015F 352203414-0020	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-fibrous (Other)	None Detected
46-015G 352203414-0021	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-fibrous (Other)	None Detected
46-016 352203414-0022	12"x12" Vinyl Floor tile (Brown/Green/Red/Black Specks (Stick Down)) - 4C-05	Brown/Black/Green Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-017 352203414-0023	Sheetrock/Tape/compound (white) - BC-20 <i>This is a composite result of sheetrock, fl. compound, and tape</i>	Brown/White Fibrous Heterogeneous	10% Cellulose 2% Glass	88% Non-fibrous (Other)	None Detected
03-001 352203414-0024	2"x2" Ceiling Tile (Long Fissure)	Gray/White Fibrous Heterogeneous	50% Cellulose 30% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
03-002-Floor Tile 352203414-0025	12"x12" Floor tile (cream)	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
03-002-Mastic 352203414-0025A	12"x12" Floor tile (cream)	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
03-003-Light Gray Layer 352203414-0026	Exterior Window Caulking (Gray)	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
03-003-Dark Gray Layer 352203414-0026A	Exterior Window Caulking (Gray)	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
03-004 352203414-0027	Sheetrock/Tape/Compound (white) <i>This is a composite result of sheetrock, fl. compound, and tape</i>	Brown/White Fibrous Heterogeneous	10% Cellulose 2% Glass	88% Non-fibrous (Other)	None Detected
03-005A 352203414-0028	Spray-on Fireproofing (white Fluffy)	White Fibrous Homogeneous	90% Cellulose	10% Non-fibrous (Other)	None Detected
03-005B 352203414-0029	Spray-on Fireproofing (white Fluffy)	White Fibrous Homogeneous	90% Cellulose	10% Non-fibrous (Other)	None Detected
03-005C 352203414-0030	Spray-on Fireproofing (white Fluffy)	White Fibrous Homogeneous	90% Cellulose	10% Non-fibrous (Other)	None Detected

Initial report from: 04/22/2022 17:07:25



APPENDIX B – ASBESTOS INSPECTOR CERTIFICATION

Certificate No: 5LM02152202IR Expiration Date: February 15, 2023

This is to certify that
Daniel J. Johnson
has attended and successfully completed an
**ASBESTOS INSPECTOR
REFRESHER TRAINING COURSE**
permitted by
the State of Minnesota under Minnesota Rules 4620.3702 to 4620.3722
and meets the requirements of
Section 206 of Title II of the Toxic Substances Control Act (TSCA)
conducted by
Lake States Environmental, Ltd.
in
White Bear Lake, MN on February 15, 2022
Examination Date: February 15, 2022

Lake States Environmental, Ltd.
P. O. Box 645, Rice Lake, WI 54868
(800) 254-9811

57

North Dakota Department of
Environmental Quality

Certificate of No. 5984
Asbestos Abatement

This is to certify that Daniel James Johnson has met the requirements of Chapter 33.1-15-13 of the North Dakota Air Pollution Control Rules for certification in the following asbestos abatement discipline(s):

Supervisor	
Worker	
Inspector	Exp: 2/15/2023 <u>Jane Kruger</u>
Management Planner	
Project Designer	
Project Monitor	

Asbestos Control Program

