

ASBESTOS SURVEY – 2022

Fargo VA Medical Center – Building 1

**2101 Elm Street North
Fargo, ND 58102**



PREPARED FOR:

**Ron Tollefson (VA COR)
2101 Elm Street North
Fargo, ND 58102**

PREPARED BY:

**TRINE Environmental, Inc. (SDVOSB)
6678 Morningdale Dr.
Brighton, MI**

**Dan Johnson
Asbestos Inspector (ND 6804)**

**John R Rogers
President**



Table of Contents

1.0 – INTRODUCTION	3
2.0 – SITE HISTORY & DESCRIPTION	3
3.0 – METHODS & LIMITATIONS.....	3
3.1 – Asbestos Survey Methods.....	3
3.2 – Laboratory Analytical Methods	5
3.3 – Limitations	5
4.0 – SURVEY RESULTS	6
4.1 – Asbestos Analysis Results	6
Table 1 – Analytical Results	8
Table 2 – Room by Room	11
4.2 – Additional Observations	79
4.3 – Cost Estimate for Asbestos Abatement.....	79
5.0 – RECOMMENDATIONS	79
5.1 – Recommendations for Regulated ACM (RACM)	79
5.2 – Recommendations for Category I Non-Friable ACM (C1NF).....	80
5.3 – Recommendations for Category II Non-Friable ACM (C2NF)	80
5.4 – General Recommendations.....	80
6.0 – SIGNATURE PAGE.....	81
APPENDIX A – LABORATORY CERTIFICATE OF ANALYSIS	81
APPENDIX B – ASBESTOS INSPECTOR CERTIFICATION	92

1.0 – INTRODUCTION

An asbestos survey was conducted at the Veterans Administration Medical Center (VAMC) Fargo Health Care System (HCS), 2101 Elm Street North Fargo, ND 58102. The survey was conducted between February 28th and March 31st, 2022, by Dan Johnson of TRINE Environmental, Inc., an EPA-certified building inspector in the state of North Dakota.

The purpose of this asbestos survey was to identify the presence, and extent of asbestos containing materials (ACM) in seventeen (17) buildings, incorporate previously performed asbestos survey, and create a new database in support of future plans to renovate which may require demolition activities. Each building was considered a separate homogenous area (HA).

The inspection was performed by a certified EPA asbestos building inspector, experienced in identifying and sampling suspect ACM. All areas of Building 1 were accessed and inspected.

Suspect materials were sampled to determine asbestos content.

All samples collected were analyzed at EMSL Analytical, Inc., (EMSL) an AIHA and NVLAP accredited asbestos laboratory, using either Polarized Light Microscopy (PLM) methods or Transmission Electron Microscopy (TEM) methods. A total of fifty-eight (58) samples were collected and analyzed.

Laboratory Certificates of Analysis are located in Appendix A of this report. Company and individual licenses and certifications are located in Appendix B.

2.0 – SITE HISTORY & DESCRIPTION

The Fargo VA HCS campus is made up of 17 buildings that first started construction in 1929 with major expansions in 1945 and 1983 but have also been under constant renovations of various magnitudes over the last 92 years. Currently the campus has approximately 576,000 interior gross square feet (GSF).

3.0 – METHODS & LIMITATIONS

3.1 – Asbestos Survey Methods

The site was inspected for suspect ACM, unless otherwise noted. Each observed suspect material was assigned a material identification within the homogenous area (HA), such as ceiling tile (CT), floor tile (FT), Thermal System Insulation (TSI) or miscellaneous (MISC), described, and measured. Each observed suspect material was sampled except for those that were confirmed positive from previous sampling events or determined to non-suspect material. Samples of suspect ACM were collected using procedures established by the United States Environmental Protection Agency (USEPA) Code of Federal Regulations (CFR) Title 40 Part 763 Subpart E, Asbestos Containing Materials in Schools.

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 1

Upon completing an initial walkthrough, the asbestos inspector began a thorough inspection identifying probable ACM and categorizing by material identification. Each material identification represented a group of material having similar characteristics such as appearance, color and manner in which it was used.

ACM's were divided into three categories:

1. **Surfacing Materials:** material that is sprayed-on, troweled on, or otherwise applied to surfaces, such as acoustical plaster on ceilings and fireproofing materials on structural members, or other materials on surfaces for acoustical, fireproofing or other purposes
2. **Thermal System Insulation (TSI):** material applied to pipes, fittings, boilers, breeching, tanks, ducts, or other structural components to prevent heat loss or gain, or water condensation, or for other purposes
3. **Miscellaneous ACM:** interior building material on structural components, structural members or fixtures, such as floor and ceiling tiles, and does not include surfacing material or thermal insulation

ACM's inventoried in this survey are classified as either friable or non-friable. Friable ACM can be crumbled or reduced to powder by hand pressure whereas non-friable ACM cannot.

The EPA asbestos NESHAP regulation further classifies non-friable ACM into two categories:

1. **Category I:** Non-friable ACM includes any asbestos-containing packing, gasket, resilient floor covering or asphalt roofing product
2. **Category II:** Non-friable ACM includes any non-friable ACM other than Category I non-friable ACM

Samples were collected in airtight sealed bags for transportation to EMSL for analysis. Standard Operating Procedures dictated samples were collected in manner consistent with health and safety protocols, using personal hygiene methods, using wet methods as required, and donning proper Personal Protective Equipment (PPE). These methods were used to prevent asbestos airborne contamination from being introduced to the hospital's atmosphere and to minimize employee, staff, and patient exposure.

Lab data pertaining to the samples analyzed is located in Appendix A of this report and each sample is listed as follows:

- Date Analyzed
- Field Sample #
- Lab Sample #
- Sample Location
- Asbestos Content
- Non-Asbestos Content

Samples were analyzed using PLM methods and Point Count Methods for any sample returning a $\leq 5\%$ (less than or equal to) result, excluding non-detects.

3.2 – Laboratory Analytical Methods

All samples collected during the survey were analyzed at EMSL, an A.I.H.A. and NVLAP certified laboratory. Upon arrival at the laboratory, the samples were logged-in and submitted for analysis.

PLM samples were analyzed utilizing the Environmental Protection Agency's test method: Methods for the determination of Asbestos in Bulk Building Materials (EPA 600/R-93/116, July 1993) and the McCrone Research Institute's The Asbestos Particle Atlas as the principal analytical references. Additional treatment and tests may be required to accurately define composition (i.e. ashing, extraction, acetone treatment, and TEM).

The PLM method utilizes a light microscope equipped with polarizing filters. The identification of asbestos fiber bundles is determined by the visual properties displayed when the sample is treated with various dispersion staining liquids. Identification is substantiated by the actual structure of the fiber and the effect of polarized light on the fiber, all of which is viewed by a trained technician. The limit of detection of asbestos by PLM is about one percent (1%) by area. Samples containing lower levels of asbestos are not reliably detectable by this technique.

Analysis was performed by using the bulk sample for visual observation and slide preparation(s) for microscopic examination and identification. The samples were analyzed for asbestos (chrysotile, amosite, crocidolite, anthophyllite, and actinolite/tremolite), fibrous non-asbestos constituents (cellulose, synthetic, etc.) and non-fibrous constituents. Using a stereoscope, the microscopist visually estimated relative amounts of each constituent by determining the volume of each constituent in proportion to the total volume of the sample.

The asbestos National Emission Standards for Hazardous Air Pollutants (NESHAP) recommends that asbestos bulk samples that are less than 10% by PLM are to be analyzed by point counting for friable ACM and mandates point counting when PLM results for friable ACM are in trace amounts (< 1%) in order to declare that the material is non-asbestos containing. The point-count procedure mandated by NESHAP is in the EPA "Interim" Bulk Method. For each layer to be point counted, eight mounts are made by dispersing 8 pinches of sample in suitable fluid. Each of the mounts is examined under the polarizing light microscope using an eyepiece reticule that superimposes a grid of points over the field of view. Fifty non-empty points are examined for each mount, yielding 400 points – some of which would be identified as asbestos and the rest as non-asbestos material.

Transmission Electron Microscopy (TEM) analysis is used to quantify and identify asbestos structures using electron diffraction and energy dispersive X-ray (EDX) analysis. Identification of chrysotile or amphibole crystalline structures can be consistently determined via the electron-diffraction capabilities of modern TEMs. The five amphibole types can be differentiated based on their elemental composition when EDX analysis is combined with their electron diffraction patterns.

3.3 – Limitations

This asbestos survey report has been prepared by TRINE in a manner consistent with that level of care and skill ordinarily exercised by members of the profession currently practicing under similar conditions. No other warranty expressed or implied is made. The intent of this survey report is to assist the building owner or management in locating ACM. This document is not intended to be utilized as a proposal or a project design document for the remediation of asbestos materials discovered during this investigation.

The survey was conducted to identify suspect ACM on the interior areas of Building 1. Some ACM may not have been discovered due to inaccessibility. Any suspect materials discovered subsequent to the issue of this survey report should be sampled and analyzed to determine asbestos content and to initiate appropriate responses.

TRINE's interpretations and recommendations are based upon the results of sample collection and analyses in compliance with environmental regulations, quality control and assurance standards, and the scope of work. The results, conclusions, and recommendations contained in this report pertain to conditions observed at the time of the survey.

The field observations, measurements, and research reported herein are considered sufficient in detail and scope to form a reasonable basis for an Asbestos Survey Report. The assessment, conclusions, and recommendations presented herein are based upon the sample analysis results of collected materials within the Homogenous Area. They may not represent all conditions at the subject site as they reflect the information gathered from specific locations. TRINE Environmental, Inc. warrants the findings and conclusions contained herein have been promulgated in accordance with generally accepted industrial hygiene methodology and only for the site described in this report.

Reliance on or use by any such third-party without explicit authorization in the report does not make said third-party a third-party beneficiary to TRINE's contract with the VA. Any such unauthorized reliance on or use of this report, including any of its information or conclusions, will be at third-party's risk. For the same reasons, no warranties or representations, expressed or implied in this report, are made to any such third party.

This report has been developed to provide the client with information regarding apparent conditions relating to the subject property. Although TRINE believes that the findings and conclusions provided in this report are reasonable, the report is necessarily limited to the conditions observed and to the information available at the time of the work. Due to the nature of the work, there is a possibility conditions exist that could not be identified within the scope of the inspection, or which were not apparent at the time of our site work. The report is also limited to information available from the client at the time it was conducted. It is also possible that the testing methods employed at the time of the report may later be superseded by other methods. TRINE does not accept responsibility for changes in the state of the art.

4.0 – SURVEY RESULTS

4.1 – Asbestos Analysis Results

A total of fifty-eight (58) samples were collected and analyzed by PLM. The original laboratory report and certificate of analysis are located in Appendix A.

The following tables summarize the samples collected and quantity of materials that contain asbestos in amounts >1% (greater than). Table 1 provides the analytical results of the samples submitted to the laboratory. Table 2 provides a room-by-room breakdown of the materials identified and sample number associated with the analytical results.

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 1

TABLE LEGEND

NAD: No Asbestos Detected

ACM Material with type and percent detected

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 1

Table 1 – Analytical Results

Sample Numbers	Sample Location	Material Description	Exterior Description	Quantity	AHERA Material Category	Condition	Potential for Future Damage	Asbestos Content	Notes
01-001	Bldg 1 Hallway Outside Canteen	Sheetrock/Tape/Compound	White	1	Surfacing Material	Good	Little/No	None Detected	
01-002	Bldg 1 Hallway Outside Canteen	2' x 2' Ceiling Tile	Random Fissures/ Pinholes (Drop in)	1	Miscellaneous	Good	Little/No	None Detected	CT-1
01-003	Bldg 1 Hallway Outside Canteen	Vinyl Plank Flooring	Dark Wook Look	1	Miscellaneous	Good	Little/No	None Detected	
01-004	Bldg 1 BC-77 Elevator Mech	Wall Mastic	Black	1	Surfacing Material	Good	Little/No	8% Chryotile	
01-005A-C	Bldg 1 BC-77/BC-79/BC-85B	Spray on Fireproofing	Lt. Green	3	Surfacing Material	Good	Little/No	None Detected	
01-006	Bldg 1 East Entry by Stairwell #7	12" x 12" Floortile and Mastic	White w/Black Specks	1	Miscellaneous	Good	Little/No	None Detected	FT-1
01-007	Bldg 1 BC-80 Retail Store	Vinyl Plank Flooring	Lt. Brown Wood Look	1	Miscellaneous	Good	Little/No	None Detected	
01-008	Bldg 1 Corridor Outside BC-82	2' x 4' Ceiling Tile	Random Fissures/ Pinholes	1	Miscellaneous	Good	Little/No	None Detected	CT-2
01-009	Bldg 1 BC-83	2' x 4' Ceiling Tile	Widthwise Fissures w/Pinholes	1	Miscellaneous	Good	Little/No	None Detected	CT-3
01-010	Bldg 1 BC-69 Vending	2' x 2' Ceiling Tile	Long Fissures w/Pinholes	1	Miscellaneous	Good	Little/No	None Detected	CT-4
01-011	Bldg 1 BC-69 Vending	1" x 1" Ceramic Floortile	Tan/Gray	1	Miscellaneous	Good	Little/No	None Detected	
01-012	BC-91	2' x 2' Ceiling Tile	Random Fissures/ Pinholes	1	Miscellaneous	Good	Little/No	None Detected	CT-5
01-013	Bldg 1 BC-94	12" x 12" Floortile and Mastic	Cream w/White Specks	1	Miscellaneous	Good	Little/No	None Detected	FT-2
01-014	Bldg 1 Main North/South Corridor	12" x 12" Floortile and Mastic	Gray w/Brown Streaks	1	Miscellaneous	Good	Little/No	4% Chrysotile FT	FT-3
01-015A-C	Bldg 1 BE-05 Mech	Spray on Fireproofing	White/Fluffy	1	Surfacing Material	Good	Little/No	None Detected	
01-016	Corridor Outside indepenence Elevators	12" x 12" Floortile and Mastic	Cream w/White and Gray specks	1	Miscellaneous	Good	Little/No	None Detected	FT-4
01-017	BE-30	Duct Seam Sealant	Black	1	Surfacing Material	Good	Little/No	None Detected	Throughout Building 1
01-018	Corridor Outside BE-31	12" x 12" Floortile and Mastic	Cream w/Brown and White Streaks	1	Miscellaneous	Good	Little/No	None Detected	FT-5

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Sample Numbers	Sample Location	Material Description	Exterior Description	Quantity	AHERA Material Category	Condition	Potential for Future Damage	Asbestos Content	Notes
01-019	BE-44	12" x 12" Floortile and Mastic	Gray w/Brown and White Streaks	1	Miscellaneous	Good	Little/No	6% Chrysotile Mastic	FT-6
01-020A-C	BE-25	Spray on Fireproofing	Gray/Firm	3	Surfacing Material	Good	Little/No	None Detected	
01-021	Corridor Outside BE-25	12" x 12" Floortile and Mastic	White w/Gray Streaks	1	Miscellaneous	Good	Little/No	None Detected	FT-15
01-022	HAC BC-85A	4" Ceramic Wall Tile	Tan	1	Miscellaneous	Good	Little/No	None Detected	
01-023	HAC BC-85A	1" Ceramic Floor Tile	Tan	1	Miscellaneous	Good	Little/No	None Detected	
01-024	BC-74A Canteen Kitchen	2' x 2' Ceiling Tile	Vinyl covered Sheetrock Look	1	Miscellaneous	Good	Little/No	None Detected	CT-6
01-025	BC-74A Canteen Kitchen	6" Ceramic Floor Tile	Brown	1	Miscellaneous	Good	Little/No	None Detected	
01-026	BC-74A Canteen Kitchen	4" Ceramic Wall Tile	Cream	1	Miscellaneous	Good	Little/No	None Detected	
01-027	BD-10 Men's Restroom	2' x 4' Ceiling Tile	Deep Lengthwise Fissures	1	Miscellaneous	Good	Little/No	None Detected	CT-7
01-028	Hallway Outside BC-64	1' x 1' Ceiling Tile/Pucks	Large and Small Pinholes	1	Miscellaneous	Good	Little/No	<1% Amosite/5% Chrysotile (Pucks)	
01-029	Corridor Outside BD-60	2' x 2' Ceiling Tile	Small Random Fissures w/Pinholes	1	Miscellaneous	Good	Little/No	None Detected	CT-8
01-030	Entry by Paint Shop	12" x 12" Floortile and Mastic	Tan w/Brown/Gray/White Specks	1	Miscellaneous	Good	Little/No	None Detected	FT-7
01-031	1C-70	Sheet Vinyl Floor	White	1	Miscellaneous	Good	Little/No	None Detected	
01-032	1C-31	12" x 12" Floortile and Mastic	White w/Gray/Dark Gray Streaks	1	Miscellaneous	Good	Little/No	None Detected	FT-8
01-033	1D-01	12" x 12" Floortile and Mastic	Gray w/White and Brown Streaks	1	Miscellaneous	Good	Little/No	4% Chrysotile FT/10% Chrysotile Mastic	FT-9
01-034	1C-112	12" x 12" Floortile and Mastic	Cream Textured	1	Miscellaneous	Good	Little/No	None Detected	FT-10
01-035	1C-108	Sheet Vinyl Floor	Cream w/Blue and Pink	1	Miscellaneous	Good	Little/No	None Detected	
01-036	1E-39	Sheet Vinyl Floor	Brown/Gray Mosaic	1	Miscellaneous	Good	Little/No	None Detected	
01-037	1E-25	Sheet Vinyl Floor	Wood Look	1	Miscellaneous	Good	Little/No	None Detected	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Sample Numbers	Sample Location	Material Description	Exterior Description	Quantity	AHERA Material Category	Condition	Potential for Future Damage	Asbestos Content	Notes
01-038	1D-20	12" x 12" Floortile and Mastic	White w/Dark Gray Streaks	1	Miscellaneous	Good	Little/No	None Detected	FT-11
01-039	1D-128 Corridor	Sheet Vinyl Floor	Gray/Rust/ White Mosaic	1	Miscellaneous	Good	Little/No	None Detected	
01-040	1D-44 HAC	Sheet Vinyl Floor	Lt. Gray w/ Dk Gray and White	1	Miscellaneous	Good	Little/No	None Detected	
01-041	1D-116	2' x 4' Ceiling Tile	Small Random Fissures w/Pinholes	1	Miscellaneous	Good	Little/No	None Detected	CT-9
01-042	2C-77	12" x 12" Floortile and Mastic	White w/Gray and Black Streaks	1	Miscellaneous	Good	Little/No	None Detected	FT-12
01-043	1D-40	2' x 2' Ceiling Tile	Random Fissures/Pinholes (Drop in)	1	Miscellaneous	Good	Little/No	None Detected	CT-10
01-044	2E-25	Sheet Vinyl Floor	Brown/Gray Mosaic	1	Miscellaneous	Good	Little/No	None Detected	
01-045	2E-41	12" x 12" Floortile and Mastic	Cream w/Gold	1	Miscellaneous	Good	Little/No	5% Chrysotile FT/10% Chrysotile Mastic	FT-13
01-046	2E-41	1' x 1' Ceiling Tile	White (Spline)	1	Miscellaneous	Good	Little/No	None Detected	CT-11
01-047	2E-44	2' x 4' Ceiling Tile	Deep Random Fissure	1	Miscellaneous	Good	Little/No	None Detected	CT-12
01-048	2D-18	Sheet Vinyl Floor	Cream/Tan/ Brown	1	Miscellaneous	Good	Little/No	None Detected	
01-049A-C	3E-45	Spray on Fireproofing	Gray	3	Surfacing Material	Good	Little/No	None Detected	
01-050	Stairwell #3	12" x 12" Floortile and Mastic	Tan/Brown/ White	1	Miscellaneous	Good	Little/No	8% Chrysotile Mastic	FT-14
01-051A-C	4th Floor Corridor Outside Elevator #4	Spray on Texture	White	3	Surfacing Material	Good	Little/No	None Detected	
01-052A-G	Throughout	Spray on Fireproofing	White/Gray	7	Surfacing Material	Good	Little/No	None Detected	
01-053	BB-01	9" x 9" Floor Tile and Mastic	White w/Red and Black	1	Miscellaneous	Good	Little/No	5% Chrysotile (FT)	
01-054	BE-45 North Loading Dock	Building Seam Caulk	Gray	1	Surfacing Material	Good	Little/No	3% Chrysotile	
01-055	BE-44	Sheetrock/Tape/ Compound	White	1	Surfacing Material	Good	Little/No	None Detected	
01-056A-G	BE-38 Corridor (Throughout)	Hard Plaster Wall	White/Gray	7	Miscellaneous	Good	Little/No	None Detected	
01-057A-G	BE-38/BE-11 Corridors (Throughout)	Hard Plaster Ceiling	White/Gray	7	Miscellaneous	Good	Little/No	None Detected	
01-058	BE-46	Fire Stop	Red		Miscellaneous	Good	Little/No	None Detected	

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 1

Table 2 – Room by Room

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
Sub-Basement	SB	Thermal System Insulation			Gray	40 LF	POOR	Assumed	Friable	Assumed	NE Corner of Room
Sub-Basement	SB	Styrofoam Panel Adhesive			Gold	140 sf	Good	Assumed	Friable	Assumed	Above Wood Bridge
BC-75	B	Vinyl Plank Flooring			Dark Wood Look	1,670 sf	Good	None Detected		01-003	
BC-75	B	2' x 2' Ceiling Tile	CT-1	2'x2'	Random Fissures w/Pinholes (Drop-in)	1,670 sf	Good	None Detected		01-002	
BC-74A	B	6" Ceramic Floor Tile		6"	Brown	1200 sf	Good	None Detected		01-025	
BC-74A	B	4" Ceramic Wall Tile		4"	Beige	2000 sf	Good	None Detected		01-026	
BC-74A	B	2" x 2" Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	1200 sf	Good	None Detected		01-024	CT-6
BC-74B	B	No Suspect Materials Found									
BC-74	B	2' x 2' Ceiling Tile	CT-1	2'x2'	Random Fissures w/Pinholes (Drop-in)	590 sf	Good	None Detected		01-002	
BC-74	B	12" Ceramic Floor Tile		12"	Tan/Green	590 sf	Good			Non-Suspect	New
BC-74 Corridor	B	Vinyl Plank Flooring			Dark Wood Look	525 sf	Good	None Detected		01-003	
BC-74 Corridor	B	2' x 2' Ceiling Tile		2'x2'	Random Fissures w/Pinholes (Drop-in)	525 sf	Good	None Detected		01-002	
BC-69	B	Thermal System Insulation			White	2 lf	POOR	Assumed	Friable	Assumed	Debris in chase behind access panel
BC-69	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	315 sf	Good	None Detected		01-0010	
BC-69	B	Vinyl Plank Flooring			Dark Wood Look	315 sf	Good	None Detected		01-003	Over 1" Ceramic Tile
BC-69	B	1" Ceramic Tile Flooring		1"	Tan/Gray	315 sf	Good	None Detected		01-011	Under Vinyl Plank Floor

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BC-77 Elev Mech	B	Wall Mastic			Black	100sf	Good	8% Chrysotile	Non-Friable	01-004	
BC-77	B	Spray-on Fireproofing			Light Green		Good	None Detected		01-005A	Throughout
BC-79	B	Spray-on Fireproofing			Light Green		Good	None Detected		01-005B	Throughout
East Entry by Mech. BC-79	B	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	90 sf	Good	None Detected		01-006	FT-1
BC-80	B	Vinyl Plank Flooring			Lt. Brown Wood Look	1,285 sf	Good	None Detected		01-007	
BC-80	B	2' x 2' Ceiling Tile	CT-1	2'x2'	Random Fissures w/Pinholes (Drop-in)	1,285 sf	Good	None Detected		01-002	CT-1
BC-81	B	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	390 sf	Good	None Detected		01-006	FT-1
BC-83	B	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	200 sf	Good	None Detected		01-006	FT-1
BC-83	B	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwsw Fissures w/Pinholes	200 sf	Good	None Detected		01-009	CT-3
BC-82	B	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	135 sf	Good	None Detected		01-006	FT-1 (Under Carpet)
BC-82	B	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	135 sf	Good	None Detected		01-008	CT-2
BC-82 Corridor	B	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	85 sf	Good	None Detected		01-006	FT-1
BC-82 Corridor	B	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	85 sf	Good	None Detected		01-008	CT-2
BC-85A	B	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	85 sf	Good	None Detected		01-008	CT-2
BC-85A	B	1" Ceramic Tile Flooring		1"	Tan	80 sf	Good	None Detected		01-023	
BC-85A	B	4" Ceramic Wall Tile		4"	Tan	80 sf	Good	None Detected		01-022	
BC-85B	B	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	410 sf	Good	None Detected		01-006	FT-1
BC-85B	B	Spray-on Fireproofing			Light Green	410 sf	Good	None Detected		01-005C	Throughout

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BC-85B Corridor	B	12" X 12" Floortile and Mastic	FT-2	12"x12"	White w/Black Specks	180 sf	Good	None Detected		01-006	FT-1
BC-85B Corridor	B	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	180 sf	Good	None Detected		01-008	CT-2
BC-70	B	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	155 sf	Good	None Detected		01-008	CT-2
BC-70	B	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	155 sf	Good	None Detected		01-006	FT-1
BC-68	B	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	120 sf	Good	None Detected		01-008	CT-2
BC-68	B	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	120.sf	Good	None Detected		01-006	FT-1
BC-64	B	2" x 2" Ceiling Tile	CT-4		Long Fissures w/Pinholes	250 sf	Good	None Detected		01-010	CT-4
BC-64	B	12" X 12" Floortile and Mastic	FT-2	12"x12"	Cream w/White Specks	250 sf	Good				FT-2
BC-64 Corridor	B	2" x 2" Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	195 sf	Good	None Detected		01-010	CT-4
BC-64 Corridor	B	12" X 12" Floortile and Mastic	FT-2	12"x12"	Cream w/White Specks	195 sf	Good	None Detected		01-013	FT-2
BC-64 Corridor	B	1' x 1' Ceiling Tile/Pucks		1'x1'	Large/Small Pinholes	16 sf	Good	<1% Amosite/5% Chrysotile (Pucks)	Friable/Non-Friable	01-028	
BC-63	B	2" x 2" Ceiling Tile	CT-4		Long Fissures w/Pinholes	180 sf	Good	None Detected		01-010	CT-4
BC-63	B	12" X 12" Floortile and Mastic	FT-2	12"x12"	Cream w/White Specks	180 sf	Good	None Detected		01-013	FT-2
BC-66 Corridor	B	2" x 2" Ceiling Tile	CT-4		Long Fissures w/Pinholes	150 sf	Good	None Detected		01-010	CT-4
BC-66 Corridor	B	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	150 sf	Good	None Detected		01-006	FT-1
BC-66	B	1" x 1" Ceramic Floor/wall Tile		1"x1"	Tan	95 sf	Good				New
BC-66	B	2" x 2" Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	95 sf	Good	None Detected		01-010	CT-4
BC-67	B	1" x 1" Ceramic Floor/wall Tile		1"x1"	Tan	125 sf	Good				New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BC-67	B	2" x 2" Ceiling Tile	CT-4		Long Fissures w/Pinholes	125 sf	Good	None Detected		01-010	CT-4
BC-89	B	2" x 2" Ceiling Tile	CT-5		Random Fissures w/Pinholes	155 sf	Good	None Detected		01-012	CT-5
BC-89	B	Thermal System Insulation			Gray	10 lf	Good	Assumed	Friable	Assumed	In Chase
BC-90	B	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	297 sf	Good	None Detected		01-043	Abated/Remodeled 2021
BC-90	B	Vinyl Plank Flooring			Rustic Look	150 sf	New			Non-Suspect	Abated/Remodeled 2021
BC-90A	B	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	125 sf	Good	None Detected		01-043	Abated/Remodeled 2021
BC-91	B	2" x 2" Ceiling Tile	CT-5		Random Fissures w/Pinholes	200 sf	Good	None Detected		01-012	CT-5
BC-91	B	Residual Black Mastic			Black	200 sf	Good	Assumed	Non-Friable	Assumed	Under Carpet
BC-93	B	2" x 2" Ceiling Tile	CT-5		Random Fissures w/Pinholes	200 sf	Good	None Detected		01-012	CT-5
BC-93	B	Residual Black Mastic			Black	200 sf	Good	Assumed	Non-Friable	Assumed	Under Carpet
BC-94	B	2" x 2" Ceiling Tile	CT-4		Long Fissures w/Pinholes	440 sf	Good	None Detected		01-010	CT-4
BC-94	B	12" X 12" Floortile and Mastic	FT-2	12"x12"	Cream w/White Specks	440 sf	Good	None Detected		01-013	FT-2
BC-95	B	1" x 1" Ceramic Floor/wall Tile		1"x1"	Tan/Green	250 sf	Good				New
BC-95	B	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	200 sf	Good	None Detected		01-012	CT-5
BC-95	B	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	330 sf	Good	None Detected		01-012	CT-5
BC-96	B	2" x 2" Ceiling Tile	CT-4		Long Fissures w/Pinholes	150 sf	Good	None Detected		01-010	CT-4
BC-96	B	Ceramic Wall Tile			White	50 sf	Good				New
BC-96	B	12" X 12" Floortile and Mastic	FT-2	12"x12"	Cream w/White Specks	150 sf	Good	None Detected		01-013	FT-2
Main North/South Corridor	B	12" X 12" Floortile and Mastic	FT-3	12"x12"	Gray w/Brown Streaks	1550 sf	Good	4% Chrysotile (FT)	Non-Friable	01-014	Possible 2 layers

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
Main North/South Corridor	B	Thermal System Insulation			White	1 lf	POOR	Assumed	Friable	Assumed	Open End-By Small Independence Elevator
BE-03	B	2" x 2" Ceiling Tile	CT-4		Long Fissures w/Pinholes	130 sf	Good	None Detected		01-010	CT-4
BE-03	B	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	130 sf	Good	None Detected		01-006	FT-1
BE-05	B	Spray-on Fireproofing			White Fluffy	1200 sf		None Detected		01-015A-C	
BE-05	B	Thermal System Insulation			Gray	2 lf	Good				In Ceiling/Riser
Corridor Outside Independence Elevators	B	12" X 12" Floortile and Mastic	FT-4	12"x12"	Cream w/White and Gray specks	350 sf	Good	None Detected		01-017	
BE-30	B	Duct Seam Sealant			Black	50 lf	Good				
BE-31 Corridor	B	12" X 12" Floortile and Mastic	FT-5	12"x12"	Cream w/Brown and White	800 sf	Good	None Detected		01-018	
BE-31	B	No Suspect Materials Found									
BE-34	B	No Suspect Materials Found									
BE-35	B	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	150 sf	Good				CT-5
BE-35	B	12" X 12" Floortile and Mastic	FT-2	12"x12"	Cream w/White Specks	150 sf	Good	None Detected		01-013	FT-2
BE-35	B	Ceramic Floor/Wall Tile			White/Green	30 sf	Good				
BE-38C	B	Ceramic Wall Tile			Tan	30 sf	Good	None Detected		01-022	
BE-38C	B	1" Ceramic Tile Flooring		1"	Tan	30 sf	Good	None Detected		01-023	
BE-38C	B	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	30 sf	Good				CT-5
BE-38	B	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	720 sf	Good				CT-5
BE-38	B	12" X 12" Floortile and Mastic	FT-2	12"x12"	Cream w/White Specks	720	Good	None Detected		01-013	FT-2

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BE-38A	B	Ceramic Wall Tile			Tan	50 sf	Good	None Detected		01-022	
BE-38A	B	1" Ceramic Tile Flooring		1"	Tan	125 sf	Good	None Detected		01-023	
BE-38B	B	Ceramic Wall Tile			Tan	50 sf	Good	None Detected		01-022	
BE-38B	B	1" Ceramic Tile Flooring		1"	Tan	125 sf	Good	None Detected		01-023	
BE-40	B	No Suspect Materials Found									
BE-42	B	No Suspect Materials Found									
BE-45	B	Thermal System Insulation			Gray	35 lf	Good	Assumed	Friable	Assumed	Above Ceiling
BE-45 North Loading Dock	B	Building Seam Caulk			Gray	120lf	Good	3% Chrysotile	Non-Friable	01-054	
BE-46	B	Thermal System Insulation			Gray	20 lf	Good	Assumed	Friable	Assumed	In Wall
BE-47	B	No Suspect Materials Found									
BE-50	B	No Suspect Materials Found									
BE-50 Corridor	B	Thermal System Insulation			Gray	16 lf	POOR	Assumed	Friable	Assumed	In Wall Behind Drinking Fountain-Open Ends
Stairwell # 1	B	Thermal System Insulation			Gray	16 lf	POOR	Assumed	Friable	Assumed	Open Ends in Wall
Stairwell # 1	B	12" X 12" Floortile and Mastic	FT-5	12"x12"	Cream w/Brown and White	65 sf	Good	None Detected		01-018	
BE-44	B	Thermal System Insulation			Gray	10 lf	Good	Assumed	Friable	Assumed	In wall SW Corner
BE-44	B	12" X 12" Floortile and Mastic	FT-6	12"x12"	Gray w/Brown and White Streaks	130 sf	Good	6% Chrysotile (Mastic)	Non-Friable	01-019	Black Mastic
BE-44A	B	No Suspect Materials Found									
BE-07	B	No Suspect Materials Found									

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BE-35 Corridor	B	12" X 12" Floortile and Mastic	FT-15	12"x12"	White w/Grey Streaks	670 sf	Good	None Detected		01-021	Corridor Only
BE-20	B	12" X 12" Floortile and Mastic	FT-15	12"x12"	White w/Grey Streaks	615 sf	Good	None Detected		01-021	
BB-01	B	9" x 9" Floortile		9"x9"	White w/Red and Black	6 sf	Good	5% Chrysotile FT	Non-Friable	01-053	Electrical Closet
BB-03	B	12" X 12" Floortile and Mastic	FT-5	12"x12"	Cream w/Brown and White	80 sf	Good	None Detected		01-018	
BE-02	B	12" X 12" Floortile and Mastic	FT-2	12"x12"	Cream w/White Specks	70 sf	Good	None Detected		01-013	
BE-02	B	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	70 sf	Good	None Detected		01-009	CT-3
Stairwell #3	B	12" X 12" Floortile and Mastic	FT-5	12"x12"	Cream w/Brown and White	100 sf	Good	None Detected		01-018	
BD-02	B	Thermal System Insulation			Gray	15 lf	Good	Assumed	Friable	Assumed	Accessible
BD-04	B	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	410 sf	Good	None Detected		01-009	CT-3
BD-04	B	12" X 12" Floortile and Mastic	FT-15	12"x12"	White w/Grey Streaks	410 sf	Good	None Detected		01-021	
BD-05	B	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	160 sf	Good	None Detected		01-009	CT-3
BD-05	B	12" X 12" Floortile and Mastic	FT-6	12"x12"	Gray w/Brown and White Streaks	160 sf	Good	6% Chrysotile (Mastic)	Non-Friable	01-019	Black Mastic
BD-06	B	Thermal System Insulation			Gray	1 lf	Good	Assumed	Friable	Assumed	Accessible
BD-06	B	12" X 12" Floortile and Mastic	FT-4	12"x12"	Cream w/White and Gray specks	110 sf	Good	None Detected		01-017	
BD-06	B	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	110 sf	Good	None Detected		01-009	CT-3
BD-05	B	9" x 9" Floortile		9"x9"	White w/Red and Black	150 sf	Good	5% Chrysotile FT	Non-Friable	01-053	Accessible
BE-10	B	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	262 sf	Good	None Detected		01-009	CT-3
BE-10	B	12" X 12" Floortile and Mastic	FT-6	12"x12"	Gray w/Brown and White Streaks	262 sf	Good	6% Chrysotile (Mastic)	Non-Friable	01-019	Black Mastic

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BE-10	B	12" X 12" Floortile and Mastic	FT-15	12"x12"	White w/Grey Streaks	390 sf	Good	None Detected		01-021	
BD-08	B	9" x 9" Floortile		9"x9"	White w/Red and Black	220 sf	Good	5% Chrysotile FT	Non-Friable	01-053	Accessible
BD-10	B	2' x 4' Ceiling Tile	CT-7	2'x4'	Deep Lengthwise Fissures	107 sf	Good	None Detected		01-027	CT-7
BD-10 Men's Restroom	B	4" Ceramic Wall Tile		4"	White/Gold	150 sf	Good	Assumed	Non-Friable	Assumed	
BD-10 Men's Restroom	B	1" Ceramic Tile Flooring		1"	White/Gold	150 sf	Good	Assumed	Non-Friable	Assumed	
BD-11	B	12" X 12" Floortile and Mastic	FT-15	12"x12"	White w/Grey Streaks	400 sf	Good	None Detected		01-021	
BD-12 Women's Restroom	B	2' x 4' Ceiling Tile	CT-7	2'x4'	Deep Lengthwise Fissures	140 sf	Good	None Detected		01-027	CT-7
BD-12 Women's Restroom	B	4" Ceramic Wall Tile		4"	White/Gold	200 sf	Good	Assumed	Non-Friable	Assumed	
BD-12 Women's Restroom	B	1" Ceramic Tile Flooring		1"	White/Gold	200 sf	Good	Assumed	Non-Friable	Assumed	
Main Engineering Corridor	B	12" X 12" Floortile and Mastic		12"x12"	Tan w/Brown/Gray/White Specks	485 sf	Good				
Main Engineering Corridor	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	485 sf	Good	None Detected		01-0010	
BD-31	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	127 sf	Good	None Detected		01-0010	
BD-33	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	127 sf	Good	None Detected		01-0010	
Main Corridor West Outside BD-34	B	Thermal System Insulation			Gray	2 lf	Good	Assumed	Friable	Assumed	Stubs in wall
BD-34	B	12" X 12" Floortile and Mastic	FT-4	12"x12"	Cream w/White and Gray specks	300 sf	Good	None Detected		01-017	
BD-34	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	300 sf	Good	None Detected		01-0010	
BD-35	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	110 sf	Good	None Detected		01-0010	
BD-36	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	147 sf	Good	None Detected		01-0010	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BD-37	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	98 sf	Good	None Detected		01-0010	
BD-38	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	148 sf	Good	None Detected		01-0010	
BD-39	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	148 sf	Good	None Detected		01-0010	
BD-40	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	148 sf	Good	None Detected		01-0010	
BD-41	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	112 sf	Good	None Detected		01-0010	
BD-42	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	143 sf	Good	None Detected		01-0010	
BD-43	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	112 sf	Good	None Detected		01-0010	
BD-45	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	108 sf	Good	None Detected		01-0010	
BD-47	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	118 sf	Good	None Detected		01-0010	
BD-50	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	842 sf	Good	None Detected		01-0010	
BD-50A	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	156 sf	Good	None Detected		01-0010	
BD-50D	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	204 sf	Good	None Detected		01-0010	
Corridor Outside BD-23	B	2" x 2" Ceiling Tile	CT-5		Ramdom Fissures w/Pinholes	86 sf	Good	None Detected		01-012	CT-5
Corridor Outside BD-23	B	12" X 12" Floortile and Mastic	FT-15	12"x12"	White w/Grey Streaks	86 sf	Good	None Detected		01-021	Black Mastic
BD-23	B	2" x 2" Ceiling Tile	CT-5		Ramdom Fissures w/Pinholes	130 sf	Good	None Detected		01-012	CT-5
BD-23	B	Residual Black Mastic			Black	130 sf	Good	Assumed	Non-Friable	Assumed	Under Carpet
BD-22	B	2" x 2" Ceiling Tile	CT-5		Ramdom Fissures w/Pinholes	304 sf	Good	None Detected		01-012	CT-5
BD-22	B	Residual Black Mastic			Black	304 sf	Good	Assumed	Non-Friable	Assumed	Under Carpet
BD-21	B	2" x 2" Ceiling Tile	CT-5		Ramdom Fissures w/Pinholes	257 sf	Good	None Detected		01-012	CT-5

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BD-21	B	Residual Black Mastic			Black	257 sf	Good	Assumed	Non-Friable	Assumed	Under Carpet
BD-20	B	2" x 2" Ceiling Tile	CT-5		Random Fissures w/Pinholes	192 sf	Good	None Detected		01-012	CT-5
BD-20	B	Residual Black Mastic			Black	192 sfr	Good	Assumed	Non-Friable	Assumed	Under Carpet
BD-60	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	207 sf	Good	None Detected		01-030	
BD-60	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	207 sf	Good	None Detected		01-029	
BD-60A	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	96 sf	Good	None Detected		01-030	
BD-60A	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	96 sf	Good	None Detected		01-029	
BD-60B	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	132 sf	Good	None Detected		01-030	
BD-60B	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	132 sf	Good	None Detected		01-029	
BD-60C	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	429 sf	Good	None Detected		01-030	
BD-60C	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	429 sf	Good	None Detected		01-029	
BD-60D	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	935 sf	Good	None Detected		01-030	
BD-60D	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	935 sf	Good	None Detected		01-029	
BD-60E	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	76 sf	Good	None Detected		01-030	
BD-60E	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	76 sf	Good	None Detected		01-029	
BD-60 Corridor	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	275 sf	Good	None Detected		01-030	
BD-60 Corridor	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	275 sf	Good	None Detected		01-029	
BD-61	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	146 sf	Good	None Detected		01-030	

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BD-61	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	146 sf	Good	None Detected		01-029	
BD-62	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	262 sf	Good	None Detected		01-030	
BD-62	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	262 sf	Good	None Detected		01-029	
BD-63	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	314 sf	Good	None Detected		01-030	
BD-63	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	314 sf	Good	None Detected		01-029	
BD-63A	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	135 sf	Good	None Detected		01-030	
BD-63A	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	135 sf	Good	None Detected		01-029	
BD-63A1	B	No Suspect Materials Found									
BD-65	B	No Suspect Materials Found									
BD-65A	B	No Suspect Materials Found									
BD-65 Corridor	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	624 sf	Good	None Detected		01-030	
BD-65 Corridor	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	624 sf	Good	None Detected		01-029	
BD-70	B	No Suspect Materials Found									
BD-75A	B	No Suspect Materials Found									
BD-75B	B	No Suspect Materials Found									
BD-70 North/South Corridor	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	913 sf	Good	None Detected		01-030	
BD-70 North/South Corridor	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	913 sf	Good	None Detected		01-029	
BD-80	B	No Suspect Materials Found									

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BD-81	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	57 sf	Good	None Detected		01-030	
BD-81	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	57 sf	Good	None Detected		01-029	
BD-83	B	No Suspect Materials Found									
BD-83	B	No Suspect Materials Found									
BD-84	B	No Suspect Materials Found									
BD-85A	B	No Suspect Materials Found									
BD-85B	B	No Suspect Materials Found									
BD-86	B	No Suspect Materials Found									
BD-90	B	No Suspect Materials Found									
BD-91	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	140 sf	Good	None Detected		01-030	
BD-91	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	140 sf	Good	None Detected		01-029	
BD-92	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	140 sf	Good	None Detected		01-030	
BD-92	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	140 sf	Good	None Detected		01-029	
BD-95	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	756 sf	Good	None Detected		01-030	
BD-95	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	756 sf	Good	None Detected		01-029	
BD-90 Corridor	B	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	839 sf	Good	None Detected		01-030	
BD-90 Corridor	B	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	839 sf	Good	None Detected		01-029	
1C-70	1	2" x 2" Ceiling Tile	CT-6		Vinyl Covered Sheetrock Look	1645 sf	Good	None Detected		01-024	CT-6
1C-70	1	Sheet Vinyl Floor			White	1645 sf	Good	None Detected		01-031	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-70A	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	22 sf	Good	None Detected		01-030	
1C-70A	1	2" x 2" Ceiling Tile	CT-6		Vinyl Covered Sheetrock Look	22 sf	Good	None Detected		01-024	CT-6
1C-70B	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	148 sf	Good	None Detected		01-030	
1C-70B	1	2" x 2" Ceiling Tile	CT-6		Vinyl Covered Sheetrock Look	148 sf	Good	None Detected		01-024	CT-6
1C-70C	1	Ceramic Floor/Wall Tile			Cream/Gray	150 sf	Good			Non-Suspect	Installed 2013
1C-70D	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	62 sf	Good	None Detected		01-030	
1C-70D	1	2" x 2" Ceiling Tile	CT-6		Vinyl Covered Sheetrock Look	62 sf	Good	None Detected		01-024	CT-6
1C-42	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	162 sf	Good	None Detected		01-029	Carpet
1C-41	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	364 sf	Good	None Detected		01-029	Carpet
1C-81	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	88 sf	Good	None Detected		01-029	
1C-81	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	88 sf	Good	None Detected		01-030	
1C-86	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	228 sf	Good	None Detected		01-0010	
1C-86	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	228 sf	Good	None Detected		01-030	Under Carpet
1C-86	1	Thermal System Insulation	Air Cell		Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
1C-30	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	181 sf	Good	None Detected		01-006	FT-1
1C-31	1	12" X 12" Floortile and Mastic	FT-8	12"x12"	White w/Gray/Dk.Gray Specks	201 sf	Good	None Detected		01-032	
1C-31	1	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	201 sf	Good	None Detected		01-008	CT-2
1C-31	1	Thermal System Insulation	Air Cell		Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-82	1	No Suspect Materials Found									
1C-85	1	2" x 2" Ceiling Tile	CT-6		Vinyl Covered Sheetrock Look	228 sf	Good	None Detected		01-024	CT-6
1C-85	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	228 sf	Good	None Detected		01-030	
1C-85A	1	2" x 2" Ceiling Tile	CT-6		Vinyl Covered Sheetrock Look	30 sf	Good	None Detected		01-024	CT-6
1C-85A	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	30 sf	Good	None Detected		01-030	
1C-84	1	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	58 sf	Good	None Detected		01-008	CT-2
1C-84	1	4" Ceramic Wall Tile		4"	Tan	58 sf	Good	None Detected		01-022	
1C-84	1	1" Ceramic Tile Flooring		1"	Tan	58 sf	Good	None Detected		01-023	
1C-83	1	Ceramic Wall Tile			Tan	100 sf	Good	None Detected		01-022	
1C-83	1	1" Ceramic Tile Flooring		1"	Tan	49 sf	Good	None Detected		01-023	
1C-123 Corridors	1	2' x 2' Ceiling Tile	CT-1	2'x2'	Random Fissures w/Pinholes (Drop-in)	596 sf	Good	None Detected		01-002	
1C-123 Corridors	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	596 sf	Good	None Detected		01-006	FT-1
1C-101	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	97 sf	Good	None Detected		01-0010	
1C-101	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	97 sf	Good	None Detected		01-006	FT-1
1C-102	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	99 sf	Good	None Detected		01-0010	
1C-102	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	99 sf	Good	None Detected		01-006	FT-1
1C-103	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	97 sf	Good	None Detected		01-0010	
1C-103	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	97 sf	Good	None Detected		01-006	FT-1

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-104	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	99 sf	Good	None Detected		01-0010	
1C-104	1	12" X 12" Floortile and Mastic	FT-10	12"x12"	Cream Textured	99 sf	Good	None Detected		01-034	FT-10
1C-105	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	56 sf	Good	None Detected		01-0010	
1C-105	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	56 sf	Good	None Detected		01-006	FT-1
1C-106	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	47 sf	Good	None Detected		01-0010	
1C-106	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	47 sf	Good	None Detected		01-006	FT-1
1C-107	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	97 sf	Good	None Detected		01-0010	
1C-107	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	97 sf	Good	None Detected		01-006	FT-1
1C-108	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	39 sf	Good	None Detected		01-0010	
1C-108	1	Sheet Vinyl Floor			Cream w/Blue and Pink	39 sf	Good	None Detected		01-035	
1C-109	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	99 sf	Good	None Detected		01-0010	
1C-109	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	99 sf	Good	None Detected		01-006	FT-1
1C-110	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	99 sf	Good	None Detected		01-0010	
1C-110	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	99 sf	Good	None Detected		01-006	FT-1
1C-111	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	144 sf	Good	None Detected		01-0010	
1C-111	1	12" X 12" Floortile and Mastic	FT-10	12"x12"	Cream Textured	144 sf	Good	None Detected		01-034	FT-10
1C-112	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	104 sf	Good	None Detected		01-0010	
1C-112	1	12" X 12" Floortile and Mastic	FT-10	12"x12"	Cream Textured	104 sf	Good	None Detected		01-034	FT-10

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-113	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	91 sf	Good	None Detected		01-0010	
1C-113	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	91 sf	Good	None Detected		01-006	FT-1
1C-114	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	166 sf	Good	None Detected		01-0010	
1C-114	1	12" X 12" Floortile and Mastic	FT-10	12"x12"	Cream Textured	166 sf	Good	None Detected		01-034	FT-10
1C-115	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	97 sf	Good	None Detected		01-0010	
1C-115	1	12" X 12" Floortile and Mastic	FT-10	12"x12"	Cream Textured	97 sf	Good	None Detected		01-034	FT-10
1C-117	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	97 sf	Good	None Detected		01-0010	
1C-117	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	97 sf	Good	None Detected		01-006	FT-1
1C-118	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	92 sf	Good	None Detected		01-0010	
1C-118	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	92 sf	Good	None Detected		01-006	FT-1
1C-119	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	95 sf	Good	None Detected		01-0010	
1C-119	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	95 sf	Good	None Detected		01-006	FT-1
1C-120	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	135 sf	Good	None Detected		01-0010	
1C-120	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	135 sf	Good	None Detected		01-006	FT-1
1C-120A	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	29 sf	Good	None Detected		01-0010	
1C-120A	1	1" Ceramic Tile Flooring		1"	Tan	29 sf	Good	None Detected		01-023	
1C-120A	1	4" Ceramic Wall Tile		4"	Tan	50 sf	Good	None Detected		01-022	
1C-121	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	95 sfd	Good	None Detected		01-0010	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-121	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	95 sf	Good	None Detected		01-006	FT-1
1C-123	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	283 sf	Good	None Detected		01-0010	
1C-123	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	283 sf	Good	None Detected		01-006	FT-1
1C-125	1	No Suspect Materials Found									
1C-125	1	No Suspect Materials Found									
1E-01	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	276 sf	Good	None Detected		01-029	
1E-05	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	377 sf	Good	None Detected		01-029	
1E-05A	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	49 sf	Good	None Detected		01-029	
1E-06	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	104 sf	Good	None Detected		01-029	
1E-07	1	Sheet Vinyl Floor			Brown/Gray Mosaic	131 sf	Good	None Detected		01-036	
1E-07	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	131 sf	Good	None Detected		01-029	
1E-08	1	Sheet Vinyl Floor			Brown/Gray Mosaic	132 sf	Good	None Detected		01-036	
1E-08	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	132 sf	Good	None Detected		01-029	
1E-09	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	103 sf	Good	None Detected		01-029	
1E-10	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	106 sf	Good	None Detected		01-029	
1E-11	1	Sheet Vinyl Floor			Brown/Gray Mosaic	255 sf	Good	None Detected		01-036	
1E-11	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	255 sf	Good	None Detected		01-029	
1E-15	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	384 sf	Good	None Detected		01-029	
1E-20	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	779 sf	Good	None Detected		01-030	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1E-20	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	779 sf	Good	None Detected		01-029	
1E-25	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	1500 sf	Good	None Detected		01-029	
1E-25	1	Sheet Vinyl Floor			Wood Look	1,500	Good	None Detected		01-037	New
1E-25A	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	1500 sf	Good	None Detected		01-029	
1E-25A	1	Sheet Vinyl Floor			Wood Look	162 sf	Good	None Detected		01-037	
1E-25B	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	1,500	Good	None Detected		01-029	
1E-25B	1	Sheet Vinyl Floor			Wood Look	162 sf	Good	None Detected		01-037	
Stair #1	1	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Wall
1E-26	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	123 sf	Good	None Detected		01-029	
1E-26	1	Sheet Vinyl Floor			Brown/Gray Mosaic	123 sf	Good	None Detected		01-036	
1E-27	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	125 sf	Good	None Detected		01-029	
1E-27	1	Sheet Vinyl Floor			Brown/Gray Mosaic	125 sf	Good	None Detected		01-036	
1E-28	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	259 sf	Good	None Detected		01-029	
1E-28	1	Sheet Vinyl Floor			Brown/Gray Mosaic	259 sf	Good	None Detected		01-036	
1E-28A	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	64 sf	Good	None Detected		01-029	
1E-28A	1	Sheet Vinyl Floor			Brown/Gray Mosaic	64 sf	Good	None Detected		01-036	
1E-30	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	600 sf	Good	None Detected		01-029	
1E-30	1	Sheet Vinyl Floor			Brown/Gray Mosaic	600 sf	Good	None Detected		01-036	
1E-30A	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	70 sf	Good	None Detected		01-029	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1E-30A	1	Sheet Vinyl Floor			Brown/Gray Mosaic	70 sf	Good	None Detected		01-036	
1E-31	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	274 sf	Good	None Detected		01-029	
1E-31	1	Sheet Vinyl Floor			Brown/Gray Mosaic	274 sf	Good	None Detected		01-036	
1E-32	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	143 sf	Good	None Detected		01-029	
1E-32	1	Sheet Vinyl Floor			Brown/Gray Mosaic	143 sf	Good	None Detected		01-036	
1E-33	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	143 sf	Good	None Detected		01-029	
1E-33	1	Sheet Vinyl Floor			Brown/Gray Mosaic	143 sf	Good	None Detected		01-036	
1E-34	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	140 sf	Good	None Detected		01-029	
1E-34	1	Sheet Vinyl Floor			Brown/Gray Mosaic	140 sf	Good	None Detected		01-036	
1E-34A	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	63 sf	Good	None Detected		01-029	
1E-34A	1	Sheet Vinyl Floor			Brown/Gray Mosaic	63 sf	Good	None Detected		01-036	
1E-35	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	196 sf	Good	None Detected		01-030	
1E-35	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	196 sf	Good	None Detected		01-029	
1E-36	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	97 sf	Good	None Detected		01-030	
1E-36	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	97 sf	Good	None Detected		01-029	
1E-36 Corridor	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	188 sf	Good	None Detected		01-030	
1E-36 Corridor	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	188 sf	Good	None Detected		01-029	
1E-37	1	4" Ceramic Wall Tile		4"	Tan	200 sf	Good			Non-Suspect	New
1E-37	1	2" Ceramic Floor Tile		2"	Brown	50 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1E-37	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	50 sf	Good	None Detected		01-029	
1E-38	1	4" Ceramic Wall Tile		4"	Tan	250 sf	Good			Non-Suspect	New
1E-38	1	2" Ceramic Floor Tile		2"	Brown	171 sf	Good			Non-Suspect	New
1E-38	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	171 sf	Good	None Detected		01-029	
1E-39	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	171 sf	Good	None Detected		01-029	
1E-39	1	Sheet Vinyl Floor			Brown/Gray Mosaic	171 sf	Good	None Detected		01-036	
1E-39 Corridor	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	462 sf	Good	None Detected		01-029	
1E-39 Corridor	1	Sheet Vinyl Floor			Brown/Gray Mosaic	462 sf	Good	None Detected		01-036	
1E-40	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	135 sf	Good	None Detected		01-029	
1E-41	1	4" Ceramic Wall Tile		4"	Tan	250 sf	Good				New
1E-41	1	2" Ceramic Floor Tile		2"	Brown	91 sf	Good				New
1E-41	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	91 sf	Good	None Detected		01-024	CT-6
1E-41 Corridor	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	298 sf	Good	None Detected		01-030	
1E-41 Corridor	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	298 sf	Good	None Detected		01-029	
1C-88	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	214 sf	Good	None Detected		01-029	
1C-88	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	214 sf	Good	None Detected		01-030	
1C-88	1	Thermal System Insulation	Air Cell		Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
1C-89	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	227 sf	Good	None Detected		01-029	
1C-89	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	227 sf	Good	None Detected		01-030	

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-89	1	Thermal System Insulation	Air Cell		Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
1C-90	1	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	179 sf	Good	None Detected		01-008	CT-2
1C-90	1	Thermal System Insulation	Air Cell		Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
1C-91	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	157 sf	Good	None Detected		01-0010	
1C-91	1	Thermal System Insulation	Air Cell		Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
1C-92	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	126 sf	Good	None Detected		01-0010	
1C-92	1	Thermal System Insulation	Air Cell		Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
1C-93	1	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	134 sf	Good	None Detected		01-008	CT-2
1C-93	1	Thermal System Insulation	Air Cell		Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
1C-94	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	126 sf	Good	None Detected		01-0010	
1C-94	1	Thermal System Insulation	Air Cell		Gray	32 lf	Good	Assumed	Friable	Assumed	In Chase
1C-95	1	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	133 sf	Good	None Detected		01-008	CT-2
1C-95	1	Thermal System Insulation	Air Cell		Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
1C-96	1	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	199 sf	Good	None Detected		01-008	CT-2
1C-96	1	Thermal System Insulation	Air Cell		Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
1C-97	1	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	199 sf	Good	None Detected		01-008	CT-2
1C-97	1	Thermal System Insulation	Air Cell		Gray	32 lf	Good	Assumed	Friable	Assumed	In Chase
1C-99	1	Need Access									

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-02	1	No Suspect Materials Found									
1D-01	1	12" X 12" Floortile and Mastic	FT-9	12"x12"	Gray w/White and Brown Streaks	113 sf	Good	4% Chrysotile (FT)/10% Chrysotile (Mastic)	Non-Friable	01-033	FT-8
1D-03	1	2" x 2" Ceiling Tile	CT-5		Random Fissures w/Pinholes	279 sf	Good	None Detected		01-012	CT-5
1D-05	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	186 sf	Good	None Detected		01-010	CT-4
1D-06	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	109 sf	Good	None Detected		01-010	CT-4
1D-06	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	109 sf	Good	None Detected		01-038	FT-11
1D-06 Corridor	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	158 sf	Good	None Detected		01-010	CT-4
1D-06 Corridor	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	158 sf	Good	None Detected		01-038	FT-11
1D-07	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	104 sf	Good	None Detected		01-010	CT-4
1D-07	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	104 sf	Good	None Detected		01-038	FT-11
1D-08	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	54 sf	Good	None Detected		01-010	CT-4
1D-08	1	2" Ceramic Floor Tile		2"	Dark Gray	54 sf	Good			Non-Suspect	New
1D-08	1	4" Ceramic Wall Tile		4"	Dark Gray	100 sf	Good			Non-Suspect	New
1D-09	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	180 sf	Good	None Detected		01-010	CT-4
1D-09	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	180 sf	Good	None Detected		01-038	FT-11
1D-10	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	136 sf	Good	None Detected		01-010	CT-4
1D-10	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	136 sf	Good	None Detected		01-038	FT-11
1D-10 Corridor	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	154 sf	Good	None Detected		01-010	CT-4

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-10 Corridor	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	154 sf	Good	None Detected		01-038	FT-11
1D-11	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	304 sf	Good	None Detected		01-010	CT-4
1D-11	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	304 sf	Good	None Detected		01-038	FT-11
1D-11 Corridor	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	162 sf	Good	None Detected		01-010	CT-4
1D-11 Corridor	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	162 sf	Good	None Detected		01-038	FT-11
1D-12	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	75 sf	Good	None Detected		01-010	CT-4
1D-12	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	75 sf	Good	None Detected		01-038	FT-11
1D-13	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	118 sf	Good	None Detected		01-010	CT-4
1D-13	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	118 sf	Good	None Detected		01-038	FT-11
1D-14	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	121 sf	Good	None Detected		01-010	CT-4
1D-14	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	121 sf	Good	None Detected		01-038	FT-11
1D-14 Corridor	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	295 sf	Good	None Detected		01-010	CT-4
1D-14 Corridor	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	295 sf	Good	None Detected		01-038	FT-11
1D-15	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	160 sf	Good	None Detected		01-010	CT-4
1D-15	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	160 sf	Good	None Detected		01-038	FT-11
1D-16	1	No Suspect Materials									
1D-17	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	55 sf	Good	None Detected		01-010	CT-4
1D-17	1	2" Ceramic Floor Tile		2"	Dark Gray	55 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-17	1	4" Ceramic Wall Tile		4"	Dark Gray	100 sf	Good			Non-Suspect	New
1D-18	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	118 sf	Good	None Detected		01-010	CT-4
1D-18	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	118 sf	Good	None Detected		01-038	FT-11
1D-19	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	115 sf	Good	None Detected		01-010	CT-4
1D-19	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	115 sf	Good	None Detected		01-038	FT-11
1D-19 Corridor	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	68 sf	Good	None Detected		01-010	CT-4
1D-19 Corridor	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	68 sf	Good	None Detected		01-038	FT-11
1D-20	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	113 sf	Good	None Detected		01-010	CT-4
1D-20	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	113 sf	Good	None Detected		01-038	FT-11
1D-22	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	55 sf	Good	None Detected		01-010	CT-4
1D-22	1	2" Ceramic Floor Tile		2"	Dark Gray	55 sf	Good			Non-Suspect	New
1D-22	1	4" Ceramic Wall Tile		4"	Dark Gray	100 sf	Good			Non-Suspect	New
1D-23	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	101 sf	Good	None Detected		01-010	CT-4
1D-23	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	101 sf	Good	None Detected		01-038	FT-11
1D-24	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	173 sf	Good	None Detected		01-010	CT-4
1D-24	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	173 sf	Good	None Detected		01-038	FT-11
1D-25	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	146 sf	Good	None Detected		01-010	CT-4
1D-25	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	146 sf	Good	None Detected		01-038	FT-11

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-26	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	120 sf	Good	None Detected		01-010	CT-4
1D-26	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	120 sf	Good	None Detected		01-038	FT-11
1D-27	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	74 sf	Good	None Detected		01-010	CT-4
1D-27	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	74 sf	Good	None Detected		01-038	FT-11
1D-28	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	120 sf	Good	None Detected		01-010	CT-4
1D-28	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	120 sf	Good	None Detected		01-038	FT-11
1D-29	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	116 sf	Good	None Detected		01-010	CT-4
1D-29	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	116 sf	Good	None Detected		01-038	FT-11
1D-30	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	115 sf	Good	None Detected		01-010	CT-4
1D-30	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	115 sf	Good	None Detected		01-038	FT-11
1D-31	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	124 sf	Good	None Detected		01-010	CT-4
1D-31	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	124 sf	Good	None Detected		01-038	FT-11
1D-32	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	130 sf	Good	None Detected		01-010	CT-4
1D-32	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	130 sf	Good	None Detected		01-038	FT-11
1D-33	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	133 sf	Good	None Detected		01-010	CT-4
1D-33	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	133 sf	Good	None Detected		01-038	FT-11
1D-33 Corridor	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	516 sf	Good	None Detected		01-010	CT-4
1D-33 Corridor	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	516 sf	Good	None Detected		01-038	FT-11

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-34	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	103 sf	Good	None Detected		01-010	CT-4
1D-34	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	103 sf	Good	None Detected		01-038	FT-11
1D-35	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	430 sf	Good	None Detected		01-010	Carpet
1D-36	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	90 sf	Good	None Detected		01-010	CT-4
1D-36	1	2" Ceramic Floor Tile		2"	Dark Gray	90 sf	Good			Non-Suspect	New
1D-36	1	4" Ceramic Wall Tile		4"	Dark Gray	150 sf	Good			Non-Suspect	New
1D-37	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	90 sf	Good	None Detected		01-010	CT-4
1D-37	1	2" Ceramic Floor Tile		2"	Dark Gray	90 sf	Good			Non-Suspect	New
1D-37	1	4" Ceramic Wall Tile		4"	Dark Gray	150 sf	Good			Non-Suspect	New
1D-38	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	103 sf	Good	None Detected		01-010	CT-4
1D-38	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	103 sf	Good	None Detected		01-038	FT-11
1D-39	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	107 sf	Good	None Detected		01-010	CT-4
1D-39	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	107 sf	Good	None Detected		01-038	FT-11
North/South Corridor	1	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	542 sf	Good	None Detected		01-010	CT-4
North/South Corridor	1	12" X 12" Floortile and Mastic	FT-11	12"x12"	White w/Dark Gray Streaks	542 sf	Good	None Detected		01-038	FT-11
1D-40	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	1195 sf	Good	None Detected		01-043	CT-10
1D-40	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	1195 sf	Good	None Detected		01-039	
1D-41	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	315 sf	Good	None Detected		01-043	CT-10

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-41	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	315 sf	Good	None Detected		01-039	
1D-42	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	385 sf	Good	None Detected		01-041	Carpet
1D-43	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	385 sf	Good	None Detected		01-041	Carpet
1D-44	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	43 sf	Good	None Detected		01-041	
1D-44	1	Sheet Vinyl Floor			Light Gray w/Dark Gray and White	43 sf	Good	None Detected		01-040	
1D-44	1	Ceramic Wall Tile			4" White	20 sf	Good			Non-Suspect	
1D-45	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	43 sf	Good	None Detected		01-041	
1D-45	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	43 sf	Good	None Detected		01-030	
1D-46	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	54 sf	Good	None Detected		01-041	
1D-46	1	2" Ceramic Floor Tile		2"	Light Gray	54 sf	Good			Non-Suspect	New
1D-46	1	4" Ceramic Wall Tile		4"	White	150 sf	Good			Non-Suspect	New
1D-47	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	54 sf	Good	None Detected		01-041	
1D-47	1	2" Ceramic Floor Tile		2"	Light Gray	54 sf	Good			Non-Suspect	New
1D-47	1	4" Ceramic Wall Tile		4"	White	150 sf	Good			Non-Suspect	New
1D-50	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	737 sf	Good	None Detected		01-043	CT-10
1D-50	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	737 sf	Good	None Detected		01-039	
1D-50 Corridor West/East	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	642 sf	Good	None Detected		01-043	CT-10
1D-50 Corridor West/East	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	642 sf	Good	None Detected		01-039	
1D-51	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	120 sf	Good	None Detected		01-041	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-51	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	120 sf	Good	None Detected		01-030	
1D-52	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	120 sf	Good	None Detected		01-041	
1D-52	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	120 sf	Good	None Detected		01-030	
1D-53	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	120 sf	Good	None Detected		01-041	
1D-53	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	120 sf	Good	None Detected		01-030	
1D-54	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	120 sf	Good	None Detected		01-041	
1D-54	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	120 sdf	Good	None Detected		01-030	
1D-55	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	120 sf	Good	None Detected		01-041	
1D-55	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	162 sf	Good	None Detected		01-040	
1D-55A	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	42 sf	Good	None Detected		01-041	
1D-55A	1	2" Ceramic Floor Tile		2"	Light Gray	42 sf	Good			Non-Suspect	New
1D-55A	1	4" Ceramic Wall Tile		4"	White	120 sf	Good			Non-Suspect	New
1D-56	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	50 sf	Good	None Detected		01-024	CT-6
1D-56	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	50 sf	Good	None Detected		01-040	
1D-57	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	50 sf	Good	None Detected		01-024	CT-6
1D-57	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	50 sf	Good	None Detected		01-040	
1D-57 Corridor North/South	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	134 sf	Good	None Detected		01-043	CT-10
1D-57 Corridor North/South	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	134 sf	Good	None Detected		01-039	
1D-58	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	50 sf	Good	None Detected		01-024	CT-6

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-58	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	50 sf	Good	None Detected		01-040	
1D-59	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	153 sf	Good	None Detected		01-041	
1D-59	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	153 sf	Good	None Detected		01-030	
1D-60	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	121 sf	Good	None Detected		01-041	
1D-60	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	121 sf	Good	None Detected		01-030	
1D-60 Corridor West/East	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	642 sf	Good	None Detected		01-043	CT-10
1D-60 Corridor West/East	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	642 sf	Good	None Detected		01-039	
1D-61	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	120 sf	Good	None Detected		01-041	
1D-61	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	120 sf	Good	None Detected		01-030	
1D-62	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	118 sf	Good	None Detected		01-041	
1D-62	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	118 sf	Good	None Detected		01-030	
1D-63	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	114 sf	Good	None Detected		01-041	
1D-63	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	114 sf	Good	None Detected		01-030	
1D-64	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	476 sf	Good	None Detected		01-043	CT-10
1D-64	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	476 sf	Good	None Detected		01-039	
1D-64A	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	81 sf	Good	None Detected		01-030	
1D-64B	1	No Suspect Material									
1D-65	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	1147 sf	Good	None Detected		01-043	Carpet

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-66	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	121 sf	Good	None Detected		01-041	
1D-66	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	121 sf	Good	None Detected		01-030	
1D-67	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	121 sf	Good	None Detected		01-041	
1D-67	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	121 sf	Good	None Detected		01-030	
1D-68	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	121 sf	Good	None Detected		01-041	
1D-68	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	121 sf	Good	None Detected		01-030	
1D-69	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	121 sf	Good	None Detected		01-041	
1D-69	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	121 sf	Good	None Detected		01-030	
1D-70	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	200 sf	Good	None Detected		01-041	
1D-70	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	200 sf	Good	None Detected		01-040	
1D-71	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	45 sf	Good	None Detected		01-041	
1D-71	1	2" Ceramic Floor Tile		2"	Light Gray	45 sf	Good			Non-Suspect	New
1D-71	1	4" Ceramic Wall Tile		4"	White	120 sf	Good			Non-Suspect	New
1D-72	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	47 sf	Good	None Detected		01-024	CT-6
1D-72	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	47 sf	Good	None Detected		01-040	
1D-72 Corridor North/South	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	134 sf	Good	None Detected		01-043	CT-10
1D-72 Corridor North/South	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	134 sf	Good	None Detected		01-039	
1D-73	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	47 sf	Good	None Detected		01-024	CT-6
1D-73	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	47 sf	Good	None Detected		01-040	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-74	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	47 sf	Good	None Detected		01-024	CT-6
1D-74	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	47 sf	Good	None Detected		01-040	
1D-75	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	142 sf	Good	None Detected		01-041	
1D-75	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	142 sf	Good	None Detected		01-030	
1D-76	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	119 sf	Good	None Detected		01-041	
1D-76	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	119 sf	Good	None Detected		01-030	
1D-77	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	114 sf	Good	None Detected		01-041	
1D-77	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	114 sf	Good	None Detected		01-030	
1D-78	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	122 sf	Good	None Detected		01-041	
1D-78	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	122 sf	Good	None Detected		01-030	
1D-79	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	122 sf	Good	None Detected		01-041	
1D-79	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	122 sf	Good	None Detected		01-030	
1D-80	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	480 sf	Good	None Detected		01-043	Carpet
1D-80 Corridor West/East	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	648 sf	Good	None Detected		01-043	CT-10
1D-80 Corridor West/East	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	648 sf	Good	None Detected		01-039	
1D-81	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	120 sf	Good	None Detected		01-041	
1D-81	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	120 sf	Good	None Detected		01-030	
1D-82	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	120 sf	Good	None Detected		01-041	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-82	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	120 sf	Good	None Detected		01-030	
1D-83	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	120 sf	Good	None Detected		01-041	
1D-83	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	120 sf	Good	None Detected		01-030	
1D-84	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	121 sf	Good	None Detected		01-041	
1D-84	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	121 sf	Good	None Detected		01-030	
1D-85	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	150 sf	Good	None Detected		01-041	
1D-85	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	150 sf	Good	None Detected		01-030	
1D-86	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	35 sf	Good	None Detected		01-024	CT-6
1D-86	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	35 sf	Good	None Detected		01-040	
1D-86 Corridor North/South	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	88 sf	Good	None Detected		01-043	CT-10
1D-86 Corridor North/South	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	88 sf	Good	None Detected		01-039	
1D-87	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	39 sf	Good	None Detected		01-024	CT-6
1D-87	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	39 sf	Good	None Detected		01-040	
1D-95	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	480 sf	Good	None Detected		01-043	CT-10
1D-96	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	121 sf	Good	None Detected		01-041	
1D-96	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	121 sf	Good	None Detected		01-030	
1D-97	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	116 sf	Good	None Detected		01-041	
1D-97	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	116 sf	Good	None Detected		01-030	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-98	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	118 sf	Good	None Detected		01-041	
1D-98	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	118 sf	Good	None Detected		01-030	
1D-99	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	121 sf	Good	None Detected		01-041	
1D-99	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	121 sf	Good	None Detected		01-030	
1D-100	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	41 sf	Good	None Detected		01-024	CT-6
1D-100	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	41 sf	Good	None Detected		01-040	
1D-101	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	142 sf	Good	None Detected		01-041	
1D-101	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	142 sf	Good	None Detected		01-030	
1D-102	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	126 sf	Good	None Detected		01-041	
1D-102	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	126 sf	Good	None Detected		01-030	
1D-102 Corridor North/South	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	88 sf	Good	None Detected		01-043	CT-10
1D-102 Corridor North/South	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	88 sf	Good	None Detected		01-039	
1D-103	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	41 sf	Good	None Detected		01-024	CT-6
1D-103	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	41 sf	Good	None Detected		01-040	
1D-104	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	125 sf	Good	None Detected		01-041	
1D-104	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	125 sf	Good	None Detected		01-030	
1D-108	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	112 sf	Good	None Detected		01-041	
1D-108	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	112 sf	Good	None Detected		01-030	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-108 Corridor West/East	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	823 sf	Good	None Detected		01-043	CT-10
1D-108 Corridor West/East	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	823 sf	Good	None Detected		01-039	
1D-109	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	39 sf	Good	None Detected		01-041	
1D-109	1	2" Ceramic Floor Tile		2"	Light Gray	39 sf	Good			Non-Suspect	New
1D-109	1	4" Ceramic Wall Tile		4"	White	120 sf	Good			Non-Suspect	New
1D-110	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	118 sf	Good	None Detected		01-041	
1D-110	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	118 sf	Good	None Detected		01-030	
1D-112	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	121 sf	Good	None Detected		01-041	
1D-112	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	121 sf	Good	None Detected		01-030	
1D-113	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	55 sf	Good	None Detected		01-041	
1D-113	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	55 sf	Good	None Detected		01-040	
1D-115	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	39 sf	Good	None Detected		01-041	
1D-115	1	2" Ceramic Floor Tile		2"	Light Gray	39 sf	Good			Non-Suspect	New
1D-115	1	4" Ceramic Wall Tile		4"	White	120 sf	Good			Non-Suspect	New
1D-116	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	242 sf	Good	None Detected		01-041	Carpet
1D-117	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	39 sf	Good	None Detected		01-041	
1D-117	1	2" Ceramic Floor Tile		2"	Light Gray	39 sf	Good			Non-Suspect	New
1D-117	1	4" Ceramic Wall Tile		4"	White	120 sf	Good			Non-Suspect	New
1D-118	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	119 sf	Good	None Detected		01-041	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-118	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	119 sf	Good	None Detected		01-030	
1D-120	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	117 sf	Good	None Detected		01-041	
1D-120	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	117 sf	Good	None Detected		01-030	
1D-121	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	49 sf	Good	None Detected		01-043	CT-10
1D-121	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	49 sf	Good	None Detected		01-039	
1D-122	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	117 sf	Good	None Detected		01-041	
1D-122	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	117 sf	Good	None Detected		01-030	
1D-123	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	39 sf	Good	None Detected		01-041	
1D-123	1	2" Ceramic Floor Tile		2"	Light Gray	39 sf	Good			Non-Suspect	New
1D-123	1	4" Ceramic Wall Tile		4"	White	120 sf	Good			Non-Suspect	New
1D-124	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	243 sf	Good	None Detected		01-041	Carpet
1D-126	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	118 sf	Good	None Detected		01-041	
1D-126	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	118 sf	Good	None Detected		01-030	
1D-127A	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	52 sf	Good	None Detected		01-041	
1D-127A	1	2" Ceramic Floor Tile		2"	Light Gray	52 sf	Good			Non-Suspect	New
1D-127A	1	4" Ceramic Wall Tile		4"	White	120 sf	Good			Non-Suspect	New
1D-127B	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	52 sf	Good	None Detected		01-041	
1D-127B	1	2" Ceramic Floor Tile		2"	Light Gray	52 sf	Good			Non-Suspect	New
1D-127B	1	4" Ceramic Wall Tile		4"	White	120 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-128	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	230 sf	Good	None Detected		01-041	
1D-128	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	230 sf	Good	None Detected		01-030	
1D-129	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	230 sf	Good	None Detected		01-041	Carpet
1D-129 Corridor West/ East	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	192 sf	Good	None Detected		01-043	CT-10
1D-129 Corridor West/ East	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	192 sf	Good	None Detected		01-039	
1D-130	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	332 sf	Good	None Detected		01-041	
1D-130	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	332 sf	Good	None Detected		01-030	
1D-131	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	54 sf	Good	None Detected		01-041	
1D-131	1	2" Ceramic Floor Tile		2"	Light Gray	54 sf	Good			Non-Suspect	New
1D-131	1	4" Ceramic Wall Tile		4"	White	20 sf	Good			Non-Suspect	New
1D-132	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	120 sf	Good	None Detected		01-041	Carpet
1D-133	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	230 sf	Good	None Detected		01-041	Carpet
1D-134	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	54 sf	Good	None Detected		01-029	
1D-134	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	54 sf	Good	None Detected		01-040	
1D-134 Corridor North/South	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	689 sf	Good	None Detected		01-029	
1D-134 Corridor North/South	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	689 sf	Good	None Detected		01-040	
1D-135	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	135 sf	Good	None Detected		01-029	
1D-135	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	135 sf	Good	None Detected		01-040	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-136	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	103 sf	Good	None Detected		01-029	Carpet
1D-137	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	143 sf	Good	None Detected		01-029	
1D-137	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	143 sf	Good	None Detected		01-040	
1D-138	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	137 sf	Good	None Detected		01-029	
1D-138	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	137 sf	Good	None Detected		01-040	
1D-139	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	142 sf	Good	None Detected		01-029	
1D-139	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	142 sf	Good	None Detected		01-040	
1D-140	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	69 sf	Good	None Detected		01-024	CT-6
1D-140	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	69 sf	Good	None Detected		01-040	
1D-141	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	214 sf	Good	None Detected		01-024	CT-6
1D-141	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	214 sf	Good	None Detected		01-040	
1D-142	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	166 sf	Good	None Detected		01-029	
1D-142	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	166 sf	Good	None Detected		01-040	
1D-143	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	113 sf	Good	None Detected		01-024	CT-6
1D-143	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	113 sf	Good	None Detected		01-040	
1D-144	1	2" x 2" Ceiling Tile	CT-6		Vinyl covered Sheetrock Look	298 sf	Good	None Detected		01-024	CT-6
1D-144	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	298 sf	Good	None Detected		01-040	
1D-145	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	140 sf	Good	None Detected		01-029	
1D-145	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	140 sf	Good	None Detected		01-040	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-146	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	120 sf	Good	None Detected		01-029	
1D-146	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	120 sf	Good	None Detected		01-040	
1D-147	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	165 sf	Good	None Detected		01-029	
1D-147	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	165 sf	Good	None Detected		01-040	
1D-148	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	123 sf	Good	None Detected		01-029	
1D-148	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	123 sf	Good	None Detected		01-040	
1D-149	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	160 sf	Good	None Detected		01-029	
1D-149	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	160 sf	Good	None Detected		01-040	
1D-150	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	124 sf	Good	None Detected		01-029	
1D-150	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	124 sf	Good	None Detected		01-040	
1D-151	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	160 sf	Good	None Detected		01-029	
1D-151	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	160 sf	Good	None Detected		01-040	
1D-152	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	150 sf	Good	None Detected		01-029	
1D-152	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	150 sf	Good	None Detected		01-040	
1D-52 North/South Corridor	1	2' x 2' Ceiling Tile	CT-8	2'x2'	Small Random Fissures w/Pinholes	725 sf	Good	None Detected		01-029	
1D-52 North/South Corridor	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	725 sf	Good	None Detected		01-040	
1D-153	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	259 sf	Good	None Detected		01-041	
1D-153	1	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	259 sf	Good	None Detected		01-006	
1D-154	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	153 sf	Good	None Detected		01-041	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1D-154	1	Sheet Vinyl Floor			Lt. Gray w/Dk Gray and White	153 sf	Good	None Detected		01-040	
1D-155	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	153 sf	Good	None Detected		01-041	Carpet
1D-156	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	195 sf	Good	None Detected		01-041	Carpet
1D-157	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	123 sf	Good	None Detected		01-041	Carpet
1D-158	1	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	42 sf	Good	None Detected		01-030	No Ceiling
1D-159	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	335 sf	Good	None Detected		01-043	Carpet
1D-160	1	2' x 4' Ceiling Tile	CT-9	2'x4'	Small Random Fissures w/Pinholes	295 sf	Good	None Detected		01-041	Carpet
1D-160 Corridor West East	1	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	225 sf	Good	None Detected		01-043	
1D-160 Corridor West East	1	Sheet Vinyl Floor			Dark Gray/Rust/White Mosaic	225 sf	Good	None Detected		01-039	
2C-78	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	216 sf	Good	None Detected		01-010	CT-4
2C-78	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	216 sf	Good	None Detected		01-042	
2C-78	2	Thermal System Insulation	Preformed		Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2C-78A	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	41 sf	Good	None Detected		01-010	CT-4
2C-78A	2	Ceramic Floor Tile			1" Brown	41 sf	Good			Non-Suspect	New
2C-78A	2	Ceramic Wall Tile			4" Cream	100 sf	Good			Non-Suspect	New
2C-78 Corridor	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	525 sf	Good	None Detected		01-010	CT-4
2C-78 Corridor	2	Vinyl Plank Flooring			Lt. Brown Wood Look	525 sf	Good	None Detected		01-007	
2C-78 Corridor	2	Thermal System Insulation			Gray	16 lf	POOR	Assumed	Friable	Assumed	Next to Stairwell Entry Above Ceiling

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-77	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	20 sf	Good	None Detected		01-010	CT-4
2C-77	2	Ceramic Floor Tile			1" Brown	20 sf	Good			Non-Suspect	New
2C-77	2	Ceramic Wall Tile			4" Cream	50 sf	Good			Non-Suspect	New
2C-79	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	216 sf	Good	None Detected		01-010	CT-4
2C-79	2	Thermal System Insulation			Gray	32 lf	Good	Assumed	Friable	Assumed	In Chase
2C-79A	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	41 sf	Good	None Detected		01-008	CT-2
2C-76	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	97 sf	Good	None Detected		01-008	CT-2
2C-76	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	97 sf	Good	None Detected		01-042	
2C-76	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2C-75	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	125 sf	Good	None Detected		01-008	CT-2
2C-75	2	Ceramic Floor Tile			1" Brown	125 sf	Good			Non-Suspect	New
2C-75	2	Ceramic Wall Tile			4" Cream	100 sf	Good			Non-Suspect	New
2C-74	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	257 sf	Good	None Detected		01-010	CT-4
2C-74	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	257 sf	Good	None Detected		01-042	
2C-74	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	
2C-74A	2	Ceramic Floor Tile			1" Brown	39 sf	Good			Non-Suspect	New
2C-74A	2	Ceramic Wall Tile			4" Cream	39 sf	Good			Non-Suspect	New
2C-73	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	31 sf	Good	None Detected		01-010	CT-4

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-73	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	31 sf	Good	None Detected		01-042	
2C-72	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	100 sf	Good	None Detected		01-010	CT-4
2C-72	2	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	100 sf	Good	None Detected		01-030	
2C-71	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	216 sf	Good	None Detected		01-010	Carpet
2C-71	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2C-71A	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	45 sf	Good	None Detected		01-010	Carpet
2C-70	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	105 sf	Good	None Detected		01-010	Carpet
2C-70	2	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	105 sf	Good	None Detected		01-030	
2C-80	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	60 sf	Good	None Detected		01-010	CT-4
2C-80	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	60 sf	Good	None Detected		01-042	
2C-82	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	217 sf	Good	None Detected		01-010	CT-4
2C-82	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	217 sf	Good	None Detected		01-042	
2C-82	2	Thermal System Insulation			Gray	32 lf	Good	Assumed	Friable	Assumed	In Chase
2C-82A	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	37 sf	Good	None Detected		01-008	CT-2
2C-82A	2	Ceramic Floor Tile			1" Brown	37 sf	Good			Non-Suspect	New
2C-82A	2	Ceramic Wall Tile			4" Cream	37 sf	Good			Non-Suspect	New
2C-83	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	226 sf	Good	None Detected		01-010	CT-4
2C-83	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	226 sf	Good	None Detected		01-042	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-83	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2C-84	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	219 sf	Good	None Detected		01-010	CT-4
2C-84	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	219 sf	Good	None Detected		01-042	
2C-85	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	219 sf	Good	None Detected		01-010	CT-4
2C-85	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	219 sf	Good	None Detected		01-042	
2C-85	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2C-86	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	220 sf	Good	None Detected		01-010	CT-4
2C-86	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	220 sf	Good	None Detected		01-042	
2C-86A	2	Ceramic Floor Tile			1" Brown	37 sf	Good			Non-Suspect	New
2C-86A	2	Ceramic Wall Tile			4" Cream	37 sf	Good			Non-Suspect	New
2C-87	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	220 sf	Good	None Detected		01-010	CT-4
2C-87	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	220 sf	Good	None Detected		01-042	Under Carpet
2C-87	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2C-87A	2	Ceramic Floor Tile			1" Brown	37 sf	Good			Non-Suspect	New
2C-87A	2	Ceramic Wall Tile			4" Cream	37 sf	Good			Non-Suspect	New
2C-87A	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	37 sf	Good	None Detected		01-008	CT-2
2C-88	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	140 sf	Good	None Detected		01-010	CT-4
2C-88	2	Vinyl Plank Flooring			Lt. Brown Wood Look	140 sf	Good	None Detected		01-007	Under Carpet

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-89	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	140 sf	Good	None Detected		01-010	CT-4
2C-89	2	Vinyl Plank Flooring			Lt. Brown Wood Look	140 sf	Good	None Detected		01-007	Under Carpet
2C-90	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	109 sf	Good	None Detected		01-010	CT-4
2C-90	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	109 sf	Good	None Detected		01-042	
2C-90A	2	No Access									
2C-91	2	No Suspect Material									
2C-93	2	No Suspect Material									
2E-07	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	100 sf	Good	None Detected		01-008	Carpet
2E-07	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2E-08	2	Ceramic Floor Tile			2" Gray	42 sf	Good			Non-Suspect	New
2E-08	2	Ceramic Wall Tile			4" Cream	80 sf	Good			Non-Suspect	New
2E-08	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	42 sdf	Good	None Detected		01-008	Carpet
2E-10	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	294 sf	Good	None Detected		01-010	CT-4
2E-10	2	Vinyl Plank Flooring			Lt. Brown Wood Look	294 sf	Good	None Detected		01-007	Under Carpet
2E-10	2	Thermal System Insulation			Gray	32 lf	Good	Assumed	Friable	Assumed	In Chase
2E-11	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	209 sf	Good	None Detected		01-010	CT-4
2E-11	2	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	209 sf	Good	None Detected		01-030	
2E-11	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2E-12	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	273 sf	Good	None Detected		01-008	Carpet

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2E-12	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2E-13	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	125 sf	Good	None Detected		01-010	Carpet
2E-13	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2E-13A	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	127 sf	Good	None Detected		01-008	Carpet
2E-13A	2	Vinyl Plank Flooring			Lt. Brown Wood Look	127 sf	Good	None Detected		01-007	Under Carpet
2E-14	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	112 sf	Good	None Detected		01-008	Carpet
2E-15	2	No Suspect Material									
2E-16	2	No Suspect Material									
2E-20	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	158 sf	Good	None Detected		01-010	Carpet
2E-25	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	2,200 sf	Good	None Detected		01-010	Carpet
2E-25	2	Sheet Vinyl Floor			Brown Mosaic		Good	None Detected		01-044	
2E-25	2	Thermal System Insulation			Gray	60 lf	Good	Assumed	Friable	Assumed	In Chase
2E-26	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	205 sf	Good	None Detected		01-010	Carpet
2E-38	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	56 sf	Good	None Detected		01-010	Carpet
2E-38	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase/Soffitt
2E-38A	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	191 sf	Good	None Detected		01-010	Carpet
2E-40	2	Ceramic Floor Tile		6"	Red	1,080 sf	Good			Non-Suspect	
2E-40	2	Ceramic Wall Tile		4"	White	1080 sf	Good			Non-Suspect	
2E-40	2	2" x 2" Ceiling Tile	CT-6	2' x 2'	Vinyl Covered Sheetrock Look	1,080 sf	Good	None Detected		01-024	CT-6

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2E-40	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2E-40	2	Transite Panels/Pucks			Black	10 sf	Good	Assumed	Friable	Assumed	Register Cabinet
2E-41	2	1' x 1' Ceiling Tile		1' x 1'	White/Spline	178 sf	Good	None Detected		01-046	
2E-41	2	12" X 12" Floortile and Mastic	FT-13	12' x 12"	Cream w/Gold	178 sf	POOR	5% Chrysotile (FT)/10% Chrysotile (Mastic)	Non-Friable	01-045	
2E-42	2	2" x 2" Ceiling Tile	CT-6	2' x 2'	Vinyl Covered Sheetrock Look	397 sf	Good	None Detected		01-024	CT-6
2E-42	2	Thermal System Insulation			Gray	35 lf	Good	Assumed	Friable	Assumed	Above Ceiling/In Chase/Soffitt
2E-42	2	Transite Panels/Pucks			Black	20 lf	Good	Assumed	Friable	Assumed	Register Cabinet (2)
2E-42	2	Ceramic Wall Tile		4"	White	300 sf	Good			Non-Suspect	
2E-43	2	2' x 4' Ceiling Tile	CT-12	2'x4'	Deep Random Fissure	115 sf	Good	None Detected		01-047	
2E-43	2	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	115 sf	Good	None Detected		01-030	
2E-43	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2E-44	2	2' x 4' Ceiling Tile	CT-12	2'x4'	Deep Random Fissure	115 sf	Good	None Detected		01-047	
2E-44	2	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	115 sf	Good	None Detected		01-030	
2E-44	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2E-45	2	2' x 4' Ceiling Tile	CT-12	2'x4'	Deep Random Fissure	115 sf	Good	None Detected		01-047	
2E-45	2	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	115 sf	Good	None Detected		01-030	
2E-45	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2E-46	2	2" x 2" Ceiling Tile	CT-6	2' x 2'	Vinyl Covered Sheetrock Look	115 sf	Good	None Detected		01-024	CT-6

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2E-46	2	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	115 sf	Good	None Detected		01-030	
2E-46	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2E-46		Transite Panels/Pucks			Black	10 sf	Good	Assumed	Friable	Assumed	Register Cabinet
Stairwell #1	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Wall
Stairwell #1	2	Transite Panels/Pucks			Black	10 sf	Good	Assumed	Friable	Assumed	Register Cabinet
2E-47	2	Refridgerator									
2E-48	2	Feezer									
2E-49	2	2" x 2" Ceiling Tile	CT-6	2' x 2'	Vinyl Covered Sheetrock Look	1,522 sf	Good	None Detected		01-024	CT-6
2E-49	2	Ceramic Floor Tile		6"	Red	1,522 sf	Good			Non-Suspect	New
2E-49	2	Ceramic Wall Tile		4"	White	1200 sf	Good			Non-Suspect	New
2E-50	2	2" x 2" Ceiling Tile	CT-6	2' x 2'	Vinyl Covered Sheetrock Look	1,522 sf	Good	None Detected		01-024	CT-6
2E-50	2	Ceramic Floor Tile		6"	Red	1,522 sf	Good			Non-Suspect	New
2E-50	2	Ceramic Wall Tile		4"	White	1200 sf	Good			Non-Suspect	New
2E-50	2	Thermal System Insulation			Gray	50 lf	Good	Assumed	Friable	Assumed	Above Ceiling/In Chase/Soffitt
2E-51	2	Refridgerator									
2E-52	2	2' x 4' Ceiling Tile	CT-12	2'x4'	Deep Random Fissure	50 sf	Good	None Detected		01-047	
2E-53	2	Ceramic Floor Tile		6"	Red	177 sf	Good			Non-Suspect	
2E-53	2	Thermal System Insulation			Gray	30 lf	Good	Assumed	Friable	Assumed	Above Ceiling/In Chase/Soffitt
2E-53	2	Transite Panels/Pucks			Black	10 sf	Good	Assumed	Friable	Assumed	Register Cabinet

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-10	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	459 sf	Good	None Detected		01-010	
2D-10	2	Vinyl Plank Flooring			Lt. Brown Wood Look	459 sf	Good	None Detected		01-007	
2D-11	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	124 sf	Good	None Detected		01-010	
2D-11	2	18" x 18" Floor Tile		18"x18"	Red	124 sf	Good			Non-Suspect	New
2D-11A	2	Ceramic Floor Tile			1" Brown	37 sf	Good			Non-Suspect	New
2D-11A	2	Ceramic Wall Tile			4" Cream	37 sf	Good			Non-Suspect	New
2D-13	2	Need Access									
2D-14	2	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	217 sf	Good	None Detected		01-010	
2D-14	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	217 sf	Good	None Detected		01-042	
2D-14	2	Thermal System Insulation			Gray	32 lf	Good	Assumed	Friable	Assumed	In Chase
2D-14A	2	Ceramic Floor Tile			1" Brown	41 sf	Good			Non-Suspect	New
2D-14A	2	Ceramic Wall Tile			4" Cream	41 sf	Good			Non-Suspect	New
2D-15	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	213 sf	Good	None Detected		01-008	
2D-15	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	213 sf	Good	None Detected		01-042	
2D-15	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2D-15A	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	40 sf	Good	None Detected		01-008	
2D-15A	2	Ceramic Floor Tile			1" Brown	40 sf	Good			Non-Suspect	New
2D-15A	2	Ceramic Wall Tile			4" Cream	40 sf	Good			Non-Suspect	New
2D-16	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	226 sf	Good	None Detected		01-008	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-16	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	226 sf	Good	None Detected		01-042	
2D-16	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2D-17	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	216 sf	Good	None Detected		01-008	
2D-17	2	12" X 12" Floortile and Mastic	FT-12	12"x12"	White w/Gray and Black Streaks	216 sf	Good	None Detected		01-042	
2D-17	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2D-18	2	2' x 2' Ceiling Tile	CT-1	2'x2'	Random Fissures w/Pinholes (Drop-in)	133 sf	Good	None Detected		01-002	
2D-18	2	Sheet Vinyl Floor			Cream/Tan/Brown	133 sf	Good	None Detected		01-048	
2D-19	2	2" x 2" Ceiling Tile	CT-6	2' x 2'	Vinyl Covered Sheetrock Look	78 sf	Good	None Detected		01-024	CT-6
2D-19	2	Sheet Vinyl Floor			Cream/Tan/Brown	78 sf	Good	None Detected		01-048	
2D-20	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	100 sf	Good	None Detected		01-043	
2D-20	2	Sheet Vinyl Floor			Brown/Gray Mosaic	100 sf	Good	None Detected		01-044	
2D-21	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	120 sf	Good			Non-Suspect	New
2D-21	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	200 sf	Good			Non-Suspect	New
2D-22	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-22	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-22A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-22A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-22 Corridor	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	1,150 sf	Good	None Detected		01-043	
2D-22 Corridor	2	Sheet Vinyl Floor			Brown/Gray Mosaic	1,150 sf	Good	None Detected		01-044	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-23	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-23	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-23A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-23A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-24	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-24	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-24A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-24A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-25	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	135 sf	Good	None Detected		01-043	
2D-25	2	Sheet Vinyl Floor			Brown/Gray Mosaic	135 sf	Good	None Detected		01-044	
2D-25A	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-25A	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	
2D-26	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-26	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-26A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-26A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-28	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-28	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-28A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-28A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-28 Corridor	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	985 sf	Good	None Detected		01-043	
2D-28 Corridor	2	Sheet Vinyl Floor			Brown/Gray Mosaic	985 sf	Good	None Detected		01-044	
2D-30	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-30	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-30A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-30A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-31	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-31	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-31A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-31A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-33	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-33	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	
2D-34	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-34	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-34A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-34A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-36	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-36	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-36A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-36A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-37	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-37	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-37A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-37A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-39	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-39	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-39A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-39A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-40	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-40	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-40A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-40A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-41	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	40 sf	Good	None Detected		01-043	
2D-41	2	Sheet Vinyl Floor			Brown/Gray Mosaic	40 sf	Good	None Detected		01-044	
2D-42	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	180 sf	Good	None Detected		01-043	
2D-42	2	Sheet Vinyl Floor			Brown/Gray Mosaic	180 sf	Good	None Detected		01-044	
2D-42A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-42A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-43	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	40 sf	Good	None Detected		01-043	
2D-43	2	Sheet Vinyl Floor			Brown/Gray Mosaic	40 sf	Good	None Detected		01-044	
2D-44	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-44	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-44A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-44A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-44 Corridor	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	1,150 sf	Good	None Detected		01-043	
2D-44 Corridor	2	Sheet Vinyl Floor			Brown/Gray Mosaic	1,150 sf	Good	None Detected		01-044	
2D-45	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-45	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-45A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-45A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-46	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-46	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-46A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-46A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-48	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	65 sf	Good	None Detected		01-043	
2D-48	2	Sheet Vinyl Floor			Brown/Gray Mosaic	65 sf	Good	None Detected		01-044	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-49	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-49	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-49A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-49A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-50	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	65 sf	Good	None Detected		01-043	
2D-50	2	Sheet Vinyl Floor			Brown/Gray Mosaic	65 sf	Good	None Detected		01-044	
2D-52	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	Carpet
2D-55	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	135 sf	Good	None Detected		01-043	
2D-55	2	Sheet Vinyl Floor			Brown/Gray Mosaic	135 sf	Good	None Detected		01-044	
2D-55A	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-25A	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	
2D-55B	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-55B	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	
2D-56	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-56	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-56A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-56A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-57	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-57	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-59	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-59	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-59A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-59A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-60	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-60	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-60A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-60A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-61	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-61	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	
2D-62	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-62	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-62A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-62A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-64	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	200 sf	Good	None Detected		01-043	
2D-64	2	Sheet Vinyl Floor			Brown/Gray Mosaic	200 sf	Good	None Detected		01-044	
2D-66	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-66	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-66A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-66A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-67	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-67	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	
2D-69	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-69	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	
2D-71	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-71	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-71A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-71A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-72	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-72	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-72A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-72A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-73	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-73	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-73A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-73A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-74	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-74	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-74A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-74A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-77	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	40 sf	Good	None Detected		01-043	
2D-77	2	Sheet Vinyl Floor			Brown/Gray Mosaic	40 sf	Good	None Detected		01-044	
2D-78	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-78	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-78A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-78A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-79	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-79	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-79A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-79A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-80	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-80	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-80A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-80A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-80 Corridor	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	985 sf	Good	None Detected		01-043	
2D-80 Corridor	2	Sheet Vinyl Floor			Brown/Gray Mosaic	985 sf	Good	None Detected		01-044	
2D-82	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-82	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-82A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-82A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-84	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	65 sf	Good	None Detected		01-043	
2D-84	2	Sheet Vinyl Floor			Brown/Gray Mosaic	65 sf	Good	None Detected		01-044	
2D-85	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	135 sf	Good	None Detected		01-043	
2D-85	2	Sheet Vinyl Floor			Brown/Gray Mosaic	135 sf	Good	None Detected		01-044	
2D-85A	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-85A	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	
2D-86	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	65 sf	Good	None Detected		01-043	
2D-86	2	Sheet Vinyl Floor			Brown/Gray Mosaic	65 sf	Good	None Detected		01-044	
2D-88	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-88	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-88A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-88A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-89	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	120 sf	Good			Non-Suspect	New
2D-89	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	200 sf	Good			Non-Suspect	New
2D-90	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-90	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-90A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-90A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-91	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	600 sf	Good	None Detected		01-043	
2D-91	2	Sheet Vinyl Floor			Brown/Gray Mosaic	600 sf	Good	None Detected		01-044	
2D-95	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-95	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-95A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-95A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-96	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	40 sf	Good	None Detected		01-043	
2D-96	2	Sheet Vinyl Floor			Brown/Gray Mosaic	40 sf	Good	None Detected		01-044	
2D-98	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-98	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-98A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-98A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-99	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-99	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-99A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-99A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-100	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-100	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-100A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-100A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-101	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-101	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-101A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-101A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-102	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-102	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-102A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-102A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-103	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	160 sf	Good	None Detected		01-043	
2D-103	2	Sheet Vinyl Floor			Brown/Gray Mosaic	160 sf	Good	None Detected		01-044	
2D-103A	2	12" Ceramic Floor Tile		12"	Brown/Gray Mosaic	50 sf	Good			Non-Suspect	New
2D-103A	2	12" Ceramic Wall Tile		12"	Brown/Gray Mosaic	100 sf	Good			Non-Suspect	New
2D-105	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	2,600 sf	Good	None Detected		01-043	
2D-105	2	Sheet Vinyl Floor			Brown/Gray Mosaic	2,600 sf	Good	None Detected		01-044	
2D-105A	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-105A	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2D-105B	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-105B	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	
2D-110	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	1,650 sf	Good	None Detected		01-043	
2D-110	2	Sheet Vinyl Floor			Brown/Gray Mosaic	1,650 sf	Good	None Detected		01-044	
2D-110A	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-110A	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	
2D-110B	2	2' x 2' Ceiling Tile	CT-10	2'x2'	Random Fissures w/Pinholes (Drop in)	50 sf	Good	None Detected		01-043	
2D-110B	2	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	
3C-60	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	200 sf	Good	None Detected		01-0010	
3C-60	3	Sheet Vinyl Floor			Brown/Gray Mosaic	200 sf	Good	None Detected		01-044	
3C-65	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	1,600 sf	Good	None Detected		01-012	CT-5
3C-65	3	Sheet Vinyl Floor			Brown/Gray Mosaic	1,600 sf	Good	None Detected		01-044	
3C-65 Corridor	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	250 sf	Good	None Detected		01-012	CT-5
3C-65 Corridor	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	250 sf	Good	None Detected		01-030	
3C-65A	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	200 sf	Good	None Detected		01-012	CT-5
3C-65A	3	Sheet Vinyl Floor			Brown/Gray Mosaic	200 sf	Good	None Detected		01-044	
3C-71	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	120 sf	Good	None Detected		01-012	CT-5
3C-71	3	Sheet Vinyl Floor			Brown/Gray Mosaic	120 sf	Good	None Detected		01-044	
3C-73	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	80 sf	Good	None Detected		01-012	CT-5

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-73	3	Sheet Vinyl Floor			Brown/Gray Mosaic	80 sf	Good	None Detected		01-044	
3C-74	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	100 sf	Good	None Detected		01-012	CT-5
3C-74	3	Sheet Vinyl Floor			Brown/Gray Mosaic	100 sf	Good	None Detected		01-044	
3C-75	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	80 sf	Good	None Detected		01-012	CT-5
3C-75	3	Sheet Vinyl Floor			Brown/Gray Mosaic	80 sf	Good	None Detected		01-044	
3C-76	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	50 sf	Good	None Detected		01-012	CT-5
3C-76	3	Sheet Vinyl Floor			Brown/Gray Mosaic	50 sf	Good	None Detected		01-044	
3C-77	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	120 sf	Good	None Detected		01-0010	
3C-77	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	120 sf	Good	None Detected		01-030	
3C-79	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	150 sf	Good	None Detected		01-0010	
3C-79	3	Sheet Vinyl Floor			Gray	150 sf	Good				
3C-80	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	180 sf	Good	None Detected		01-0010	
3C-80	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	180 sf	Good	None Detected		01-030	
3C-80A	3	Ceramic Floor Tile		2"	Gray	50 sf	Good			Non-Suspect	
3C-80A	3	Ceramic Wall Tile		4"	White	50 sf	Good			Non-Suspect	
3C-88	3	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	90 sf	Good	None Detected		01-006	FT-1
3C-88A	3	Ceramic Floor Tile		2"	Gray	50 sf	Good			Non-Suspect	
3C-88A	3	Ceramic Wall Tile		4"	White	50 sf	Good			Non-Suspect	
3C-89	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	150 sf	Good	None Detected		01-030	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-89A	3	Ceramic Floor Tile		2"	Gray	50 sf	Good			Non-Suspect	
3C-89A	3	Ceramic Wall Tile		4"	White	50 sf	Good			Non-Suspect	
3C-90	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	300 sf	Good	None Detected		01-0010	
3C-90	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	300 sf	Good	None Detected		01-030	
3C-90B	3	Ceramic Floor Tile		2"	Gray	50 sf	Good			Non-Suspect	
3C-90B	3	Ceramic Wall Tile		4"	White	50 sf	Good			Non-Suspect	
3C-91	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	150 sf	Good	None Detected		01-0010	
3C-91	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	150 sf	Good	None Detected		01-030	
3C-91A	3	Ceramic Floor Tile		2"	Gray	50 sf	Good			Non-Suspect	
3C-91A	3	Ceramic Wall Tile		4"	White	50 sf	Good			Non-Suspect	
3C-93	3	No Suspect Material									
3C-96	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	80 sf	Good	None Detected		01-0010	
3C-96	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	80 sf	Good	None Detected		01-030	
3C-97	3	9" x 9" Floortile		9"x9"	White w/Red and Black	6 sf	Good	5% Chrysotile FT	Non-Friable	01-053	Electrical Closet
3C-98	3	9" x 9" Floortile		9"x9"	White w/Red and Black	6 sf	Good	5% Chrysotile FT	Non-Friable	01-053	Electrical Closet
3E-01	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	25 sf	Good	None Detected		01-012	CT-5
3E-01	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	25 sf	Good	None Detected		01-030	
3E-02	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	80 sf	Good	None Detected		01-012	CT-5
3E-02	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	80 sf	Good	None Detected		01-030	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3E-03	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	100 sf	Good	None Detected		01-0010	Carpet
3E-05	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	175 sf	Good	None Detected		01-0010	Carpet
3E-07	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	175 sf	Good	None Detected		01-0010	Carpet
3E-06	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	160 sf	Good	None Detected		01-012	CT-5
3E-06	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	160 sf	Good	None Detected		01-030	
3E-07	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	175 sf	Good	None Detected		01-0010	Carpet
3E-08	3	No Suspect Material									
Stair #21	3	9" x 9" Floortile		9"x9"	White w/Red and Black	16sf	Good	5% Chrysotile FT	Non-Friable	01-053	
3E-15	3	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	1,925 sf	Good	None Detected		01-009	CT-3
3E-15	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	1,925 sf	Good	None Detected		01-030	
3E-15	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
3E-15A	3	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	200 sf	Good	None Detected		01-009	CT-3
3E-15A	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	200 sf	Good	None Detected		01-030	
3E-15A		Transite Panel/Pucks			Black	60 lf	Good	Assumed	Friable	Assumed	(3) Register Cabinets
3E-15B	3	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	100 sf	Good	None Detected		01-009	CT-3
3E-15B	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	100 sf	Good	None Detected		01-030	
3E-24	3	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	50 sf	Good	None Detected		01-009	CT-3
3E-24	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	50 sf	Good	None Detected		01-030	

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3E-24 Corridor	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase/Above Ceiling
3E-25	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	560 sf	Good	None Detected		01-0010	Carpet
3E-25	3	Transite Panel/Pucks			Black	20 sf	Good	Assumed	Non-Friable	Assumed	(2) Register Cabinets
3E-30	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	310 sf	Good	None Detected		01-0010	Carpet
3E-32	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	310 sf	Good	None Detected		01-0010	Carpet
3E-35	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	300 sf	Good	None Detected		01-0010	Carpet
3E-35	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	300 sf	Good	None Detected		01-030	
3E-35	3	Transite Panel/Pucks			Black	20 sf	Good	Assumed	Non-Friable	Assumed	(2) Register Cabinets
3E-36	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3E-36	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	130 sf	Good	None Detected		01-0010	Carpet
3E-38	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3E-38	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	100 sf	Good	None Detected		01-0010	Carpet
3E-40	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	130 sf	Good	None Detected		01-0010	Carpet
3E-40	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3E-40	3	Thermal System Insulation			Gray	1 lf	Good	Assumed	Friable	Assumed	Stubs in Wall
3E-40 Corridor	3	Thermal System Insulation			Gray	10 lf	Good	Assumed	Friable	Assumed	In Wall Chase and Soffitts
3E-40 Corridor	3	Transite Panel/Pucks			Black	20 sf	Good	Assumed	Non-Friable	Assumed	(2) Register Cabinets
Stair #1	3	Thermal System Insulation			Gray	10 lf	Good	Assumed	Friable	Assumed	In Wall
Stair #1	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3D-10	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	260 sf	Good	None Detected		01-008	CT-2
3D-10	3	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	260 sf	Good	None Detected		01-006	Under Carpet
3D-12	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	110 sf	Good	None Detected		01-0010	
3D-12	3	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	110 sf	Good	None Detected		01-006	Under Carpet
3D-12 Corridor	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	700 sf	Good	None Detected		01-012	CT-5
3D-12 Corridor	3	12" X 12" Floortile and Mastic	FT-5	12"x12"	Cream w/White and Brown Streaks	700 sf	Good	None Detected		01-018	
3D-13	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	135 sf	Good	None Detected		01-008	CT-2
3D-13	3	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	260 sf	Good	None Detected		01-006	Under Carpet
3D-13	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
3D-14	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	135 sf	Good	None Detected		01-0010	
3D-14	3	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	135 sf	Good	None Detected		01-006	Under Carpet
3D-15	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	135 sf	Good	None Detected		01-008	CT-2
3D-16	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	135 sf	Good	None Detected		01-0010	
3D-16	3	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	135 sf	Good	None Detected		01-006	Under Carpet
3D-17	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	135 sf	Good	None Detected		01-0010	
3D-17	3	12" X 12" Floortile and Mastic	FT-1	12"x12"	White w/Black Specks	135 sf	Good	None Detected		01-006	Under Carpet
3D-19	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	100 sf	Good	None Detected		01-0010	Carpet
3D-20	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	180 sf	Good	None Detected		01-008	CT-2

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3D-21	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	135 sf	Good	None Detected		01-008	CT-2
3D-22	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	110 sf	Good	None Detected		01-008	CT-2
3D-23	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	217 sf	Good	None Detected		01-008	CT-2
3D-24	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	215 sf	Good	None Detected		01-0010	Carpet
3D-28	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	25 sf	Good	None Detected		01-008	CT-2
3D-28	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	25 sf	Good	None Detected		01-030	
3D-30	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	25 sf	Good	None Detected		01-008	CT-2
3D-30	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	25 sf	Good	None Detected		01-030	
3D-34	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	100 sf	Good	None Detected		01-0010	Carpet
3D-35	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	130 sf	Good	None Detected		01-0010	Carpet
3D-36	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	100 sf	Good	None Detected		01-0010	Carpet
3D-37	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	130 sf	Good	None Detected		01-0010	Carpet
3D-38	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	100 sf	Good	None Detected		01-0010	Carpet
3D-40	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	240 sf	Good	None Detected		01-008	Carpet
3D-41	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	30 sf	Good	None Detected		01-008	CT-2
3D-41	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	30 sf	Good	None Detected		01-030	
3D-43	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	50 sf	Good	None Detected		01-008	CT-2
3D-43	3	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	50 sf	Good	None Detected		01-030	
3D-44	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	50 sf	Good	None Detected		01-008	CT-2

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3D-44 Corridor	3	2" x 2" Ceiling Tile	CT-5	2'x2'	Random Fissures w/Pinholes	900 sf	Good	None Detected		01-012	CT-5
3D-44 Corridor	3	12" X 12" Floortile and Mastic	FT-5	12"x12"	Cream w/White and Brown Streaks	900 sf	Good	None Detected		01-018	
3D-45	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	130 sf	Good	None Detected		01-0010	Carpet
3D-46	3	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	200 sf	Good	None Detected		01-0010	Carpet
3D-47	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	220 sf	Good	None Detected		01-008	CT-2
3D-48	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	500 sf	Good	None Detected		01-008	CT-2
3D-49	3	2' x 4' Ceiling Tile	CT-2	2'x4'	Random Fissures w/Pinholes	500 sf	Good	None Detected		01-008	CT-2
4D-05	4	No Suspect Material									
4D-06	4	No Suspect Material									
4D-06 Corridor	4	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	500 sf	Good	None Detected		01-0010	
4D-06 Corridor	4	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	500 sf	Good	None Detected		01-030	
Corridor Outside Elevator #4	4	Spray On Texture			White	120 sf	Good	None Detected		01-051A-C	
Stair #3	4	12" X 12" Floortile and Mastic	FT-14	12"x12"	Tan/Brown/White	50 sf	Good	8% Chrysotile (Mastic)	Non-Friable	01-050	
Independence Elevator Corridor	4	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	500 sf	Good	None Detected		01-0010	
Independence Elevator Corridor	4	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	500 sf	Good	None Detected		01-030	
4D-07	4	No Suspect Material									
4D-07A	4	No Suspect Material									
4D-08	4	No Suspect Material									

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1

Room Number	Level	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4E-09	4	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	5 sf	Good	None Detected		01-0010	
4E-10	4	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	2,200 sf	Good	None Detected		01-009	Carpet
4E-10	4	Thermal System Insulation			Gray	16 lf		Assumed	Friable	Assumed	In Chase
4E-14	4	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	120 sf	Good	None Detected		01-0010	Carpet
4E-15	4	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	360 sf	Good	None Detected		01-0010	Carpet
4E-15A	4	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	110 sf	Good	None Detected		01-009	Carpet
4E-16	4	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	120 sf	Good	None Detected		01-009	Carpet
4E-17	4	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	350 sf	Good	None Detected		01-009	Carpet
4E-18	4	2' x 4' Ceiling Tile	CT-3	2'x4'	Widthwisw Fissures w/Pinholes	100 sf	Good	None Detected		01-009	Carpet
4E-19	4	Transite Panel/Pucks			Black	50 lf	Good	Assumed	Non-Friable	Assumed	(5) Register Cabinets
4E-19E	4	No Suspect Material									
4E-20	4	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	100 sf	Good	None Detected		01-0010	Carpet
4E-20	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4E-21	4	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	50 sf	Good	None Detected		01-0010	
4E-21	4	12" X 12" Floortile and Mastic	FT-7	12"x12"	Tan w/Brown/Gray/White Specks	50 sf	Good	None Detected		01-030	
4E-22	4	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	100 sf	Good	None Detected		01-0010	Carpet
4E-22	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4E-23	4	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	100 sf	Good	None Detected		01-0010	Carpet
4E-24	4	2' x 2' Ceiling Tile	CT-4	2'x2'	Long Fissures w/Pinholes	100 sf	Good	None Detected		01-0010	Carpet

4.2 – Additional Observations

The main North/South and East/West corridors may have 2 layers of floortile.

4.3 – Cost Estimate for Asbestos Abatement

Material	Sample Reference	Location	Low End Price Per sq/ln ft	High End Price per ln/sq ft	Total Square/Linear Feet of ACM	Low End Removal Cost	High End Removal Cost
Wall Mastic	01-004		\$7.00	\$9.00	100	\$700.00	\$900.00
12"x12" Floor Tile and Mastic	01-014		\$7.00	\$9.00	1550	\$10,850.00	\$13,950.00
12"x12" Floor Tile and Mastic	01-019	BE-44, Stairwell #3, BD-05,	\$7.00	\$9.00	652	\$4,564.00	\$5,868.00
1'x1' Ceiling Tile/Pucks	01-028	BC-64 Corridor	\$12.00	\$19.00	16	\$192.00	\$304.00
12"x12" Floor Tile and Mastic	01-033		\$7.00	\$9.00	113	\$791.00	\$1,017.00
12"x12" Floor Tile and Mastic	01-045	2E-41	\$7.00	\$9.00	178	\$1,246.00	\$1,602.00
12"x12" Floor Tile and Mastic	01-050	Stairwell #3	\$7.00	\$9.00	50	\$350.00	\$450.00
9"x9" Floor Tile and Mastic	01-053	BB-01;BD-05;BD-08;3C-97;3C-98;Stairwell #21	\$7.00	\$9.00	404	\$2,828.00	\$3,636.00
Building Seam Caulk	01-054	BE-45 North Loading Dock	\$7.00	\$9.00	120	\$840.00	\$1,080.00
Thermal System Insulation	Assumed	Throughout	\$12.00	\$19.00	1148	\$13,776.00	\$21,812.00
Transite Panels/Pucks	Assumed	Refer to Table 2	\$12.00	\$19.00	290	\$3,480.00	\$5,510.00

5.0 – RECOMMENDATIONS

5.1 – Recommendations for Regulated ACM (RACM)

Thermal System Insulation (TSI):

If present, these materials must be removed prior to any activity that would release asbestos fibers from this material. Specifically, any renovation or demolition activity that will crush, abrade, or dissolve the matrix of this material must be performed by a North Dakota licensed Asbestos Contractor. If these materials are in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

5.2 – Recommendations for Category I Non-Friable ACM (C1NF)

Floor Tile and Floor Tile Matic:

If present, these materials identified as Category I Non-Friable ACM are required to be removed by a North Dakota licensed asbestos contractor if proposed renovations or demolition will impact these materials in such a manner as to render them friable and thus RACM. Specifically, any renovation or demolition activity that will crush, abrade, or dissolve the matrix of these materials then they must first be removed by a North Dakota-licensed Asbestos Contractor. If these materials are in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

5.3 – Recommendations for Category II Non-Friable ACM (C2NF)

Transite™ Panels and Transite™ Panel Pucks; Building Seam Caulk:

If present, these materials identified as Category II Non-friable ACM must be removed prior to any renovation or demolition activity that will crush, abrade, or dissolve the matrix of this material. The removal of this material must be performed by a North Dakota licensed Asbestos Contractor. If this material is in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

5.4 – General Recommendations

Based on the asbestos survey and sampling results, TRINE has the following recommendations:

- Each type of asbestos that will need to be removed as part of any renovation or demolition project in North Dakota are required to be removed, handled, and disposed of as ACM waste by a licensed North Dakota asbestos abatement contractor regardless if the material is a RACM, C1NF, or C2NF in accordance with the North Dakota Department of Environmental Quality (DEQ).
- The VA employ an independent industrial hygienist (VPIH/CPIH) consultant and/or use its own IH to perform various services of the VA. The VPIH/CPIH will perform the necessary monitoring, inspection, testing, and other support services to ensure that VA patients, employees, and visitors will not be adversely affected by the abatement work in accordance with ***Veterans Administration (VA), Section 02 82 11, Traditional Asbestos Abatement***
- TRINE recommends final air testing in addition to final visual inspection of abatement areas prior to deregulation of contained work areas.
- Suspect materials discovered after this inspection should be sampled and analyzed to determine asbestos content and to initiate appropriate responses.

North Dakota DEQ and the US Environmental Protection Agency require notification of intent to renovate or demolish when asbestos is present. Notification must be sent at least 10 working days prior to the start of any construction activities. The general contractor should also keep a copy of this survey at the construction site during the entire construction project as proof of compliance with 40 CFR 61 (NESHAP).

Submitted by:

6.0 – SIGNATURE PAGE



John R Rogers
President
Asbestos Building Inspector (NY) 16-11678



Dan Johnson
Asbestos Building Inspector (ND) 6804

APPENDIX A – LABORATORY CERTIFICATE OF ANALYSIS

NOTE: Results for the above referenced samples are located on the following pages.

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1



EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427
Tel/Fax: (763) 449-4922 / (763) 449-4924
<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352202990

Customer ID: TREV42

Customer PO:

Project ID:

Attention: John Rogers
Trine Environmental
6678 Morningdale Drive
Brighton, MI 48116

Phone: (810) 986-0536

Fax:

Received Date: 04/01/2022 12:15 PM

Analysis Date: 04/07/2022 - 04/08/2022

Collected Date:

Project: Fargo VA- 2022

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
01-001 352202990-0001	Hallway Outside Canteen - Sheetrock/Tape/Com pound	Tan/White Fibrous Heterogeneous	10% Cellulose	90% Non-fibrous (Other)	None Detected
This is a composite result of sheetrock, tape, and joint compound					
01-002 352202990-0002	Hallway Outside Canteen - 2' x 2' Ceiling Tile Random Fissures/Pinholes (Drop in)	Gray Fibrous Homogeneous	50% Cellulose 35% Min. Wool	10% Perlite 5% Non-fibrous (Other)	None Detected
01-003 352202990-0003	Hallway Outside Canteen - Vinyl Plank Flooring Dark Wood Look	Brown/Gray Non-Fibrous Homogeneous	5% Glass	95% Non-fibrous (Other)	None Detected
01-004 352202990-0004	BC-77 Elevator Mech Room - Wall Mastic Black	Black Non-Fibrous Homogeneous		92% Non-fibrous (Other)	8% Chrysotile
01-005A 352202990-0005	B-77/BC-79/BC-85B - Spray On Fireproofing Lt. Green	Green Fibrous Homogeneous	20% Cellulose	80% Non-fibrous (Other)	None Detected
01-005B 352202990-0006	B-77/BC-79/BC-85B - Spray On Fireproofing Lt. Green	Green Fibrous Homogeneous	20% Cellulose	80% Non-fibrous (Other)	None Detected
01-005C 352202990-0007	B-77/BC-79/BC-85B - Spray On Fireproofing Lt. Green	Green Fibrous Homogeneous	20% Cellulose	80% Non-fibrous (Other)	None Detected
01-006-Floor Tile 352202990-0008	East Entry By Stairwell #7 - 12" x 12" Floor tile and Mastic White w/Black Speck	Tan/White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-006-Adhesive 352202990-0008A	East Entry By Stairwell #7 - 12" x 12" Floor tile and Mastic White w/Black Speck	Yellow Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-007-Vinyl Flooring 352202990-0009	BC-80 Retail Store - Vinyl Plank Flooring Lt. Brown Wood Look	Brown/Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-007-Adhesive 352202990-0009A	BC-80 Retail Store - Vinyl Plank Flooring Lt. Brown Wood Look	Yellow Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-008 352202990-0010	BC-82 Corridor - 2' x 4' Ceiling Tile Random Fissure/Pinholes	Gray Fibrous Homogeneous	50% Cellulose 35% Min. Wool	10% Perlite 5% Non-fibrous (Other)	None Detected
01-009 352202990-0011	BC-83 - 2' x 4' Ceiling Tile Widthwise Fissures w/Pinholes	Gray Fibrous Homogeneous	80% Cellulose	15% Perlite 5% Non-fibrous (Other)	None Detected

Initial report from: 04/08/2022 15:00:25

ASB_PLM_0008_0001 - 1.78 Printed: 4/8/2022 2:00 PM

Page 1 of 7



EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427

Tel/Fax: (763) 449-4922 / (763) 449-4924

<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352202990

Customer ID: TREV42

Customer PO:

Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
01-010 352202990-0012	BC-69 Vending - 2' x 2' Ceiling Tile Long Fissures w/Pinholes	Gray Fibrous Homogeneous	70% Cellulose 15% Min. Wool	10% Perlite 5% Non-fibrous (Other)	None Detected
01-011-Ceramic Tile 352202990-0013	BC-69 Vending - 1' x 1' Ceramic FloorTile Tan/Gray	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-011-Grout 352202990-0013A	BC-69 Vending - 1' x 1' Ceramic FloorTile Tan/Gray	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-012 352202990-0014	BC-91 - 2' x 2' Ceiling Tile Random Fissures w/Pinholes	Gray Fibrous Homogeneous	80% Cellulose	15% Perlite 5% Non-fibrous (Other)	None Detected
01-013-Floor Tile 352202990-0015	BC-94 - 12" x 12" Floor tile Gray w/Brown Streaks	Gray/Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-013-Adhesive 352202990-0015A	BC-94 - 12" x 12" Floor tile Gray w/Brown Streaks	Yellow Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-013-Filler 352202990-0015B	BC-94 - 12" x 12" Floor tile Gray w/Brown Streaks	Gray Non-Fibrous Homogeneous	10% Cellulose	90% Non-fibrous (Other)	None Detected
01-014-Floor Tile 352202990-0016	Basement Main North/South Corridor - 12" x 12" Floor tile Gray w/Brown Streaks	Tan Non-Fibrous Homogeneous		96% Non-fibrous (Other)	4% Chrysotile
01-014-Mastic 352202990-0016A	Basement Main North/South Corridor - 12" x 12" Floor tile Gray w/Brown Streaks	Brown/Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-015A 352202990-0017	BE-05 Mech Room - Spray On Fireproofing White Fluffy	Tan Fibrous Homogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
01-015B 352202990-0018	BE-05 Mech Room - Spray On Fireproofing White Fluffy	Tan Fibrous Homogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
01-015C 352202990-0019	BE-05 Mech Room - Spray On Fireproofing White Fluffy	Tan Fibrous Homogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
01-016-Floor Tile 352202990-0020	Corridor Outside Independence Elevators - 12" x 12" Floortile Cream w/Brown and White Streaks	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-016-Mastic 352202990-0020A	Corridor Outside Independence Elevators - 12" x 12" Floortile Cream w/Brown and White Streaks	Black Non-Fibrous Homogeneous	5% Cellulose 5% Synthetic	90% Non-fibrous (Other)	None Detected
01-017 352202990-0021	BE-30 - Duct Seam Caulk Black	Gray/Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Initial report from: 04/08/2022 15:00:25

ASB_PLM_0008_0001 - 1.78 Printed: 4/8/2022 2:00 PM

Page 2 of 7


EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427

Tel/Fax: (763) 449-4922 / (763) 449-4924

<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352202990

Customer ID: TREV42

Customer PO:

Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	% Fibrous	Non-Asbestos % Non-Fibrous	Asbestos % Type
01-018-Floor Tile 352202990-0022	Corridor Outside BE-31 - 12" x 12" Floortile Cream w/Brown and White Streaks	Tan/White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-018-Adhesive 352202990-0022A	Corridor Outside BE-31 - 12" x 12" Floortile Cream w/Brown and White Streaks	Yellow Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-018-Filler 352202990-0022B	Corridor Outside BE-31 - 12" x 12" Floortile Cream w/Brown and White Streaks	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-019-Floor Tile 352202990-0023	BE-44 - 12" x 12" Floortile Gray w/Brown and White Streaks	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-019-Mastic 352202990-0023A	BE-44 - 12" x 12" Floortile Gray w/Brown and White Streaks	Black Non-Fibrous Homogeneous		94% Non-fibrous (Other)	6% Chrysotile
01-019-Adhesive/Filler 352202990-0023B	BE-44 - 12" x 12" Floortile Gray w/Brown and White Streaks	Gray/Tan Non-Fibrous Homogeneous	5% Cellulose	95% Non-fibrous (Other)	None Detected
Unable to separate yellow adhesive from gray filler, layers analyzed together:					
01-020A 352202990-0024	BE-25 - Spray On Fireproofing Gray/Firm	Gray Fibrous Homogeneous	20% Cellulose	80% Non-fibrous (Other)	None Detected
01-020B 352202990-0025	BE-25 - Spray On Fireproofing Gray/Firm	Gray Fibrous Homogeneous	20% Cellulose	80% Non-fibrous (Other)	None Detected
01-020C 352202990-0026	BE-25 - Spray On Fireproofing Gray/Firm	Gray Fibrous Homogeneous	20% Cellulose	80% Non-fibrous (Other)	None Detected
01-021-Floor Tile 352202990-0027	Corridor Outside BE-25 - 12" x 12" Floortile White w/ Gray Streaks	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-021-Mastic 352202990-0027A	Corridor Outside BE-25 - 12" x 12" Floortile White w/ Gray Streaks	Black Non-Fibrous Homogeneous	8% Cellulose	92% Non-fibrous (Other)	None Detected
01-021-Adhesive 352202990-0027B	Corridor Outside BE-25 - 12" x 12" Floortile White w/ Gray Streaks	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-022-Ceramic Tile 352202990-0028	BC-85A HAC - 4" Ceramic Wall Tile Tan	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-022-Grout 352202990-0028A	BC-85A HAC - 4" Ceramic Wall Tile Tan	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-022-Adhesive 352202990-0028B	BC-85A HAC - 4" Ceramic Wall Tile Tan	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Initial report from: 04/08/2022 15:00:25

ASB_PLM_0008_0001 - 1.78 Printed: 4/8/2022 2:00 PM

Page 3 of 7

**EMSL Analytical, Inc.**

3410 Winnetka Avenue North New Hope, MN 55427

Tel/Fax: (763) 449-4922 / (763) 449-4924

<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352202990

Customer ID: TREV42

Customer PO:

Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
01-023-Ceramic Tile 352202990-0029	BC-85A HAC - 1" Ceramic Floor Tile Tan	Gray/Tan Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-023-Grout 352202990-0029A	BC-85A HAC - 1" Ceramic Floor Tile Tan	Gray Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-023-Adhesive 352202990-0029B	BC-85A HAC - 1" Ceramic Floor Tile Tan	Yellow Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-024 352202990-0030	BC-74A Canteen Kitchen - 2' x 2' Ceiling Tile Vinyl Covered Sheetrock Look	Gray Fibrous Homogeneous	40% Cellulose 40% Min. Wool	15% Perlite 5% Non-Fibrous (Other)	None Detected
01-025-Ceramic Tile 352202990-0031	BC-74A Canteen Kitchen - 6" Ceramic Floor Tile Brown	Gray/Tan Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-025-Grout 352202990-0031A	BC-74A Canteen Kitchen - 6" Ceramic Floor Tile Brown	Gray Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-025-Adhesive 352202990-0031B	BC-74A Canteen Kitchen - 6" Ceramic Floor Tile Brown	Tan Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-026-Ceramic Tile 352202990-0032	BC-74A Canteen Kitchen - 4" Ceramic Wall Tile Cream	White/Beige Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-026-Grout 352202990-0032A	BC-74A Canteen Kitchen - 4" Ceramic Wall Tile Cream	Gray Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-026-Adhesive 352202990-0032B	BC-74A Canteen Kitchen - 4" Ceramic Wall Tile Cream	Yellow Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-027 352202990-0033	B-10 Men's Restroom - 2' x 4' Ceiling Tile Deep Lengthwise Fissures	Gray Fibrous Homogeneous	40% Cellulose 40% Min. Wool	15% Perlite 5% Non-Fibrous (Other)	None Detected
01-028-Ceiling Tile 352202990-0034	Hallway Outside BC-64 - 1' x 1' Ceiling Tile Large and Small Pinholes	Gray Fibrous Homogeneous	90% Min. Wool	5% Non-Fibrous (Other)	<1% Amosite 5% Chrysotile
01-028-Adhesive 352202990-0034A	Hallway Outside BC-64 - 1' x 1' Ceiling Tile Large and Small Pinholes	Brown Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-029 352202990-0035	Corridor Outside BD-60 - 2' x 2' Ceiling Tile Small Random Fissures w/Pinholes	Gray Fibrous Homogeneous	40% Cellulose 40% Min. Wool	15% Perlite 5% Non-Fibrous (Other)	None Detected
01-030-Floor Tile 352202990-0036	Entry by BD-65 Paint Shop - 12" x 12" Floortile Tan w/Brown/Gray/White Specks	Tan/White Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-030-Adhesive 352202990-0036A	Entry by BD-65 Paint Shop - 12" x 12" Floortile Tan w/Brown/Gray/White Specks	Yellow Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected

Initial report from: 04/08/2022 15:00:25

ASB_PLM_0008_0001 - 1.78 Printed: 4/8/2022 2:00 PM

Page 4 of 7

**EMSL Analytical, Inc.**

3410 Winnetka Avenue North New Hope, MN 55427

Tel/Fax: (763) 449-4922 / (763) 449-4924

<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352202990

Customer ID: TREV42

Customer PO:

Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	% Fibrous	Non-Asbestos % Non-Fibrous	Asbestos % Type
01-031-Flooring 352202990-0037	1C-70 - Sheet Vinyl Flooring White	White Non-Fibrous Homogeneous	5% Glass	95% Non-Fibrous (Other)	None Detected
01-031-Adhesive 352202990-0037A	1C-70 - Sheet Vinyl Flooring White	Yellow Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-032-Floor Tile 352202990-0038	1C-31 - 12" x 12" Floortile White w/Gray/Dr Gray Streaks	Gray/White Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-032-Adhesive 352202990-0038A	1C-31 - 12" x 12" Floortile White w/Gray/Dr Gray Streaks	Yellow Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-033-Floor Tile 352202990-0039	1D-01 - 12" x 12" Floortile Gray w/White and Brn Streaks	Gray/Tan Non-Fibrous Homogeneous		96% Non-Fibrous (Other)	4% Chrysotile
01-033-Mastic 352202990-0039A	1D-01 - 12" x 12" Floortile Gray w/White and Brn Streaks	Black Non-Fibrous Homogeneous		90% Non-Fibrous (Other)	10% Chrysotile
01-034-Flooring 352202990-0040	1C-112 - 12" Floortile Cream Textured	Tan/Black Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-034-Adhesive/Filler 352202990-0040A	1C-112 - 12" Floortile Cream Textured	Gray/Yellow Non-Fibrous Homogeneous	5% Cellulose	95% Non-Fibrous (Other)	None Detected
Unable to separate yellow adhesive from gray filler, layers analyzed together.					
01-035-Flooring 352202990-0041	1C-108 - Cream w/Blue and Pink	White/Blue/Pink Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-035-Adhesive 352202990-0041A	1C-108 - Cream w/Blue and Pink	Yellow Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-036 352202990-0042	1E-39 - Sheet Vinyl Flooring Brown Gray Mosaic	Gray/Tan Fibrous Heterogeneous	25% Cellulose	75% Non-Fibrous (Other)	None Detected
01-037 352202990-0043	1E-25 - Sheet Vinyl Flooring Wood Look	Tan/White Non-Fibrous Homogeneous	5% Glass	95% Non-Fibrous (Other)	None Detected
01-038-Floor Tile 352202990-0044	1D-20 - 12" Floor tile White w/Dk Gray Streaks	Tan/White Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-038-Adhesive 352202990-0044A	1D-20 - 12" Floor tile White w/Dk Gray Streaks	Yellow Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-038-Filler 352202990-0044B	1D-20 - 12" Floor tile White w/Dk Gray Streaks	Gray Non-Fibrous Homogeneous	10% Cellulose	90% Non-Fibrous (Other)	None Detected
01-039-Flooring 352202990-0045	1D-128 - Sheet Vinyl Flooring Gray/Rust/White Mosaic	Gray Fibrous Homogeneous	25% Cellulose	75% Non-Fibrous (Other)	None Detected
01-039-Adhesive/Filler 352202990-0045A	1D-128 - Sheet Vinyl Flooring Gray/Rust/White Mosaic	Gray/Clear Non-Fibrous Homogeneous	5% Cellulose	95% Non-Fibrous (Other)	None Detected

Unable to separate clear adhesive from gray filler, layers analyzed together.

Initial report from: 04/08/2022 15:00:25

ASB_PLM_0008_0001 - 1.78 Printed: 4/8/2022 2:00 PM

Page 5 of 7



EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427

Tel/Fax: (763) 449-4922 / (763) 449-4924

<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352202990

Customer ID: TREV42

Customer PO:

Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
01-040-Flooring 352202990-0040	1D-44 HAC - Sheet Vinyl Floor Lt. Gray w/Dk Gray and White	Gray/White Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-040-Adhesive 352202990-0040A	1D-44 HAC - Sheet Vinyl Floor Lt. Gray w/Dk Gray and White	Blue/Green Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-041 352202990-0047	1D-116 - 2' x 4' Ceiling Tile Small Random Fissures w/Pinholes	Gray Fibrous Homogeneous	40% Cellulose 40% Min. Wool	15% Perlite 5% Non-Fibrous (Other)	None Detected
01-042-Floor Tile 352202990-0048	2C-77 - 12" Floor tile White w/Gray and Black Streaks	Tan Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-042-Mastic 352202990-0048A	2C-77 - 12" Floor tile White w/Gray and Black Streaks	Black Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-043 352202990-0049	1D-40 - 2' x 2' Ceiling Tile Random Fissures w/Pinholes (Drop in)	Gray Non-Fibrous Homogeneous	70% Cellulose 15% Min. Wool	10% Perlite 5% Non-Fibrous (Other)	None Detected
01-044 352202990-0050	2E-25 - Sheet Vinyl Flooring Brown/Gray/Mosaic	Brown/Gray/Tan Fibrous Homogeneous	25% Cellulose	75% Non-Fibrous (Other)	None Detected
01-045-Floor Tile 352202990-0051	2E-41 - 12" Floor tile Cream w/ Gold	Tan Non-Fibrous Homogeneous		95% Non-Fibrous (Other)	5% Chrysotile
01-045-Mastic 352202990-0051A	2E-41 - 12" Floor tile Cream w/ Gold	Black Non-Fibrous Homogeneous		90% Non-Fibrous (Other)	10% Chrysotile
01-046 352202990-0052	2E-41 - 1' x 1' Ceiling Tile White Spline	Gray Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-047 352202990-0053	2E-44 - 2' x 4' Ceiling Tile Deep Random Fissure	Gray Fibrous Homogeneous	40% Cellulose 40% Min. Wool	15% Perlite 5% Non-Fibrous (Other)	None Detected
01-048 352202990-0054	2D-18 - Sheet Vinyl Flooring Cream/Tan/Brown	Tan Non-Fibrous Homogeneous	5% Glass	95% Non-Fibrous (Other)	None Detected
01-049A 352202990-0055	3E-45 - Spray On Fireproofing Gray	Tan Non-Fibrous Homogeneous	20% Cellulose	80% Non-Fibrous (Other)	None Detected
01-049B 352202990-0056	3E-45 - Spray On Fireproofing Gray	Tan Non-Fibrous Homogeneous	20% Cellulose	80% Non-Fibrous (Other)	None Detected
01-049C 352202990-0057	3E-45 - Spray On Fireproofing Gray	Tan Non-Fibrous Homogeneous	20% Cellulose	80% Non-Fibrous (Other)	None Detected
01-050-Floor Tile 352202990-0058	Stairwell #3 4th Floor - 12" Floortile Tan/Brown/White	Tan Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
01-050-Mastic 352202990-0058A	Stairwell #3 4th Floor - 12" Floortile Tan/Brown/White	Black Non-Fibrous Homogeneous		92% Non-Fibrous (Other)	8% Chrysotile
01-051A 352202990-0059	4th Floor Corridor Outside Elevator #4 - Spray On Texture White	White Non-Fibrous Homogeneous		5% Mica 95% Non-Fibrous (Other)	None Detected

Initial report from: 04/08/2022 15:00:25

ASB_PLM_0008_0001 - 1.78 Printed: 4/8/2022 2:00 PM

Page 6 of 7

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 1



EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427
Tel/Fax: (763) 449-4922 / (763) 449-4924
<http://www.EMSL.com> / minneapolislab@emsl.com

EMSL Order: 352202990
Customer ID: TREV42
Customer PO:
Project ID:

**Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized
Light Microscopy**

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
01-051B	4th Floor Corridor	White		5% Mica	None Detected
352202990-0060	Outside Elevator #4 -	Non-Fibrous		95% Non-Fibrous (Other)	
	Spray On Texture	Homogeneous			
	White				
01-051C	4th Floor Corridor	White		5% Mica	None Detected
352202990-0061	Outside Elevator #4 -	Non-Fibrous		95% Non-Fibrous (Other)	
	Spray On Texture	Homogeneous			
	White				

Analyst(s)

Daniel Nordland (96)

Rachel Travis, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and meet method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/R4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. New Hope, MN NVLAP Lab Code 200019-0; Colorado AL-24478

Initial report from: 04/08/2022 15:00:25

ASB_PLM_0008_0001 - 1.78 Printed: 4/8/2022 2:00 PM

Page 7 of 7

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 1



EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427
Tel/Fax: (763) 449-4922 / (763) 449-4924
<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203398

Customer ID: TREV42

Customer PO:

Project ID:

Attention: John Rogers
Trine Environmental
6678 Morningdale Drive
Brighton, MI 48116

Phone: (810) 986-0536

Fax:

Received Date: 04/14/2022 1:30 PM

Analysis Date: 04/20/2022 - 04/21/2022

Collected Date:

Project: Fargo VA Inspection

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
01-052A	Throughout - spray-on fireproofing (white/gray)	Gray Fibrous Homogeneous	95% Min. Wool	5% Non-fibrous (Other)	None Detected
352203398-0001					
01-052B	Throughout - spray-on fireproofing (white/gray)	Gray Fibrous Homogeneous	95% Min. Wool	5% Non-fibrous (Other)	None Detected
352203398-0002					
01-052C	Throughout - spray-on fireproofing (white/gray)	Gray Fibrous Homogeneous	95% Min. Wool	5% Non-fibrous (Other)	None Detected
352203398-0003					
01-052D	Throughout - spray-on fireproofing (white/gray)	Gray Fibrous Homogeneous	95% Min. Wool	5% Non-fibrous (Other)	None Detected
352203398-0004					
01-052E	Throughout - spray-on fireproofing (white/gray)	Gray Fibrous Homogeneous	95% Min. Wool	5% Non-fibrous (Other)	None Detected
352203398-0005					
01-052F	Throughout - spray-on fireproofing (white/gray)	Gray Fibrous Homogeneous	95% Min. Wool	5% Non-fibrous (Other)	None Detected
352203398-0006					
01-052G	Throughout - spray-on fireproofing (white/gray)	Gray Fibrous Homogeneous	95% Min. Wool	5% Non-fibrous (Other)	None Detected
352203398-0007					
01-053-Floor Tile	BB-01 - 9"x9" Floortile (white w/ Red and Black)	Tan Non-Fibrous Heterogeneous		95% Non-fibrous (Other)	5% Chrysotile
352203398-0008					
01-053-Mastic	BB-01 - 9"x9" Floortile (white w/ Red and Black)	Black Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0008A					
01-054	BE-45 - Building seam caulk (Gray)	Tan/White Fibrous Heterogeneous		97% Non-fibrous (Other)	3% Chrysotile
352203398-0009					
01-055	BE-44 - sheetrock/Tape/compound	Tan/White Fibrous Heterogeneous	10% Cellulose <1% Glass	<1% Mica 90% Non-fibrous (Other)	None Detected
352203398-0010					
This is a composite result of wallboard, fl. compound, and tape					
01-056A-Skim Coat	BE-38 - Hard Plaster wall (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0011					
01-056A-Plaster	BE-38 - Hard Plaster wall (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0011A					
01-056B-Skim Coat	BE-38 - Hard Plaster wall (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0012					
01-056B-Plaster	BE-38 - Hard Plaster wall (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0012A					
01-056C-Skim Coat	BE-38 - Hard Plaster wall (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0013					

Initial report from: 04/21/2022 17:02:38

ASB_PLM_0008_0001 - 1.78 Printed: 4/21/2022 4:02 PM

Page 1 of 6



EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427

Tel/Fax: (763) 449-4922 / (763) 449-4924

<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203398

Customer ID: TREV42

Customer PO:

Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
01-056C-Plaster 352203398-00134	BE-38 - Hard Plaster wall (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-056D-Skim Coat 352203398-0014	BE-38 - Hard Plaster wall (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-056D-Plaster 352203398-0014A	BE-38 - Hard Plaster wall (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-056E-Skim Coat 352203398-0015	BE-38 - Hard Plaster wall (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-056E-Plaster 352203398-0015A	BE-38 - Hard Plaster wall (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-056F-Skim Coat 352203398-0016	BE-38 - Hard Plaster wall (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-056F-Plaster 352203398-0016A	BE-38 - Hard Plaster wall (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-056G-Skim Coat 352203398-0017	BE-38 - Hard Plaster wall (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-056G-Plaster 352203398-0017A	BE-38 - Hard Plaster wall (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-057A-Skim Coat 352203398-0018	BE-38 - Hard-Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-057A-Plaster 352203398-0018A	BE-38 - Hard-Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-057B-Skim Coat 352203398-0019	BE-38 - Hard-Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-057B-Plaster 352203398-0019A	BE-38 - Hard-Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-057C-Skim Coat only 352203398-0020	BE-38 - Hard-Lid Plaster Ceiling (white/gray)	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-057D-Skim Coat only 352203398-0021	BE-38 - Hard-Lid Plaster Ceiling (white/gray)	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-057E-Skim Coat 352203398-0022	BE-38 - Hard-Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-057E-Plaster 352203398-0022A	BE-38 - Hard-Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
01-057F-Skim Coat only 352203398-0023	BE-38 - Hard-Lid Plaster Ceiling (white/gray)	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Initial report from: 04/21/2022 17:02:38

ASB_PLM_0008_0001 - 1.78 Printed: 4/21/2022 4:02 PM

Page 2 of 6



EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427

Tel/Fax: (763) 449-4922 / (763) 449-4924

<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203398

Customer ID: TREV42

Customer PO:

Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	% Fibrous	Non-Asbestos % Non-Fibrous	Asbestos % Type
01-057G-Skim Coat only 352203398-0024	BE-38 - Hard-Lid Plaster Ceiling (white/gray)	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-058 352203398-0025	BE-46 - Fire stop (red)	Red Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
09-001-Floor Tile 352203398-0026	BA-65 - 12"x12" Floor tile (Gray/Brown/white)	Tan Non-Fibrous Heterogeneous		97% Non-fibrous (Other)	3% Chrysotile
09-001-Tan Mastic 352203398-0026A	BA-65 - 12"x12" Floor tile (Gray/Brown/white)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-001-Black Mastic 352203398-0026B	BA-65 - 12"x12" Floor tile (Gray/Brown/white)	Black Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-002-Floor Tile 352203398-0027	BA-65 - 12"x12" Floor tile (Tan w/ Brown and white specks)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-002-Tan Mastic 352203398-0027A	BA-65 - 12"x12" Floor tile (Tan w/ Brown and white specks)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-002-Black Mastic 352203398-0027B	BA-65 - 12"x12" Floor tile (Tan w/ Brown and white specks)	Black Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-003 352203398-0028	BA-65 - Concrete Floor Trench Seam Caulk	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
09-004 352203398-0029	BB-44 - 2"x4' Ceiling Tile (widthwise fissures)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-005 352203398-0030	BB-15B - 2"x4' Ceiling Tile (vinyl covered sheetrock look)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-006 352203398-0031	BB-22 - 2"x2' ceiling Tile (Long fissures w/ Pinholes)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-007 352203398-0032	BB-55 Corridor - 2"x2' ceiling Tile (Rough Texture)	Tan/White Fibrous Homogeneous	95% Min. Wool	5% Non-fibrous (Other)	None Detected
09-008A 352203398-0033	BB-09 - spray-on fireproofing	White Fibrous Homogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
09-008B 352203398-0034	BB-09 - spray-on fireproofing	White Fibrous Homogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
09-008C 352203398-0035	BB-09 - spray-on fireproofing	White Fibrous Homogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
09-009 352203398-0036	BB-67 North/South Corridor - 2"x2' ceiling tile (Random fissures)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-010 352203398-0037	1A-30B - 2"x2' ceiling tile (vinyl covered sheetrock Look)	Tan/White Fibrous Homogeneous	40% Cellulose 40% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected

Initial report from: 04/21/2022 17:02:38

ASB_PLM_0008_0001 - 1.78 Printed: 4/21/2022 4:02 PM

Page 3 of 6

APPENDIX B – ASBESTOS INSPECTOR CERTIFICATION

Certificate No: 5LM021522021R Expiration Date: February 15, 2023

This is to certify that
Daniel J. Johnson
has attended and successfully completed an
**ASBESTOS INSPECTOR
REFRESHER TRAINING COURSE**
permitted by
the State of Minnesota under Minnesota Rules 4620.3702 to 4620.3722
and meets the requirements of
Section 206 of Title II of the Toxic Substances Control Act (TSCA)
conducted by
Lake States Environmental, Ltd.
in
White Bear Lake, MN on February 15, 2022
Examination Date: February 15, 2022

Lake States Environmental, Ltd.
P. O. Box 645, Rice Lake, WI 54868
(800) 254-9811

57

North Dakota Department of
Environmental Quality
Certificate of No. 6984
Asbestos Abatement

This is to certify that Daniel James Johnson has met the
requirements of Chapter 33.1-15-13 of the North Dakota Air Pollution Control
Rules for certification in the following asbestos abatement discipline(s):
Supervisor
Worker
Asbestos
Management Planner
Project Designer
Project Monitor

Exp: 2/15/2023 *Jane Kruger*
Asbestos Control Program

ASBESTOS SURVEY – 2022

Fargo VA Medical Center – Building 9

**2101 Elm Street North
Fargo, ND 58102**



PREPARED FOR:

**Ron Tollefson (VA COR)
2101 Elm Street North
Fargo, ND 58102**

PREPARED BY:

**TRINE Environmental, Inc. (SDVOSB)
6678 Morningdale Dr.
Brighton, MI**

**Dan Johnson
Asbestos Inspector (ND 6804)**

**John R Rogers
President**



Table of Contents

1.0 – INTRODUCTION	3
2.0 – SITE HISTORY & DESCRIPTION	3
3.0 – METHODS & LIMITATIONS.....	3
3.1 – Asbestos Survey Methods.....	3
3.2 – Laboratory Analytical Methods	5
3.3 – Limitations	5
4.0 – SURVEY RESULTS	6
4.1 – Asbestos Analysis Results	6
Table 1 – Analytical Results	8
Table 2 – Room by Room	9
4.2 – Additional Observations	62
4.3 – Cost Estimate for Asbestos Abatement.....	62
5.0 – RECOMMENDATIONS	62
5.1 – Recommendations for Regulated ACM (RACM)	62
5.2 – Recommendations for Category I Non-Friable ACM (C1NF).....	62
5.3 – Recommendations for Category II Non-Friable ACM (C2NF)	63
5.4 – General Recommendations.....	63
6.0 – SIGNATURE PAGE.....	64
APPENDIX A – LABORATORY CERTIFICATE OF ANALYSIS	65
APPENDIX B – ASBESTOS INSPECTOR CERTIFICATION	70

1.0 – INTRODUCTION

An asbestos survey was conducted at the Veterans Administration Medical Center (VAMC) Fargo Health Care System (HCS), 2101 Elm Street North Fargo, ND 58102. The survey was conducted between February 28th and March 31st, 2022, by Dan Johnson of TRINE Environmental, Inc., an EPA-certified building inspector in the state of North Dakota.

The purpose of this asbestos survey was to identify the presence, and extent of asbestos containing materials (ACM) in seventeen (17) buildings, incorporate previously performed asbestos survey, and create a new database in support of future plans to renovate which may require demolition activities. Each building was considered a separate homogenous area (HA).

The inspection was performed by a certified EPA asbestos building inspector, experienced in identifying and sampling suspect ACM. All areas of Building 9 were accessed and inspected.

Suspect materials were sampled to determine asbestos content.

All samples collected were analyzed at EMSL Analytical, Inc., (EMSL) an AIHA and NVLAP accredited asbestos laboratory, using either Polarized Light Microscopy (PLM) methods or Transmission Electron Microscopy (TEM) methods. A total of twenty-three (23) samples were collected and analyzed.

Laboratory Certificates of Analysis are located in Appendix A of this report. Company and individual licenses and certifications are located in Appendix B.

2.0 – SITE HISTORY & DESCRIPTION

The Fargo VA HCS campus is made up of 17 buildings that first started construction in 1929 with major expansions in 1945 and 1983 but have also been under constant renovations of various magnitudes over the last 92 years. Currently the campus has approximately 576,000 interior gross square feet (GSF).

3.0 – METHODS & LIMITATIONS

3.1 – Asbestos Survey Methods

The site was inspected for suspect ACM, unless otherwise noted. Each observed suspect material was assigned a material identification within the homogenous area (HA), such as ceiling tile (CT), floor tile (FT), Thermal System Insulation (TSI) or miscellaneous (MISC), described, and measured. Each observed suspect material was sampled except for those that were confirmed positive from previous sampling events or determined to non-suspect material. Samples of suspect ACM were collected using procedures established by the United States Environmental Protection Agency (USEPA) Code of Federal Regulations (CFR) Title 40 Part 763 Subpart E, Asbestos Containing Materials in Schools.

Upon completing an initial walkthrough, the asbestos inspector began a thorough inspection identifying probable ACM and categorizing by material identification. Each material identification represented a group of material having similar characteristics such as appearance, color and manner in which it was used.

ACM's were divided into three categories:

1. **Surfacing Materials:** material that is sprayed-on, troweled on, or otherwise applied to surfaces, such as acoustical plaster on ceilings and fireproofing materials on structural members, or other materials on surfaces for acoustical, fireproofing or other purposes
2. **Thermal System Insulation (TSI):** material applied to pipes, fittings, boilers, breeching, tanks, ducts, or other structural components to prevent heat loss or gain, or water condensation, or for other purposes
3. **Miscellaneous ACM:** interior building material on structural components, structural members or fixtures, such as floor and ceiling tiles, and does not include surfacing material or thermal insulation

ACM's inventoried in this survey are classified as either friable or non-friable. Friable ACM can be crumbled or reduced to powder by hand pressure whereas non-friable ACM cannot.

The EPA asbestos NESHAP regulation further classifies non-friable ACM into two categories:

1. **Category I:** Non-friable ACM includes any asbestos-containing packing, gasket, resilient floor covering or asphalt roofing product
2. **Category II:** Non-friable ACM includes any non-friable ACM other than Category I non-friable ACM

Samples were collected in airtight sealed bags for transportation to EMSL for analysis. Standard Operating Procedures dictated samples were collected in manner consistent with health and safety protocols, using personal hygiene methods, using wet methods as required, and donning proper Personal Protective Equipment (PPE). These methods were used to prevent asbestos airborne contamination from being introduced to the hospital's atmosphere and to minimize employee, staff, and patient exposure.

Lab data pertaining to the samples analyzed is located in Appendix A of this report and each sample is listed as follows:

- Date Analyzed
- Field Sample #
- Lab Sample #
- Sample Location
- Asbestos Content
- Non-Asbestos Content

Samples were analyzed using PLM methods and Point Count Methods for any sample returning a $\leq 5\%$ (less than or equal to) result, excluding non-detects.

3.2 – Laboratory Analytical Methods

All samples collected during the survey were analyzed at EMSL, an A.I.H.A. and NVLAP certified laboratory. Upon arrival at the laboratory, the samples were logged-in and submitted for analysis.

PLM samples were analyzed utilizing the Environmental Protection Agency's test method: Methods for the determination of Asbestos in Bulk Building Materials (EPA 600/R-93/116, July 1993) and the McCrone Research Institute's The Asbestos Particle Atlas as the principal analytical references. Additional treatment and tests may be required to accurately define composition (i.e. ashing, extraction, acetone treatment, and TEM).

The PLM method utilizes a light microscope equipped with polarizing filters. The identification of asbestos fiber bundles is determined by the visual properties displayed when the sample is treated with various dispersion staining liquids. Identification is substantiated by the actual structure of the fiber and the effect of polarized light on the fiber, all of which is viewed by a trained technician. The limit of detection of asbestos by PLM is about one percent (1%) by area. Samples containing lower levels of asbestos are not reliably detectable by this technique.

Analysis was performed by using the bulk sample for visual observation and slide preparation(s) for microscopic examination and identification. The samples were analyzed for asbestos (chrysotile, amosite, crocidolite, anthophyllite, and actinolite/tremolite), fibrous non-asbestos constituents (cellulose, synthetic, etc.) and non-fibrous constituents. Using a stereoscope, the microscopist visually estimated relative amounts of each constituent by determining the volume of each constituent in proportion to the total volume of the sample.

The asbestos National Emission Standards for Hazardous Air Pollutants (NESHAP) recommends that asbestos bulk samples that are less than 10% by PLM are to be analyzed by point counting for friable ACM and mandates point counting when PLM results for friable ACM are in trace amounts (< 1%) in order to declare that the material is non-asbestos containing. The point-count procedure mandated by NESHAP is in the EPA "Interim" Bulk Method. For each layer to be point counted, eight mounts are made by dispersing 8 pinches of sample in suitable fluid. Each of the mounts is examined under the polarizing light microscope using an eyepiece reticule that superimposes a grid of points over the field of view. Fifty non-empty points are examined for each mount, yielding 400 points – some of which would be identified as asbestos and the rest as non-asbestos material.

Transmission Electron Microscopy (TEM) analysis is used to quantify and identify asbestos structures using electron diffraction and energy dispersive X-ray (EDX) analysis. Identification of chrysotile or amphibole crystalline structures can be consistently determined via the electron-diffraction capabilities of modern TEMs. The five amphibole types can be differentiated based on their elemental composition when EDX analysis is combined with their electron diffraction patterns.

3.3 – Limitations

This asbestos survey report has been prepared by TRINE in a manner consistent with that level of care and skill ordinarily exercised by members of the profession currently practicing under similar conditions. No other warranty expressed or implied is made. The intent of this survey report is to assist the building owner or management in locating ACM. This document is not intended to be utilized as a proposal or a project design document for the remediation of asbestos materials discovered during this investigation.

The survey was conducted to identify suspect ACM on the interior areas of Building 9. Some ACM may not have been discovered due to inaccessibility. Any suspect materials discovered subsequent to the issue of this survey report should be sampled and analyzed to determine asbestos content and to initiate appropriate responses.

TRINE's interpretations and recommendations are based upon the results of sample collection and analyses in compliance with environmental regulations, quality control and assurance standards, and the scope of work. The results, conclusions, and recommendations contained in this report pertain to conditions observed at the time of the survey.

The field observations, measurements, and research reported herein are considered sufficient in detail and scope to form a reasonable basis for an Asbestos Survey Report. The assessment, conclusions, and recommendations presented herein are based upon the sample analysis results of collected materials within the Homogenous Area. They may not represent all conditions at the subject site as they reflect the information gathered from specific locations. TRINE Environmental, Inc. warrants the findings and conclusions contained herein have been promulgated in accordance with generally accepted industrial hygiene methodology and only for the site described in this report.

Reliance on or use by any such third-party without explicit authorization in the report does not make said third-party a third-party beneficiary to TRINE's contract with the VA. Any such unauthorized reliance on or use of this report, including any of its information or conclusions, will be at third-party's risk. For the same reasons, no warranties or representations, expressed or implied in this report, are made to any such third party.

This report has been developed to provide the client with information regarding apparent conditions relating to the subject property. Although TRINE believes that the findings and conclusions provided in this report are reasonable, the report is necessarily limited to the conditions observed and to the information available at the time of the work. Due to the nature of the work, there is a possibility conditions exist that could not be identified within the scope of the inspection, or which were not apparent at the time of our site work. The report is also limited to information available from the client at the time it was conducted. It is also possible that the testing methods employed at the time of the report may later be superseded by other methods. TRINE does not accept responsibility for changes in the state of the art.

4.0 – SURVEY RESULTS

4.1 – Asbestos Analysis Results

A total of twenty-three (23) samples were collected and analyzed by PLM. The original laboratory report and certificate of analysis are located in Appendix A.

The following tables summarize the samples collected and quantity of materials that contain asbestos in amounts >1% (greater than). Table 1 provides the analytical results of the samples submitted to the laboratory. Table 2 provides a room-by-room breakdown of the materials identified and sample number associated with the analytical results.

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 9

TABLE LEGEND

NAD: No Asbestos Detected

ACM Material with type and percent detected

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 9

Table 1 – Analytical Results

Sample Numbers	Location / Homogenous Area	Material Description	Material Type	Exterior Description	Quantity	AHERA Material Category	Condition	Potential for Future Damage	Asbestos Content	Balance Material	Notes
09-001	BA-65 Renovation Area	12" x 12" Floor Tile		Gray/Brown /White	1				3% Chrysotile FT		FT-1
09-002	BA-65 Renovation Area	12" x 12" Floor Tile		Tan w/Brown and White Specks	1				None Detected		FT-2
09-003	BA-65 Renovation Area	Concrete Floor Trench Seam Caulk		Gray	1				None Detected		
09-004	BB-44	2' x 4' Ceiling Tile		Widthwise Fissures	1				None Detected		CT-1
09-005	BB-15B	2' x 4' Ceiling Tile		Vinyl Covered Sheetrock Look	1				None Detected		CT-2
09-006	BB-22			Long Fissures w/Pinholes	1				None Detected		CT-3
09-007	BB-55 Corridor	2' x 2' Ceiling Tile		Rough Texture	1				None Detected		CT-4
09-008A-C	BB-09	Spray-On Fireproofing		White Fluffy	3				None Detected		
09-009	BB-67 North/South Corridor	2' x 2' Ceiling Tile		Random Fissures	1				None Detected		CT-5
09-010	1A-30B	2' x 2' Ceiling Tile		Vinyl Covered Sheetrock Look	1				None Detected		CT-6
09-011	1B-73	12" x 12" Floor Tile		White w/Black Specks	1				None Detected		FT-3
09-012	2A-66 Corridor	12" x 12" Floor Tile		White w/Gold	1				4% Chrysotile (FT)/10% Chrysotile (Mastic)		FT-4
09-013	2A-34	2' x 4' Ceiling Tile		Random Fissures	1				None Detected		CT-7
09-014	4A-40 Corridor	12" x 12" Floor Tile		White w/Gray Streaks	1				None Detected		FT-5
09-015	Penhouse	Building Seam Filler		Gray	1				None Detected		
09-016	Penhouse	West Window Glazing		Gray	1				None Detected		
09-017	Penthouse	SE Mud at Floor Around Duct		White/Gray	1				None Detected		

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Sample Numbers	Location / Homogenous Area	Material Description	Material Type	Exterior Description	Quantity	AHERA Material Category	Condition	Potential for Future Damage	Asbestos Content	Balance Material	Notes
09-018	Penthouse	Ceiling Fiberglass insulation Backing		Black	1				None Detected		
09-019	Penthouse	Tar Paper by Windows		Black	1				None Detected		
09-020	BA-65 Renovation Area	Fire Stop		Red	1				None Detected		
09-021A-C	Outside BA-65 Renovation Area in Corridor	Hard Plaster Ceiling		White/Gray	3				None Detected		<1,000 sf Left
09-022A-G	BA-65 Renovation Area	Hard Plaster Wall		White/Gray	7				None Detected		
09-023	BA-65 Renovation Area	Sheetrock/Tape/Compound		White	1				None Detected		

Table 2 – Room by Room

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BA-03	B	No Suspect Material									
BA-05	B	No Suspect Material									
BA-07	B	No Suspect Material									
BA-07A	B	No Suspect Material									
BA-09	B	Thermal System Insulation			Gray	12lf		Assumed	Friable	Assumed	In Floor Trench
BA-09	B	No Suspect Material									
BA-10	B	No Suspect Material									
BA-65 Renovation Area	B	12" x 12" Floor Tile and Mastic	FT-1	12"x12"	Gray/Brown /White	275 sf		3% Chrysotile (FT)	Non-Friable	09-001	FT-1
BA-65 Renovation Area	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	375 sf		None Detected		09-002	FT-2

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BA-65 Renovation Area	B	Thermal System Insulation			Gray	100 lf		Assumed	Friable	Assumed	In Floor Trench
BA-65 Renovation Area	B	Concrete Floor Seam Caulk			Gray	100 lf		None Detected		09-003	
BB-09	B	Spray-On Fireproofing			White Fluffy	955 sf		None Detected		09-008A-C	
BB-09 Corridor	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	750 sf		None Detected		09-002	FT-2
BB-09 Corridor	B	Thermal System Insulation			Gray	200 lf		Assumed	Friable	Assumed	In Floor Trench
BB-10	B	Thermal System Insulation			Gray	10 lf		Assumed	Friable	Assumed	Above Hard Lid Ceiling
BB-12	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	200 sf		None Detected		09-004	CT-1
BB-12	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	200 sf		None Detected		09-002	FT-2
BB-15	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	2,000 sf		None Detected		09-005	CT-2
BB-15	B	Sheet Vinyl Floor			Gray	2,000 sf				Non-Suspect	New
BB-15A	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	150 sf		None Detected		09-005	CT-2
BB-15A	B	2" Ceramic Floor Tile			Gray	150 sf				Non-Suspect	New
BB-15A	B	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
BB-15A1	B	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
BB-15A-1	B	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
BB-15B	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	150 sf		None Detected		09-005	CT-2
BB-15B	B	2" Ceramic Floor Tile			Gray	150 sf				Non-Suspect	New
BB-15B	B	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
BB-15B1	B	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-15B1	B	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
BB-16A	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-005	CT-2
BB-16A	B	Sheet Vinyl Floor			Gray	50 sf				Non-Suspect	New
BB-16B	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-005	CT-2
BB-16B	B	Sheet Vinyl Floor			Gray	50 sf				Non-Suspect	New
BB-17	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	1,200 sf		None Detected		09-005	CT-2
BB-17	B	Sheet Vinyl Floor			Gray	1,200 sf				Non-Suspect	New
BB-17A	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	120 sf		None Detected		09-005	CT-2
BB-17A	B	Sheet Vinyl Floor			Gray	120 sf				Non-Suspect	New
BB-18A	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	40 sf		None Detected		09-005	CT-2
BB-18A	B	Sheet Vinyl Floor			Gray	40 sf				Non-Suspect	New
BB-18B	B	2' x 4" Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-005	CT-2
BB-18B	B	Sheet Vinyl Floor			Gray	50 sf				Non-Suspect	New
BB-22	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	110 sf		None Detected		09-006	CT-3
BB-24	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	450 sf		None Detected		09-004	CT-1
BB-24	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	450 sf		None Detected		09-002	FT-2
BB-24 Corridor	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	750 sf		None Detected		09-002	FT-2
BB-26	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	110 sf		None Detected		09-006	CT-3
BB-27	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-28	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-30	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	170 sf		None Detected		09-006	CT-3
BB-31	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
BB-32	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	170 sf		None Detected		09-004	CT-1
BB-33	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-004	CT-1
BB-34	B	Spray-On Fireproofing			Gray	3,000 sf				Non-Suspect	New
BB-34A	B	Spray-On Fireproofing			Gray	100 sf				Non-Suspect	New
BB-34B	B	No Suspect Material									
BB-35	B	Need Access									
BB-44	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
BB-44	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-44A	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	50 sf		None Detected		09-006	CT-1
BB-44A	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
BB-44B	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	50 sf		None Detected		09-006	CT-1
BB-44B	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
BB-50	B	No Suspect Material									
BB-50 Mech	B	No Suspect Material									
BB-52	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
BB-53	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	240 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-54	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
BB-55	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
BB-55 Corridor	B	2' x 2' Ceiling Tile	CT-4	2'x2'	Rough Texture	550 sf		None Detected		09-007	CT-4
BB-55 Corridor	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	550 sf		None Detected		09-002	FT-2
BB-56	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	40 sf		None Detected		09-006	CT-3
BB-56	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	40 sf		None Detected		09-002	FT-2
BB-57	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	40 sf		None Detected		09-006	CT-3
BB-57	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	40 sf		None Detected		09-002	FT-2
BB-58	B	No Suspect Material									
BB-59	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
BB-59	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
BB-59A	B	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
BB-59A	B	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
BB-60	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
BB-60	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
BB-60A	B	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
BB-60A	B	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
BB-61	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-62	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-62	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-64	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
BB-64	B	2" Ceramic Floor Tile			Gray	150 sf				Non-Suspect	New
BB-64	B	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
BB-66	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
BB-66	B	2" Ceramic Floor Tile			Gray	120 sf				Non-Suspect	New
BB-66	B	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
BB-67	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-67 North/South Corridor	B	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	220 sf		None Detected		09-009	CT-5
BB-67 North/South Corridor	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	220 sf		None Detected		09-002	FT-2
BB-67A	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-67B	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-67C	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-67D	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-68	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
BB-68	B	2" Ceramic Floor Tile			Gray	120 sf				Non-Suspect	New
BB-68	B	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
BB-69	B	No Suspect Material									
BB-70	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	250 sf		None Detected		09-006	CT-1

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-82	B	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
BB-82	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-84	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
BB-84	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-85	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
BB-85	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-85A	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
BB-85A	B	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
BB-85B	B	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-05	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	360 sf		None Detected		09-006	CT-3
1A-05	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	360 sf		None Detected		09-002	FT-2
1A-05	1	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
1A-05A	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	110 sf		None Detected		09-006	CT-3
1A-05A	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	110 sf		None Detected		09-002	FT-2
1A-05A	1	Thermal System Insulation			Gray	32 lf	Good	Assumed	Friable	Assumed	In Chase
1A-07	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	160 sf		None Detected		09-006	CT-3
1A-07	1	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
1A-09	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
1A-09A	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1A-09A	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50		None Detected		09-002	FT-2
1A-11	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	160 sf		None Detected		09-006	CT-1
1A-11	1	2" Ceramic Floor Tile			Gray	160 sf				Non-Suspect	New
1A-11	1	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
1A-13	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	160 sf		None Detected		09-006	CT-1
1A-13	1	2" Ceramic Floor Tile			Gray	160 sf				Non-Suspect	New
1A-13	1	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
1A-15	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	85 sf		None Detected		09-006	CT-3
1A-15	1	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
1A-19	1	No Suspect Material									
1A-20	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	250 sf		None Detected		09-006	CT-3
1A-22	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	100 sf		None Detected		09-010	CT-6
1A-22	1	Epoxy Floor			Gray	100 sf				Non-Suspect	
1A-23	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	100 sf		None Detected		09-010	CT-6
1A-23	1	Epoxy Floor			Gray	100 sf				Non-Suspect	
1A-24	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	100 sf		None Detected		09-010	CT-6
1A-24	1	Epoxy Floor			Gray	100 sf				Non-Suspect	
1A-24 Corridor	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	350 sf		None Detected		09-010	CT-6
1A-24 Corridor	1	Sheet Vinyl Floor			Cream	350 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1A-25	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-010	CT-6
1A-25	1	Sheet Vinyl Floor			Cream	50 sf				Non-Suspect	New
1A-27	1	No Suspect Material									
1A-28	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-010	CT-6
1A-28	1	Sheet Vinyl Floor			Cream	50 sf				Non-Suspect	New
1A-30	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	1,500 sf		None Detected		09-010	CT-6
1A-30	1	Sheet Vinyl Floor			Cream	1,500 sf				Non-Suspect	New
1A-30A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	300 sf		None Detected		09-006	CT-1
1A-30A	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	300 sf		None Detected		09-002	FT-2
1A-30B	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-010	CT-6
1A-30B	1	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
1A-30B	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1A-30C	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	350 sf		None Detected		09-010	CT-6
1A-30C	1	Sheet Vinyl Floor			Cream	350 sf				Non-Suspect	New
1A-30D	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	25 sf		None Detected		09-010	CT-6
1A-30D	1	Sheet Vinyl Floor			Cream	25 sf				Non-Suspect	New
1A-30E	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	250 sf		None Detected		09-006	CT-1
1A-30E	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	250 sf		None Detected		09-002	FT-2
1A-30F	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1A-30F	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
1A-30G	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	50 sf		None Detected		09-009	CT-5
1A-30G	1	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
1A-30G	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1A-30H	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	300 sf		None Detected		09-010	CT-6
1A-30H	1	Sheet Vinyl Floor			Cream	300 sf				Non-Suspect	New
1A-30I	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	600 sf		None Detected		09-010	CT-6
1A-30I	1	Sheet Vinyl Floor			Cream	600 sf				Non-Suspect	New
1A-30IA	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-010	CT-6
1A-30IA	1	Sheet Vinyl Floor			Cream	50 sf				Non-Suspect	New
1A-30J	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	700 sf		None Detected		09-010	CT-6
1A-30J	1	Sheet Vinyl Floor			Cream	700 sf				Non-Suspect	New
1A-31	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
1A-33	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	160 sf		None Detected		09-006	CT-1
1A-34	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-35	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-35	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
1A-36	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-37	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1A-38	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-39	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-40	1	No Suspect Material									
1A-41	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	180 sf		None Detected		09-010	CT-6
1A-50	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	460 sf		None Detected		09-006	CT-3
1A-52	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
1A-52	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
1A-54	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
1A-54	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
1A-55	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-57	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-58	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
1A-59	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
1A-59 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	1,200 sf		None Detected		09-006	CT-3
1A-60	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-62	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-63	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
1A-63	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
1A-64	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	235 sf		None Detected		09-006	CT-1

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1A-66	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	235 sf		None Detected		09-006	CT-1
1A-67A	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	75 sf		None Detected		09-006	CT-3
1A-68	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	240 sf		None Detected		09-006	CT-1
1A-69	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	385 sf		None Detected		09-006	CT-1
1A-69A	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	75 sf		None Detected		09-006	CT-3
1A-69A	1	2" Ceramic Floor Tile			Gray	75 sf				Non-Suspect	New
1A-69A	1	4" Ceramic Wall Tile			Cream	125 sf				Non-Suspect	New
1A-70	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
1A-70	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	200 sf		None Detected		09-002	FT-2
1B-24	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
1B-25	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
1B-26	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	450 sf		None Detected		09-006	CT-3
1B-26 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	450 sf		None Detected		09-006	CT-3
1B-26 Corridor	1	12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	300 sf		None Detected		09-011	FT-3
1B-27A	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	75 sf		None Detected		09-002	FT-2
1B-27B	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	75 sf		None Detected		09-010	CT-6
1B-27B	1	2" Ceramic Floor Tile			Gray	75 sf				Non-Suspect	New
1B-27B	1	4" Ceramic Wall Tile			Cream	125 sf				Non-Suspect	New
1B-27C	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-010	CT-6

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-27C	1	Sheet Vinyl Floor			Cream	50 sf				Non-Suspect	New
1B-27C Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	440 sf		None Detected		09-006	CT-3
1B-27C Corridor	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	440 sf		None Detected		09-002	FT-2
1B-28	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	250 sf		None Detected		09-006	CT-3
1B-28	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	250 sf		None Detected		09-002	FT-2
1B-29	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	350 sf		None Detected		09-006	CT-1
1B-29	1	Sheet Vinyl Floor			Cream	350 sf				Non-Suspect	New
1B-29A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
1B-29A	1	Sheet Vinyl Floor			Cream	180 sf				Non-Suspect	New
1B-29B	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	60 sf		None Detected		09-006	CT-1
1B-29B	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	60 sf		None Detected		09-002	FT-2
1B-30	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	350 sf		None Detected		09-006	CT-1
1B-30	1	Sheet Vinyl Floor			Cream	350 sf				Non-Suspect	New
1B-30A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	60 sf		None Detected		09-006	CT-1
1B-30A	1	Sheet Vinyl Floor			Cream	60 sf				Non-Suspect	New
1B-31	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	250 sf		None Detected		09-009	CT-5
1B-31	1	Sheet Vinyl Floor			Cream	250 sf				Non-Suspect	New
1B-31A	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	100 sf		None Detected		09-009	CT-5
1B-31A	1	Sheet Vinyl Floor			Cream	100 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-32	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	25 sf		None Detected		09-009	CT-5
1B-32	1	Sheet Vinyl Floor			Cream	25 sf				Non-Suspect	New
1B-32 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	300 sf		None Detected		09-006	CT-3
1B-32 Corridor	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	300 sf		None Detected		09-002	FT-2
1B-33	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	100 sf		None Detected		09-006	CT-1
1B-33	1	Sheet Vinyl Floor			Cream	100 sf				Non-Suspect	New
1B-34	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	385 sf		None Detected		09-006	CT-3
1B-34	1	Sheet Vinyl Floor			Cream	385 sf				Non-Suspect	New
1B-34A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	85 sf		None Detected		09-006	CT-1
1B-34A	1	2" Ceramic Floor Tile			Gray	85 sf				Non-Suspect	New
1B-34A	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-35	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	385 sf		None Detected		09-006	CT-3
1B-35	1	Sheet Vinyl Floor			Cream	385 sf				Non-Suspect	New
1B-35A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	85 sf		None Detected		09-006	CT-1
1B-35A	1	2" Ceramic Floor Tile			Gray	85 sf				Non-Suspect	New
1B-35A	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-36	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	200 sf		None Detected		09-006	CT-1
1B-36	1	Sheet Vinyl Floor			Cream	200 sf				Non-Suspect	New
1B-37	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	325 sf		None Detected		09-009	CT-5

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-37	1	Sheet Vinyl Floor			Cream	325 sf				Non-Suspect	New
1B-37A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	85 sf		None Detected		09-006	CT-1
1B-37A	1	2" Ceramic Floor Tile			Gray	85 sf				Non-Suspect	New
1B-37A	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-38	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
1B-38	1	Sheet Vinyl Floor			Cream	150 sf				Non-Suspect	New
1B-39	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	235 sf		None Detected		09-006	CT-3
1B-41	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
1B-42	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
1B-44	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	175 sf		None Detected		09-009	CT-5
1B-45	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	150 sf		None Detected		09-009	CT-5
1B-45	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
1B-45A	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	100 sf		None Detected		09-009	CT-5
1B-45A	1	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
1B-45A	1	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
1B-47	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	150 sf		None Detected		09-009	CT-5
1B-47	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
1B-47A	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	100 sf		None Detected		09-009	CT-5
1B-47A	1	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-47A	1	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
1B-48	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	150 sf		None Detected		09-009	CT-5
1B-50	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	150 sf		None Detected		09-009	CT-5
1B-52	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	150 sf		None Detected		09-009	CT-5
1B-54	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	150 sf		None Detected		09-009	CT-5
1B-55	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	50 sf		None Detected		09-009	CT-5
1B-55	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
1B-60	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	385 sf		None Detected		09-006	CT-1
1B-60	1	Sheet Vinyl Floor			Cream	385 sf				Non-Suspect	New
1B-61	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
1B-61	1	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
1B-61	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-62	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	385 sf		None Detected		09-006	CT-1
1B-62	1	Sheet Vinyl Floor			Cream	385 sf				Non-Suspect	New
1B-63	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	200 sf		None Detected		09-010	CT-6
1B-63	1	Sheet Vinyl Floor			Cream	200 sf				Non-Suspect	New
1B-64	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
1B-64	1	Sheet Vinyl Floor			Cream	180 sf				Non-Suspect	New
1B-65	1	Need Access									

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-65 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	300 sf		None Detected		09-006	CT-3
1B-65 Corridor	1	12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	300 sf		None Detected		09-011	FT-3
1B-66	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	385 sf		None Detected		09-010	CT-6
1B-66	1	Sheet Vinyl Floor			Cream	385 sf				Non-Suspect	New
1B-67	1	Need Access									
1B-68	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
1B-68	1	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
1B-68	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-69	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
1B-70	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
1B-70		12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	180 sf		None Detected		09-011	FT-3
1B-70 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	500 sf		None Detected		09-006	CT-3
1B-70 Corridor	1	12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	500 sf		None Detected		09-011	FT-3
1B-71	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
1B-71	1	12" x 12" Floor Tile and Mastic	FT-1	12"x12"	Gray/Brown/White	180 sf		3% Chrysotile (FT)	Non-Friable	09-001	FT-1
1B-71A	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	80 sf		None Detected		09-006	CT-1
1B-71A	1	2" Ceramic Floor Tile			Gray	80 sf				Non-Suspect	New
1B-71A	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-72	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	150 sf		None Detected		09-010	CT-6

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-72	1	Sheet Vinyl Floor			Cream	150 sf				Non-Suspect	New
1B-73	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	300 sf		None Detected		09-006	CT-3
1B-73	1	12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	300 sf		None Detected		09-011	FT-3
1B-74	1	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
1B-74	1	12" x 12" Floor Tile and Mastic	FT-1	12"x12"	Gray/Brown/White	180 sf		3% Chrysotile (FT)	Non-Friable	09-001	FT-1
1B-75	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
1B-77 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	450 sf		None Detected		09-006	CT-3
1B-77 Corridor	1	12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	450 sf		None Detected		09-011	FT-3
1B-78	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
1B-78	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	200 sf		None Detected		09-002	FT-2
1B-78 Corridor	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
1B-78 Corridor	1	12" x 12" Floor Tile and Mastic	FT-3	12"x12"	White w/Black Specks	200 sf		None Detected		09-011	FT-3
1B-79	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	250 sf		None Detected		09-010	CT-6
1B-79	1	Sheet Vinyl Floor			Cream	250 sf				Non-Suspect	New
1B-79A	1	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	125 sf		None Detected		09-009	CT-5
1B-79A	1	2" Ceramic Floor Tile			Gray	125 sf				Non-Suspect	New
1B-79A	1	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
1B-80	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	500 sf		None Detected		09-010	CT-6
1B-80	1	Sheet Vinyl Floor			Cream	500 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-80A	1	Sheet Vinyl Floor			Cream	100 sf				Non-Suspect	New
1B-80B	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	125 sf		None Detected		09-010	CT-6
1B-80B	1	Sheet Vinyl Floor			Cream	125 sf				Non-Suspect	New
1B-80C	1	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	100 sf		None Detected		09-010	CT-6
1B-80C	1	Sheet Vinyl Floor			Cream	100 sf				Non-Suspect	New
1B-90	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	355 sf		None Detected		09-006	CT-3
1B-90	1	Sheet Vinyl Floor			Cream	355 sf				Non-Suspect	New
1B-90A	1	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
1B-90A	1	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
1B-90A	1	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
1B-90B	1	Sheet Vinyl Floor			Cream	150 sf				Non-Suspect	New
1B-90F	1	Sheet Vinyl Floor			Cream	250 sf				Non-Suspect	New
2A-03	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
2A-03	2	Thermal System Insulation			Gray	32 lf	Good	Assumed	Friable	Assumed	In Chase
2A-03 Corridor	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	1,500 sf		None Detected		09-006	CT-3
2A-03 Corridor	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	1,500 sf		None Detected		09-002	FT-2
2A-05	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	230 sf		None Detected		09-006	CT-3
2A-05	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-05A	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2A-07	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	180 sf		None Detected		09-006	CT-3
2A-07	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-09	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	180 sf		None Detected		09-006	CT-3
2A-09	2	Thermal System Insulation			Gray	32 lf	Good	Assumed	Friable	Assumed	In Chase
2A-13	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
2A-13	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-13A	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	100 sf		None Detected		09-006	CT-1
2A-13A	2	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
2A-13A	2	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
2A-19	2	No Suspect Material									
2A-22	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
2A-22	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-22A	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
2A-22A	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-24	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
2A-24	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
2A-24	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-26	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	165 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2A-28	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	165 sf		None Detected		09-006	CT-3
2A-28	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-29	2	Transite Panel/Pucks			Black	60 lf	Good	Assumed		Assumed	(6) Register Cabinets
2A-29		Thermal System Insulation			Gray	16 lf	POOR	Assumed	Friable	Assumed	In Wall/Open End
2A-29 Corridor	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	750 sf		None Detected		09-009	CT-5
2A-29 Corridor	2	12" x 12" Floor Tile and Mastic	FT-4	12"x12"	White w/Gold	750 sf		4% Chrysotile (FT)/10% Chrysotile (Mastic)	Non-Friable	09-012	FT-4
2A-30	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	165 sf		None Detected		09-006	CT-1
2A-30	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-32	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	165 sf		None Detected		09-006	CT-1
2A-32	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-34	2	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	165 sf		None Detected		09-013	CT-7
2A-34	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-36	2	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	100 sf		None Detected		09-013	CT-7
2A-36	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-38	2	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	165 sf		None Detected		09-013	CT-7
2A-40	2	No Suspect Material									
2A-40 Corridor	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	500 sf		None Detected		09-009	CT-5
2A-40 Corridor	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	500 sf		None Detected		09-002	FT-2

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2A-42	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	130 sf		None Detected		09-009	CT-5
2A-42	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-42	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
2A-43	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	130 sf		None Detected		09-009	CT-5
2A-43	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-43	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
2A-45	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	130 sf		None Detected		09-009	CT-5
2A-45	2	Thermal System Insulation			Gray	16 lf	POOR	Assumed	Friable	Assumed	In Chase/Open End
2A-45	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
2A-46	2	Transite Panel/Pucks			Black	20 lf	Good	Assumed		Assumed	(2) Register Cabinets
2A-46	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	250 sf		None Detected		09-009	CT-5
2A-46	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-47	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
2A-47	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	250 sf		None Detected		09-009	CT-5
2A-47	2	Thermal System Insulation			Gray	32 lf	POOR	Assumed	Friable	Assumed	In Chase/Open End
2A-48	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
2A-48	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
2A-48	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2A-50	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
2A-50	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	195 sf		None Detected		09-009	CT-5
2A-51	2	No Suspect Material									
2A-52	2	Transite Panel/Pucks			Black	20 lf	Good	Assumed		Assumed	(2) Register Cabinets
2A-52	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	350 sf		None Detected		09-006	CT-3
2A-52	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-52 Corridor	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	750 sf		None Detected		09-009	CT-5
2A-52 Corridor	2	12" x 12" Floor Tile and Mastic	FT-4	12"x12"	White w/Gold	750 sf		4% Chrysotile (FT)/10% Chrysotile (Mastic)	Non-Friable	09-012	FT-4
2A-56	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
2A-56	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2
2A-56	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-56	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
2A-57	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
2A-57	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-58	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
2A-58	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
2A-60	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	100 sf		None Detected		09-009	CT-5
2A-60	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2A-60	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-60	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
2A-61	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	300 sf		None Detected		09-006	CT-1
2A-61	2	2" Ceramic Floor Tile			Gray	300 sf				Non-Suspect	New
2A-61	2	4" Ceramic Wall Tile			Cream	500 sf				Non-Suspect	New
2A-62	2	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	130 sf		None Detected		09-009	CT-5
2A-62	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
2A-64	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	130 sf		None Detected		09-006	CT-1
2A-64	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-64	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
2A-65	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	300 sf		None Detected		09-006	CT-1
2A-65	2	2" Ceramic Floor Tile			Gray	300 sf				Non-Suspect	New
2A-65	2	4" Ceramic Wall Tile			Cream	500 sf				Non-Suspect	New
2A-66	2	Transite Panel/Pucks			Black	20 lf	Good	Assumed	Non-Friable	Assumed	(2) Register Cabinets
2A-66	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	300 sf		None Detected		09-006	CT-1
2A-66	2	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
2A-70	2	Need Access									
2B-22	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	550 sf		None Detected		09-006	CT-3
2B-22	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	550 sf		None Detected		09-002	FT-2

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-25	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	700 sf		None Detected		09-006	CT-3
2B-25	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	700 sf		None Detected		09-002	FT-2
2B-26	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	165 sf		None Detected		09-006	CT-3
2B-26	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	165 sf		None Detected		09-002	FT-2
2B-27	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	165 sf		None Detected		09-006	CT-3
2B-27	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	165 sf		None Detected		09-002	FT-2
2B-28	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
2B-28	2	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
2B-28	2	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
2B-29	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
2B-29	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
2B-31	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
2B-31	2	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
2B-31	2	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
2B-32	2	No Suspect Material									
2B-34	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
2B-34	2	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
2B-34	2	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
2B-35	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	165 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-35	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	165 sf		None Detected		09-002	FT-2
2B-37	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	110 sf		None Detected		09-006	CT-3
2B-37	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	110 sf		None Detected		09-002	FT-2
2B-39	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	110 sf		None Detected		09-006	CT-3
2B-39	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	110 sf		None Detected		09-002	FT-2
2B-40	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	110 sf		None Detected		09-006	CT-3
2B-40	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	110 sf		None Detected		09-002	FT-2
2B-42	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	80 sf		None Detected		09-002	FT-2
2B-44	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	200 sf		None Detected		09-006	CT-1
2B-44	2	Sheet Vinyl Floor			Cream	200 sf				Non-Suspect	New
2B-44A	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
2B-44A	2	Sheet Vinyl Floor			Cream	150 sf				Non-Suspect	New
2B-45	2	Epoxy Floor								Non-Suspect	New
2B-45A	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	60 sf		None Detected		09-005	CT-2
2B-45A	2	Epoxy Floor								Non-Suspect	New
2B-45B	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	60 sf		None Detected		09-005	CT-2
2B-45B	2	Epoxy Floor								Non-Suspect	New
2B-46	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
2B-46	2	Sheet Vinyl Floor			Cream	150 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-47	2	Epoxy Floor								Non-Suspect	New
2B-48	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	300 sf		None Detected		09-005	CT-2
2B-48	2	Sheet Vinyl Floor			Cream	300 sf				Non-Suspect	New
2B-49	2	Epoxy Floor								Non-Suspect	New
2B-49A	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	50 sf		None Detected		09-005	CT-2
2B-49A	2	Epoxy Floor								Non-Suspect	New
2B-50	2	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	1,200 sf		None Detected		09-010	CT-6
2B-50	2	Sheet Vinyl Floor			Cream	1, 200 sf				Non-Suspect	New
2B-51	2	Epoxy Floor								Non-Suspect	New
2B-51A	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	110 sf		None Detected		09-005	CT-2
2B-51A	2	Epoxy Floor								Non-Suspect	New
2B-53	2	2' x 4' Ceiling Tile	CT-2	2'x4'	Vinyl Covered Sheetrock Look	300 sf		None Detected		09-005	CT-2
2B-53	2	Sheet Vinyl Floor			Cream	300 sf				Non-Suspect	New
2B-55	2	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	750 sf		None Detected		09-010	CT-6
2B-55	2	Sheet Vinyl Floor			Cream	750 sf				Non-Suspect	New
2B-55A	2	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	110 sf		None Detected		09-010	CT-6
2B-55A	2	Epoxy Floor								Non-Suspect	New
2B-55B	2	2' x 2' Ceiling Tile	CT-6	2'x2'	Vinyl Covered Sheetrock Look	110 sf		None Detected		09-010	CT-6
2B-55B	2	Epoxy Floor								Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-56	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	365 sf		None Detected		09-006	CT-1
2B-56	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	365 sf		None Detected		09-002	FT-2
2B-60	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	300 sf		None Detected		09-006	CT-3
2B-60	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	300 sf		None Detected		09-002	FT-2
2B-63	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	250 sf		None Detected		09-006	CT-3
2B-64	2	No Suspect Material									
2B-65	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	150 sf		None Detected		09-006	CT-1
2B-65	2	12" x 12" Floor Tile and Mastic		12"x12"	Gray	150 sf				Non-Suspect	New
2B-66	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-66	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-67	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-67	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-68	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-68	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-69	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-69	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-70	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-70	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-71	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-71	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-72	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-72	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-73	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-73	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-74	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-74	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-75	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-75	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-76	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-76	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-77	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-77	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-78	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-78	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-79	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	50 sf		None Detected		09-006	CT-1
2B-79	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
2B-80	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	30 sf		None Detected		09-006	CT-1
2B-80	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	30 sf		None Detected		09-002	FT-2

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-82	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	30 sf		None Detected		09-006	CT-1
2B-82	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	30 sf		None Detected		09-002	FT-2
2B-83	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	30 sf		None Detected		09-006	CT-1
2B-83	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	30 sf		None Detected		09-002	FT-2
2B-84	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	120 sf		None Detected		09-006	CT-1
2B-84	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-85	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	30 sf		None Detected		09-006	CT-1
2B-85	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	30 sf		None Detected		09-002	FT-2
2B-86	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
2B-86	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
2B-86	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
2B-86A	2	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	30 sf		None Detected		09-006	CT-1
2B-86A	2	2" Ceramic Floor Tile			Gray	30 sf				Non-Suspect	New
2B-86A	2	4" Ceramic Wall Tile			Cream	80 sf				Non-Suspect	New
2B-86B	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	30 sf		None Detected		09-006	CT-3
2B-86B	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	30 sf		None Detected		09-002	FT-2
2B-87	2	No Suspect Material									
2B-88	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
2B-89	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-90	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
2B-90 Corridor	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	250 sf		None Detected		09-006	CT-3
2B-90 Corridor	2	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	250 sf		None Detected		09-002	FT-2
2B-95	2	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	350 sf		None Detected		09-006	CT-3
3A-03	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3A-03	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-03 Corridor	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	600 sf		None Detected		09-006	CT-3
3A-03 Corridor	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	600 sf		None Detected		09-002	FT-2
3A-05	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	75 sf		None Detected		09-006	CT-3
3A-05	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	75 sf		None Detected		09-002	FT-2
3A-07	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3A-07	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3A-07	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-09	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
3A-09	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
3A-09	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-09A	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	80 sf		None Detected		09-006	CT-3
3A-11	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
3A-11	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3A-11	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-13	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
3A-13	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
3A-13	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
3A-13	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-14	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
3A-14	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
3A-14	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-15	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
3A-15	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-17	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3A-17	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3A-17	3	Thermal System Insulation			Gray	32 lf	Good	Assumed	Friable	Assumed	In Chase
3A-17	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
3A-19	3	No Suspect Material									
3A-20	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
3A-22	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3A-22	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3A-22 Corridor	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	700 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3A-22 Corridor	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	700 sf		None Detected		09-002	FT-2
3A-22A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-22A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-23	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3A-24	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3A-24	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3A-24A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-24A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-25	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
3A-25	3	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
3A-25	3	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
3A-27	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	200 sf		None Detected		09-006	CT-1
3A-28	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3A-28	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3A-28A	3	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
3A-28A	3	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New
3A-29	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	200 sf		None Detected		09-006	CT-1
3A-31	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	100 sf		None Detected		09-006	CT-1
3A-31	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3A-31	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-32	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3A-32	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3A-32A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-32A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-33	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3A-33	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3A-35	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	100 sf		None Detected		09-006	CT-1
3A-35	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2
3A-37	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	100 sf		None Detected		09-006	CT-1
3A-37	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2
3A-37A	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
3A-40	3	No Suspect Material									
3A-40A	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	50 sf		None Detected		09-006	CT-1
3A-40A	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
3A-42	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-42	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-42A	3	2" Ceramic Floor Tile			Gray	50 sf				Non-Suspect	New
3A-42A	3	4" Ceramic Wall Tile			Cream	100 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3A-43	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
3A-43	3	12" x 12" Floor Tile and Mastic	FT-2 (Multiple Layers)	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2 (Multiple Layers)
3A-43A	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	40 sf		None Detected		09-006	CT-3
3A-43A	3	2" Ceramic Floor Tile			Gray	40 sf				Non-Suspect	New
3A-43A	3	4" Ceramic Wall Tile			Cream	80 sf				Non-Suspect	New
3A-46	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-46	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-46A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-46A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-47	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-47	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-48	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-48	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-48A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-48A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-50	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
3A-50	3	2" Ceramic Floor Tile			Gray	115 sf				Non-Suspect	New
3A-50	3	4" Ceramic Wall Tile			Cream	165 sf				Non-Suspect	New
3A-51	3	No Suspect Material									

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3A-52	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
3A-52	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-52 Corridor	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	650 sf		None Detected		09-006	CT-3
3A-52 Corridor	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	650 sf		None Detected		09-002	FT-2
3A-52A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-52A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-55	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	250 sf		None Detected		09-006	CT-3
3A-56	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-56	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-56A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-56A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-57	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-57	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-57A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-57A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-58	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-58	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-58A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-58A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3A-59	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-59	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-59A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-59A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-60	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	140 sf		None Detected		09-006	CT-3
3A-60	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-60A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-60A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-61	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	140 sf		None Detected		09-006	CT-1
3A-61	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	140 sf		None Detected		09-002	FT-2
3A-61A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3A-61A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3A-65	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
3A-65	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	180 sf		None Detected		09-002	FT-2
3B-02	3	Thermal System Insulation			Gray	32 lf	Good	Assumed	Friable	Assumed	Above Ceiling
3B-02	3	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	150 sf		None Detected		09-013	CT-7
3B-02	3	2" Ceramic Floor Tile			Gray	150 sf				Non-Suspect	New
3B-02	3	4" Ceramic Wall Tile			Cream	200 sf				Non-Suspect	New
3B-06	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	180 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3B-06	3	12" x 12" Floor Tile and Mastic	FT-4	12"x12"	White w/Gold	180 sf		4% Chrysotile (FT)/10% Chrysotile (Mastic)	Non-Friable	09-012	FT-4
3B-06	3	12" Transite Pipe		12"	Gray	10 lf	Good	Assumed	Non-Friable	Assumed	In wall
3B-06A	3	2" Ceramic Floor Tile			Gray	40 sf				Non-Suspect	New
3B-06A	3	4" Ceramic Wall Tile			Cream	80 sf				Non-Suspect	New
3B-08	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
3B-08	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	145 sf		None Detected		09-002	FT-2
3B-10	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
3B-10	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	120 sf		None Detected		09-002	FT-2
3B-10	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
3B-12	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	220 sf		None Detected		09-006	CT-3
3B-12	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	220 sf		None Detected		09-002	FT-2
3B-12	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
3B-16	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
3B-16	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	180 sf		None Detected		09-002	FT-2
3B-22	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3B-22	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3B-22A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-22A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3B-23	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2
3B-25	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
3B-26	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3B-26	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3B-26A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-26A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-27	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
3B-28	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3B-28	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2
3B-28A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-28A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-29	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
3B-31	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	100 sf		None Detected		09-006	CT-1
3B-31	3	1" Ceramic Floor Tile		1"	Gray	100 sf				Non-Suspect	New
3B-31	3	4" Ceramic Wall Tile			White	150 sf				Non-Suspect	New
3B-33	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-33	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-34	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	215 sf		None Detected		09-006	CT-1
3B-34	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	215 sf		None Detected		09-002	FT-2

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3B-34A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-34A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-35	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	40 sf		None Detected		09-006	CT-3
3B-35	3	2" Ceramic Floor Tile			Gray	40 sf				Non-Suspect	New
3B-35	3	4" Ceramic Wall Tile			Cream	80 sf				Non-Suspect	New
3B-37	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	40 sf		None Detected		09-006	CT-3
3B-37	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	40 sf		None Detected		09-002	FT-2
3B-39	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	50 sf		None Detected		09-006	CT-3
3B-39	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	50 sf		None Detected		09-002	FT-2
3B-39A	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	40 sf		None Detected		09-006	CT-3
3B-39A	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	40 sf		None Detected		09-002	FT-2
3B-45	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
3B-45	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	180 sf		None Detected		09-002	FT-2
3B-45 Corridor	3	2' x 2' Ceiling Tile	CT-5	2'x2'	Random Fissures	700 sf		None Detected		09-009	CT-5
3B-45 Corridor	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	700 sf		None Detected		09-002	FT-2
3B-47	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-47	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-47A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-47A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3B-48	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-48	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-48A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-48A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-49	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-49	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-49A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-49A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-50	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-50	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-50A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-50A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-51	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-51	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-51A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-51A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-52	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-52	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-52A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3B-52A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-54	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
3B-54	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	150 sf		None Detected		09-002	FT-2
3B-54A	3	2" Ceramic Floor Tile			Gray	100 sf				Non-Suspect	New
3B-54A	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-55	3	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	250 sf		None Detected		09-006	CT-3
3B-56	3	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
3B-56	3	2" Ceramic Floor Tile			Gray	115 sf				Non-Suspect	New
3B-56	3	4" Ceramic Wall Tile			Cream	150 sf				Non-Suspect	New
3B-62	3	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	210 sf		None Detected		09-013	CT-7
3B-62	3	12" x 12" Floor Tile and Mastic	FT-2 (Under Carpet)	12"x12"	Tan w/Brown and White Specks	210 sf		None Detected		09-002	FT-2 (Under Carpet)
3B-64	3	2" Ceramic Floor Tile		2"	Gray	120 sf				Non-Suspect	New
3B-64	3	4" Ceramic Wall Tile		4"	Cream	180 sf				Non-Suspect	New
3B-64	3	2' x 4' Ceiling Tile		2'x4'	Vinyl Covered Sheetrock Look	120 sf		None Detected		09-005	
3B-72	3	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	120 sf		None Detected		09-013	CT-7
3B-73	3	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	250 sf		None Detected		09-013	CT-7
3B-74	3	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	250 sf		None Detected		09-013	CT-7
3B-74	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	250 sf		None Detected		09-002	FT-2
3C-40B	3	2' x 4' Ceiling Tile	CT-7	2'x4'	Random Fissures	120 sf		None Detected		09-013	CT-7

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-40B	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Chase
4A-01	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
4A-03	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
4A-05	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
4A-05	4	2" Ceramic Floor Tile		2"	Gray	180 sf				Non-Suspect	New
4A-05	4	4" Ceramic Wall Tile		4"	Cream	225 sf				Non-Suspect	New
4A-07	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	180 sf		None Detected		09-006	CT-1
4A-07	4	2" Ceramic Floor Tile		2"	Gray	180 sf				Non-Suspect	New
4A-07	4	4" Ceramic Wall Tile		4"	Cream	225 sf				Non-Suspect	New
4A-15	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	420 sf		None Detected		09-006	CT-3
4A-16	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
4A-17	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
4A-17	4	4" Ceramic Wall Tile		4"	Cream	180 sf				Non-Suspect	New
4A-19	4	No Suspect Material									
4A-20	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
4A-20	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-22	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-22	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-22 Corridor	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	875 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4A-22 Corridor	4	12" x 12" Floor Tile and Mastic	FT-5	12"x12"	White w/Gray Streaks	875 sf		None Detected		09-014	FT-5
4A-23	4	Transite Panel/Pucks			Black	30 lf	Good	Assumed	Non-Friable	Assumed	(3) Register Cabinets
4A-23	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	315 sf		None Detected		09-006	CT-3
4A-23A	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	20 sf		None Detected		09-006	CT-3
4A-24	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-24	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-26	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-26	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-27	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-27	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-28	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-28	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	145 sf		None Detected		09-002	FT-2
4A-28	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-29	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-29	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-30	4	Transite Panel/Pucks			Black	20 lf	Good	Assumed	Non-Friable	Assumed	(2) Register Cabinets
4A-30	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
4A-31	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-31	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4A-32	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-32	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-33	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-34	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	145 sf		None Detected		09-006	CT-3
4A-34	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-35	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	115 sf		None Detected		09-006	CT-3
4A-35	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-36	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	115 sf		None Detected		09-006	CT-3
4A-38	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	80 sf		None Detected		09-006	CT-3
4A-38	4	2" Ceramic Floor Tile		2"	Gray	80 sf				Non-Suspect	New
4A-38	4	4" Ceramic Wall Tile		4"	Gray	120 sf				Non-Suspect	New
4A-40	4	No Suspect Material									
4A-42	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
4A-42	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-42 Corridor	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	875 sf		None Detected		09-006	CT-3
4A-42 Corridor	4	12" x 12" Floor Tile and Mastic	FT-5	12"x12"	White w/Gray Streaks	875 sf		None Detected		09-014	FT-5
4A-43	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-43	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-44	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4A-44	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-45	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
4A-45	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-46	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
4A-46	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-47	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-47	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-48	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	120 sf		None Detected		09-006	CT-3
4A-48	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-50	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
4A-50	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-51	4	No Suspect Material									
4A-52	4	No Access									
4A-53	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
4A-53	4	2" Ceramic Floor Tile		2"	Gray	100 sf				Non-Suspect	New
4A-53	4	4" Ceramic Wall Tile		4"	Gray	150 sf				Non-Suspect	New
4A-54	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	220 sf		None Detected		09-006	CT-3
4A-54	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-55	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4A-55	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-56	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-56	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-57	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-57	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-58	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-58	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-59	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-59	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-60	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-60	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-61	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-61	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-62	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-62	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-63	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-63	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-64	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-64	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4A-67	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-67	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-68	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	150 sf		None Detected		09-006	CT-3
4A-68	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4A-70	4	No Access									
4B-02	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
4B-04	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
4B-06	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
4B-10	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	115 sf		None Detected		09-006	CT-3
4B-12	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	130 sf		None Detected		09-006	CT-1
4B-14	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	115 sf		None Detected		09-006	CT-1
4B-16	4	2' x 4' Ceiling Tile	CT-1	2'x4'	Widthwise Fissures	200 sf		None Detected		09-006	CT-1
4B-19	4	Occupied									
4B-20	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	300 sf		None Detected		09-006	CT-3
4B-23	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	125 sf		None Detected		09-006	CT-3
4B-23	4	12" x 12" Floor Tile and Mastic	FT-2 (Under Carpet)	12"x12"	Tan w/Brown and White Specks	125 sf		None Detected		09-002	FT-2 (Under Carpet)
4B-23 Corridor	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	430 sf		None Detected		09-006	CT-3
4B-23 Corridor	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	430 sf		None Detected		09-002	FT-2
4B-24	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	125 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4B-24	4	12" x 12" Floor Tile and Mastic	FT-2 (Under Carpet)	12"x12"	Tan w/Brown and White Specks	125 sf		None Detected		09-002	FT-2 (Under Carpet)
4B-26	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	125 sf		None Detected		09-006	CT-3
4B-26	4	12" x 12" Floor Tile and Mastic	FT-2 (Under Carpet)	12"x12"	Tan w/Brown and White Specks	125 sf		None Detected		09-002	FT-2 (Under Carpet)
4B-36	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	200 sf		None Detected		09-006	CT-3
4B-36	4	12" x 12" Floor Tile and Mastic	FT-2 (Under Carpet)	12"x12"	Tan w/Brown and White Specks	200 sf		None Detected		09-002	FT-2 (Under Carpet)
4B-40	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	130 sf		None Detected		09-002	FT-2
4B-42	4	Sheet Vinyl Floor			Cream	100 sf				Non-Suspect	New
4B-42	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-43	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
4B-43	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-44	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
4B-44	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-45	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
4B-45	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-46	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
4B-46	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-47	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	100 sf		None Detected		09-006	CT-3
4B-47	4	Sheet Vinyl Floor			Cream	100 sf				Non-Suspect	New
4B-48	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4B-48	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-49	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
4B-49	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
4B-50	4	2" Ceramic Floor Tile		2"	Gray	100 sf				Non-Suspect	New
4B-50	4	4" Ceramic Wall Tile		4"	Cream	150 sf				Non-Suspect	New
4B-55	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	75 sf		None Detected		09-006	CT-3
4B-55A	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	115 sf		None Detected		09-006	CT-3
4B-57	4	Sheet Vinyl Floor			Gray Mosaic	130 sf				Non-Suspect	New
4B-57A	4	Epoxy Floor			Gray	45 sf				Non-Suspect	New
4B-58	4	Sheet Vinyl Floor			Gray Mosaic	130 sf				Non-Suspect	New
4B-58 Corridor	4	Sheet Vinyl Floor			Gray Mosaic	400 sf				Non-Suspect	New
4B-58A	4	Epoxy Floor			Gray	45 sf				Non-Suspect	New
4B-59	4	Sheet Vinyl Floor			Gray Mosaic	130 sf				Non-Suspect	New
4B-59A	4	Epoxy Floor			Gray	45 sf				Non-Suspect	New
4B-60	4	Sheet Vinyl Floor			Gray Mosaic	130 sf				Non-Suspect	New
4B-60A	4	Epoxy Floor			Gray	45 sf				Non-Suspect	New
4B-62	4	Sheet Vinyl Floor			Gray Mosaic	100 sf				Non-Suspect	New
4B-63	4	Sheet Vinyl Floor			Gray Mosaic	130 sf				Non-Suspect	New
4B-63A	4	Epoxy Floor			Gray	45 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4B-64	4	No Suspect Materials									
4B-64A	4	No Suspect Materials									
4B-65	4	Sheet Vinyl Floor			Gray Mosaic	220 sf				Non-Suspect	New
4B-66	4	Sheet Vinyl Floor			Gray Mosaic	50 sf				Non-Suspect	New
4B-67	4	Sheet Vinyl Floor			Gray Mosaic	50 sf				Non-Suspect	New
4B-70	4	Transite Panel/Pucks			Black	20 lf	Good	Assumed	Non-Friable	Assumed	(2) Register Cabinets
4B-70	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	400 sf		None Detected		09-006	CT-3
4B-70A	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	25 sf		None Detected		09-006	CT-3
4B-70A	4	2" Ceramic Floor Tile		2"	Gray	25 sf				Non-Suspect	New
4B-70A	4	4" Ceramic Wall Tile		4"	Cream	50 sf				Non-Suspect	New
4B-70B	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	130 sf		None Detected		09-006	CT-3
4B-70B	4	Sheet Vinyl Floor			Gray Mosaic	130 sf				Non-Suspect	New
4B-71	4	No Suspect Materials									
4B-72	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	130 sf		None Detected		09-002	FT-2
4B-72A	4	Epoxy Floor			Gray	25 sf				Non-Suspect	New
4B-73	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	130 sf		None Detected		09-002	FT-2
4B-73A	4	Epoxy Floor			Gray	25 sf				Non-Suspect	New
4B-74	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	130 sf		None Detected		09-002	FT-2
4B-74A	4	Epoxy Floor			Gray	25 sf				Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4B-75	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	130 sf		None Detected		09-002	FT-2
4B-75 Corridor	4	2' x 2' Ceiling Tile	CT-3	2'x2'	Long Fissures w/Pinholes	400 sf		None Detected		09-006	CT-3
4B-75 Corridor	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	400 sf		None Detected		09-002	FT-2
4B-75A	4	Epoxy Floor			Gray	25 sf				Non-Suspect	New
4B-76	4	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	130 sf		None Detected		09-002	FT-2
4B-76A	4	Epoxy Floor			Gray	25 sf				Non-Suspect	New
Stairwell #9	1	Thermal System Insulation			Gray	10 lf	Good	Assumed	Friable	Assumed	In Wall
Stairwell #9	2	Thermal System Insulation			Gray	10 lf	Good	Assumed	Friable	Assumed	In Wall
Stairwell #9	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Wall
Stairwell #9	1	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
Stairwell #9	2	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
Stairwell #9	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
Stairwell #9	4	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
Stairwell #10	1	Thermal System Insulation			Gray	10 lf	Good	Assumed	Friable	Assumed	In Wall
Stairwell #10	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	In Wall
Stairwell #10	1	Transite Panel/Pucks			Black	10 lf	Good	Assumed		Assumed	Register Cabinet
Stairwell #10	3	Transite Panel/Pucks			Black	10 lf	Good	Assumed	Non-Friable	Assumed	Register Cabinet
Stairwell #13	1	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2
Stairwell #13	3	12" x 12" Floor Tile and Mastic	FT-2	12"x12"	Tan w/Brown and White Specks	100 sf		None Detected		09-002	FT-2

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 9

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
Stairwell #14	2	Sheet Vinyl Floor			Cream	200 sf				Non-Suspect	New
Stairwell #14	3	Sheet Vinyl Floor			Cream	120 sf				Non-Suspect	New
Stairwell #14	4	Sheet Vinyl Floor			Cream	120 sf				Non-Suspect	New
Stairwell #15	3	Thermal System Insulation			Gray	16 lf	Good	Assumed	Friable	Assumed	Above Hatch

4.2 – Additional Observations

No additional observations were noted.

4.3 – Cost Estimate for Asbestos Abatement

Material	Sample Reference	Location	Low Price Per sq/ln ft	High Price per ln/sq ft	Total Square/Linear Feet of ACM	Low End Removal Cost	High End Removal Cost
12"x12" Floor Tile and Mastic	09-001	BA-65 Renovation Area; 1B-71; 1B-74	\$7.00	\$9.00	635	\$4,445.00	\$5,715.00
12"x12" Floor Tile and Mastic	09-012	2A-29 Corridor, 2A-52 Corridor, 3B-06	\$7.00	\$9.00	1680	\$11,760.00	\$15,120.00
Transite Panels/Pucks	Assumed	Throughout	\$12.00	\$19.00	840	\$10,080.00	\$15,960.00
Thermal System Insulation	Assumed	Throughout	\$12.00	\$19.00	1066	\$12,792.00	\$20,254.00
12" Transite Pipe	Assumed	3B-06	\$12.00	\$19.00	10	\$120.00	\$190.00

5.0 – RECOMMENDATIONS

5.1 – Recommendations for Regulated ACM (RACM)

Thermal System Insulation (TSI):

If present, these materials must be removed prior to any activity that would release asbestos fibers from this material. Specifically, any renovation or demolition activity that will crush, abrade, or dissolve the matrix of this material must be performed by a North Dakota licensed Asbestos Contractor. If these materials are in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

5.2 – Recommendations for Category I Non-Friable ACM (C1NF)

Floor Tile and Floor Tile Mastic:

If present, these materials identified as Category I Non-Friable ACM are required to be removed by a North Dakota licensed asbestos contractor if proposed renovations or demolition will impact these materials in such a manner as to render them friable and thus RACM. Specifically, any renovation or demolition activity that will crush, abrade, or dissolve the matrix of these materials then they must first be removed by a North Dakota-licensed Asbestos Contractor. If these materials are in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

5.3 – Recommendations for Category II Non-Friable ACM (C2NF)

Transite™ Panels and Transite™ Panel Pucks

If present, these materials identified as Category II Non-friable ACM must be removed prior to any renovation or demolition activity that will crush, abrade, or dissolve the matrix of this material. The removal of this material must be performed by a North Dakota licensed Asbestos Contractor. If this material is in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

5.4 – General Recommendations

Based on the asbestos survey and sampling results, TRINE has the following recommendations:

- Each type of asbestos that will need to be removed as part of any renovation or demolition project in North Dakota are required to be removed, handled, and disposed of as ACM waste by a licensed North Dakota asbestos abatement contractor regardless if the material is a RACM, C1NF, or C2NF in accordance with the North Dakota Department of Environmental Quality (DEQ).
- The VA employ an independent industrial hygienist (VPIH/CPIH) consultant and/or use its own IH to perform various services of the VA. The VPIH/CPIH will perform the necessary monitoring, inspection, testing, and other support services to ensure that VA patients, employees, and visitors will not be adversely affected by the abatement work in accordance with ***Veterans Administration (VA), Section 02 82 11, Traditional Asbestos Abatement***
- TRINE recommends final air testing in addition to final visual inspection of abatement areas prior to deregulation of contained work areas.
- Suspect materials discovered after this inspection should be sampled and analyzed to determine asbestos content and to initiate appropriate responses.


North Dakota DEQ and the US Environmental Protection Agency require notification of intent to renovate or demolish when asbestos is present. Notification must be sent at least 10 working days prior to the start of any construction activities. The general contractor should also keep a copy of this survey at the construction site during the entire construction project as proof of compliance with 40 CFR 61 (NESHAP).

6.0 – SIGNATURE PAGE

Submitted by:



John R Rogers
President
Asbestos Building Inspector (NY) 16-11678

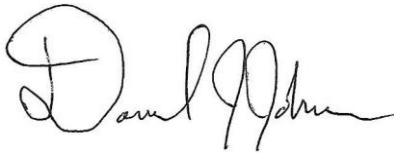

Dan Johnson
Asbestos Building Inspector (ND) 6804

APPENDIX A – LABORATORY CERTIFICATE OF ANALYSIS

NOTE: Results for the above referenced samples are located on page 65 beginning with sample # 09-001

**EMSL Analytical, Inc.**

3410 Winnetka Avenue North New Hope, MN 55427

Tel/Fax: (763) 449-4922 / (763) 449-4924

<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203398

Customer ID: TREV42

Customer PO:

Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
01-057G-Skim Coat only 352203398-0024	BE-38 - Hard-Lid Plaster Ceiling (white/gray)	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
01-058 352203398-0025	BE-46 - Fire stop (red)	Red Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
09-001-Floor Tile 352203398-0026	BA-65 - 12"x12" Floor tile (Gray/Brown/white)	Tan Non-Fibrous Heterogeneous		97% Non-fibrous (Other)	3% Chrysotile
09-001-Tan Mastic 352203398-0026A	BA-65 - 12"x12" Floor tile (Gray/Brown/white)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-001-Black Mastic 352203398-0026B	BA-65 - 12"x12" Floor tile (Gray/Brown/white)	Black Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-002-Floor Tile 352203398-0027	BA-65 - 12"x12" Floor tile (Tan w/ Brown and white specks)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-002-Tan Mastic 352203398-0027A	BA-65 - 12"x12" Floor tile (Tan w/ Brown and white specks)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-002-Black Mastic 352203398-0027B	BA-65 - 12"x12" Floor tile (Tan w/ Brown and white specks)	Black Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-003 352203398-0028	BA-65 - Concrete Floor Trench Seam Caulk	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
09-004 352203398-0029	BB-44 - 2"x4' Ceiling Tile (widthwise fissures)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-005 352203398-0030	BB-15B - 2"x4' Ceiling Tile (vinyl covered sheetrock look)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-006 352203398-0031	BB-22 - 2"x2' ceiling Tile (Long fissures w/ Pinholes)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-007 352203398-0032	BB-55 Corridor - 2"x2' ceiling Tile (Rough Texture)	Tan/White Fibrous Homogeneous	95% Min. Wool	5% Non-fibrous (Other)	None Detected
09-008A 352203398-0033	BB-09 - spray-on fireproofing	White Fibrous Homogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
09-008B 352203398-0034	BB-09 - spray-on fireproofing	White Fibrous Homogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
09-008C 352203398-0035	BB-09 - spray-on fireproofing	White Fibrous Homogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
09-009 352203398-0036	BB-67 North/South Corridor - 2"x2' ceiling tile (Random fissures)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
09-010 352203398-0037	1A-30B - 2"x2' ceiling tile (vinyl covered sheetrock Look)	Tan/White Fibrous Homogeneous	40% Cellulose 40% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected

Initial report from: 04/21/2022 17:02:38

ASB_PLM_0008_0001 - 1.78 Printed: 4/21/2022 4:02 PM

Page 3 of 6



EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427

Tel/Fax: (763) 449-4922 / (763) 449-4924

<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203398

Customer ID: TREV42

Customer PO:

Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	% Fibrous	Non-Asbestos % Non-Fibrous	Asbestos % Type
09-011-Floor Tile	1B-73 - 12"x12" Floor tile (white w/ black specks)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0038					
09-011-Mastic	1B-73 - 12"x12" Floor tile (white w/ black specks)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0038A					
09-012-Floor Tile	2A-66 Corridor - 12"x12" Floor tile (white w/ gold)	White Non-Fibrous Heterogeneous		96% Non-fibrous (Other)	4% Chrysotile
352203398-0039					
09-012-Mastic	2A-66 Corridor - 12"x12" Floor tile (white w/ gold)	Black Non-Fibrous Heterogeneous		90% Non-fibrous (Other)	10% Chrysotile
352203398-0039A					
09-013	2A-34 - 2"x4" Ceiling Tile (Random fissures)	Tan/White Fibrous Homogeneous	70% Cellulose 10% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
352203398-0040					
09-014-Floor Tile	4A-40 Corridor - 12"x12" (white w/ gray streaks)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0041					
09-014-Mastic	4A-40 Corridor - 12"x12" (white w/ gray streaks)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0041A					
09-015	Penthouse - Building seam filler (gray)	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
352203398-0042					
09-016	Penthouse - West old window glazing (Gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0043					
09-017	Penthouse - SE Mud at floor duct (white/gray)	Beige Fibrous Heterogeneous	20% Min. Wool	80% Non-fibrous (Other)	None Detected
352203398-0044					
09-018-Insulation	Penthouse - Ceiling Fiberglass Insulation Backing (Black)	Pink Fibrous Heterogeneous	95% Min. Wool	5% Non-fibrous (Other)	None Detected
352203398-0045					
09-018-Wrap	Penthouse - Ceiling Fiberglass Insulation Backing (Black)	Tan/Black/Silver Fibrous Heterogeneous	50% Cellulose	50% Non-fibrous (Other)	None Detected
352203398-0045A					
09-019	Penthouse - Tar Paper by Windows (Black)	Black Fibrous Homogeneous	45% Cellulose	55% Non-fibrous (Other)	None Detected
352203398-0046					
09-020	BA-65 - Fire Stop (Red)	Red Non-Fibrous Homogeneous	10% Glass	90% Non-fibrous (Other)	None Detected
352203398-0047					
09-021A-Skim Coat	BA-65 (outside corridor) - Hard Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0048					
09-021A-Plaster	BA-65 (outside corridor) - Hard Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0048A					
09-021B-Skim Coat	BA-65 (outside corridor) - Hard Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0049					
09-021B-Plaster	BA-65 (outside corridor) - Hard Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
352203398-0049A					

Initial report from: 04/21/2022 17:02:38

ASB_PLM_0008_0001 - 1.78 Printed: 4/21/2022 4:02 PM

Page 4 of 6

**EMSL Analytical, Inc.**

3410 Winnetka Avenue North New Hope, MN 55427

Tel/Fax: (763) 449-4922 / (763) 449-4924

<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203398

Customer ID: TREV42

Customer PO:

Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
09-021C-Skim Coat 352203398-0050	BA-65 (outside corridor) - Hard Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-021C-Plaster 352203398-0050A	BA-65 (outside corridor) - Hard Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022A-Skim Coat 352203398-0051	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022A-Plaster 352203398-0051A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022B-Skim Coat 352203398-0052	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022B-Plaster 352203398-0052A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022C-Skim Coat 352203398-0053	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022C-Plaster 352203398-0053A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022D-Skim Coat 352203398-0054	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022D-Plaster 352203398-0054A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022E-Skim Coat 352203398-0055	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022E-Plaster 352203398-0055A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022F-Skim Coat 352203398-0056	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022F-Plaster 352203398-0056A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022G-Skim Coat 352203398-0057	BA-65 - Hard Lid Plaster Ceiling (white/gray)	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-022G-Plaster 352203398-0057A	BA-65 - Hard Lid Plaster Ceiling (white/gray)	Tan Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
09-023 352203398-0058	BA-65 - Sheetrock/Tape/compound	Tan/White Fibrous Heterogeneous	10% Cellulose <1% Glass	<1% Mica 90% Non-fibrous (Other)	None Detected

This is a composite result of wallboard, p. compound, and tape

Initial report from: 04/21/2022 17:02:38

ASB_PLM_0008_0001 - 1.78 Printed: 4/21/2022 4:02 PM

Page 5 of 6

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 9



EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427
Tel/Fax: (763) 449-4922 / (763) 449-4924
<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203398
Customer ID: TREV42
Customer PO:
Project ID:

Analyst(s)

Lynn Scott (87)

Rachel Travis, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. New Hope, MN NVLAP Lab Code 200019-0; Colorado AL-24478

Initial report from: 04/21/2022 17:02:38

ASB_PLM_0008_0001 - 1.78 Printed: 4/21/2022 4:02 PM

Page 6 of 6

APPENDIX B – ASBESTOS INSPECTOR CERTIFICATION

Certificate No: 5LM02152202IR

Expiration Date: February 15, 2023

This is to certify that
Daniel J. Johnson
has attended and successfully completed an
**ASBESTOS INSPECTOR
REFRESHER TRAINING COURSE**
permitted by
the State of Minnesota under Minnesota Rules 4620.3702 to 4620.3722
and meets the requirements of
Section 206 of Title II of the Toxic Substances Control Act (TSCA)
conducted by
Lake States Environmental, Ltd.
in
White Bear Lake, MN on February 15, 2022
Examination Date: February 15, 2022

Lake States Environmental, Ltd.
P. O. Box 645, Rice Lake, WI 54868
(800) 254-9811

5

North Dakota Department of
Environmental Quality
Certificate of No. 0004
Asbestos Abatement
This is to certify that Daniel James Johnson has met the
requirements of Chapter 33.1-15-13 of the North Dakota Air Pollution Control
Rules for certification in the following asbestos abatement discipline(s):
Supervisor
Worker
A. Inspector
Management Planner
Project Designer
Project Monitor
Exp: 2/15/2023
Jane Krizan
Asbestos Control Program

ASBESTOS SURVEY – 2022

Fargo VA Medical Center – Building 46

**2101 Elm Street North
Fargo, ND 58102**



PREPARED FOR:

**Ron Tollefson (VA COR)
2101 Elm Street North
Fargo, ND 58102**

PREPARED BY:

**TRINE Environmental, Inc. (SDVOSB)
6678 Morningdale Dr.
Brighton, MI**

**Dan Johnson
Asbestos Inspector (ND 6804)**

**John R Rogers
President**



Table of Contents

1.0 – INTRODUCTION	3
2.0 – SITE HISTORY & DESCRIPTION	3
3.0 – METHODS & LIMITATIONS.....	3
3.1 – Asbestos Survey Methods.....	3
3.2 – Laboratory Analytical Methods	5
3.3 – Limitations	5
4.0 – SURVEY RESULTS	6
4.1 – Asbestos Analysis Results	6
Table 1 – Analytical Results	8
Table 2 – Room by Room	9
4.2 – Additional Observations	40
4.3 – Cost Estimate for Asbestos Abatement.....	40
5.0 – RECOMMENDATIONS	40
5.1 – Recommendations for Regulated ACM (RACM)	40
5.2 – Recommendations for Category I Non-Friable ACM (C1NF).....	40
5.3 – Recommendations for Category II Non-Friable ACM (C2NF)	40
5.4 – General Recommendations.....	41
6.0 – SIGNATURE PAGE.....	41
APPENDIX A – LABORATORY CERTIFICATE OF ANALYSIS	42
APPENDIX B – ASBESTOS INSPECTOR CERTIFICATION	46

1.0 – INTRODUCTION

An asbestos survey was conducted at the Veterans Administration Medical Center (VAMC) Fargo Health Care System (HCS), 2101 Elm Street North Fargo, ND 58102. The survey was conducted between February 28th and March 31st, 2022, by Dan Johnson of TRINE Environmental, Inc., an EPA-certified building inspector in the state of North Dakota.

The purpose of this asbestos survey was to identify the presence, and extent of asbestos containing materials (ACM) in seventeen (17) buildings, incorporate previously performed asbestos survey, and create a new database in support of future plans to renovate which may require demolition activities. Each building was considered a separate homogenous area (HA).

The inspection was performed by a certified EPA asbestos building inspector, experienced in identifying and sampling suspect ACM. All areas of Building 46 were accessed and inspected.

Suspect materials were sampled to determine asbestos content.

All samples collected were analyzed at EMSL Analytical, Inc., (EMSL) an AIHA and NVLAP accredited asbestos laboratory, using either Polarized Light Microscopy (PLM) methods or Transmission Electron Microscopy (TEM) methods. A total of seventeen (17) samples were collected and analyzed.

Laboratory Certificates of Analysis are located in Appendix A of this report. Company and individual licenses and certifications are located in Appendix B.

2.0 – SITE HISTORY & DESCRIPTION

The Fargo VA HCS campus is made up of 17 buildings that first started construction in 1929 with major expansions in 1945 and 1983 but have also been under constant renovations of various magnitudes over the last 92 years. Currently the campus has approximately 576,000 interior gross square feet (GSF).

3.0 – METHODS & LIMITATIONS

3.1 – Asbestos Survey Methods

The site was inspected for suspect ACM, unless otherwise noted. Each observed suspect material was assigned a material identification within the homogenous area (HA), such as ceiling tile (CT), floor tile (FT), Thermal System Insulation (TSI) or miscellaneous (MISC), described, and measured. Each observed suspect material was sampled except for those that were confirmed positive from previous sampling events or determined to non-suspect material. Samples of suspect ACM were collected using procedures established by the United States Environmental Protection Agency (USEPA) Code of Federal Regulations (CFR) Title 40 Part 763 Subpart E, Asbestos Containing Materials in Schools.

Upon completing an initial walkthrough, the asbestos inspector began a thorough inspection identifying probable ACM and categorizing by material identification. Each material identification represented a group of material having similar characteristics such as appearance, color and manner in which it was used.

ACM's were divided into three categories:

1. **Surfacing Materials:** material that is sprayed-on, troweled on, or otherwise applied to surfaces, such as acoustical plaster on ceilings and fireproofing materials on structural members, or other materials on surfaces for acoustical, fireproofing or other purposes
2. **Thermal System Insulation (TSI):** material applied to pipes, fittings, boilers, breeching, tanks, ducts, or other structural components to prevent heat loss or gain, or water condensation, or for other purposes
3. **Miscellaneous ACM:** interior building material on structural components, structural members or fixtures, such as floor and ceiling tiles, and does not include surfacing material or thermal insulation

ACM's inventoried in this survey are classified as either friable or non-friable. Friable ACM can be crumbled or reduced to powder by hand pressure whereas non-friable ACM cannot.

The EPA asbestos NESHAP regulation further classifies non-friable ACM into two categories:

1. **Category I:** Non-friable ACM includes any asbestos-containing packing, gasket, resilient floor covering or asphalt roofing product
2. **Category II:** Non-friable ACM includes any non-friable ACM other than Category I non-friable ACM

Samples were collected in airtight sealed bags for transportation to EMSL for analysis. Standard Operating Procedures dictated samples were collected in manner consistent with health and safety protocols, using personal hygiene methods, using wet methods as required, and donning proper Personal Protective Equipment (PPE). These methods were used to prevent asbestos airborne contamination from being introduced to the hospital's atmosphere and to minimize employee, staff, and patient exposure.

Lab data pertaining to the samples analyzed is located in Appendix A of this report and each sample is listed as follows:

- Date Analyzed
- Field Sample #
- Lab Sample #
- Sample Location
- Asbestos Content
- Non-Asbestos Content

Samples were analyzed using PLM methods and Point Count Methods for any sample returning a $\leq 5\%$ (less than or equal to) result, excluding non-detects.

3.2 – Laboratory Analytical Methods

All samples collected during the survey were analyzed at EMSL, an A.I.H.A. and NVLAP certified laboratory. Upon arrival at the laboratory, the samples were logged-in and submitted for analysis.

PLM samples were analyzed utilizing the Environmental Protection Agency's test method: Methods for the determination of Asbestos in Bulk Building Materials (EPA 600/R-93/116, July 1993) and the McCrone Research Institute's The Asbestos Particle Atlas as the principal analytical references. Additional treatment and tests may be required to accurately define composition (i.e. ashing, extraction, acetone treatment, and TEM).

The PLM method utilizes a light microscope equipped with polarizing filters. The identification of asbestos fiber bundles is determined by the visual properties displayed when the sample is treated with various dispersion staining liquids. Identification is substantiated by the actual structure of the fiber and the effect of polarized light on the fiber, all of which is viewed by a trained technician. The limit of detection of asbestos by PLM is about one percent (1%) by area. Samples containing lower levels of asbestos are not reliably detectable by this technique.

Analysis was performed by using the bulk sample for visual observation and slide preparation(s) for microscopic examination and identification. The samples were analyzed for asbestos (chrysotile, amosite, crocidolite, anthophyllite, and actinolite/tremolite), fibrous non-asbestos constituents (cellulose, synthetic, etc.) and non-fibrous constituents. Using a stereoscope, the microscopist visually estimated relative amounts of each constituent by determining the volume of each constituent in proportion to the total volume of the sample.

The asbestos National Emission Standards for Hazardous Air Pollutants (NESHAP) recommends that asbestos bulk samples that are less than 10% by PLM are to be analyzed by point counting for friable ACM and mandates point counting when PLM results for friable ACM are in trace amounts (< 1%) in order to declare that the material is non-asbestos containing. The point-count procedure mandated by NESHAP is in the EPA "Interim" Bulk Method. For each layer to be point counted, eight mounts are made by dispersing 8 pinches of sample in suitable fluid. Each of the mounts is examined under the polarizing light microscope using an eyepiece reticule that superimposes a grid of points over the field of view. Fifty non-empty points are examined for each mount, yielding 400 points – some of which would be identified as asbestos and the rest as non-asbestos material.

Transmission Electron Microscopy (TEM) analysis is used to quantify and identify asbestos structures using electron diffraction and energy dispersive X-ray (EDX) analysis. Identification of chrysotile or amphibole crystalline structures can be consistently determined via the electron-diffraction capabilities of modern TEMs. The five amphibole types can be differentiated based on their elemental composition when EDX analysis is combined with their electron diffraction patterns.

3.3 – Limitations

This asbestos survey report has been prepared by TRINE in a manner consistent with that level of care and skill ordinarily exercised by members of the profession currently practicing under similar conditions. No other warranty expressed or implied is made. The intent of this survey report is to assist the building owner or management in locating ACM. This document is not intended to be utilized as a proposal or a project design document for the remediation of asbestos materials discovered during this investigation.

The survey was conducted to identify suspect ACM on the interior areas of Building 46. Some ACM may not have been discovered due to inaccessibility. Any suspect materials discovered subsequent to the issue of this survey report should be sampled and analyzed to determine asbestos content and to initiate appropriate responses.

TRINE's interpretations and recommendations are based upon the results of sample collection and analyses in compliance with environmental regulations, quality control and assurance standards, and the scope of work. The results, conclusions, and recommendations contained in this report pertain to conditions observed at the time of the survey.

The field observations, measurements, and research reported herein are considered sufficient in detail and scope to form a reasonable basis for an Asbestos Survey Report. The assessment, conclusions, and recommendations presented herein are based upon the sample analysis results of collected materials within the Homogenous Area. They may not represent all conditions at the subject site as they reflect the information gathered from specific locations. TRINE Environmental, Inc. warrants the findings and conclusions contained herein have been promulgated in accordance with generally accepted industrial hygiene methodology and only for the site described in this report.

Reliance on or use by any such third-party without explicit authorization in the report does not make said third-party a third-party beneficiary to TRINE's contract with the VA. Any such unauthorized reliance on or use of this report, including any of its information or conclusions, will be at third-party's risk. For the same reasons, no warranties or representations, expressed or implied in this report, are made to any such third party.

This report has been developed to provide the client with information regarding apparent conditions relating to the subject property. Although TRINE believes that the findings and conclusions provided in this report are reasonable, the report is necessarily limited to the conditions observed and to the information available at the time of the work. Due to the nature of the work, there is a possibility conditions exist that could not be identified within the scope of the inspection, or which were not apparent at the time of our site work. The report is also limited to information available from the client at the time it was conducted. It is also possible that the testing methods employed at the time of the report may later be superseded by other methods. TRINE does not accept responsibility for changes in the state of the art.

4.0 – SURVEY RESULTS

4.1 – Asbestos Analysis Results

A total of seventeen (17) samples were collected and analyzed by PLM. The original laboratory report and certificate of analysis are located in Appendix A.

The following tables summarize the samples collected and quantity of materials that contain asbestos in amounts >1% (greater than). Table 1 provides the analytical results of the samples submitted to the laboratory. Table 2 provides a room-by-room breakdown of the materials identified and sample number associated with the analytical results.

TABLE LEGEND

NAD: No Asbestos Detected

ACM Material with type and percent detected

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Table 1 – Analytical Results

Sample Numbers	Location / Homogeneous Area	Material Description	Material Type	Exterior Description	Quantity	AHERA Material Category	Condition	Potential for Future Damage	Asbestos Content	Notes
46-001	BA-01	Black Wall Mastic	Misc	Black	1	Miscellaneous	Good	Little/No	None Detected	
46-002	BB-80	2' x 2' Ceiling Tile	Misc	Long Fissures	1	Miscellaneous	Good	Little/No	None Detected	CT-1
46-003	BB-80	12" x 12" Floor Tile	Misc	White w/Gold	1	Miscellaneous	Good	Little/No	None Detected	FT-1
46-004	BB-75	12" x 12" Floor Tile	Misc	White w/Gray Streaks	1	Miscellaneous	Good	Little/No	None Detected	FT-2
46-005	Corridor by Stairwell #15	12" x 12" Floor Tile	Misc	Cream/Tan/ Brown	1	Miscellaneous	Good	Little/No	None Detected	FT-3
46-006	Corridor Outside BB-70	2' x 2' Ceiling Tile	Misc	Random Fissure	1	Miscellaneous	Good	Little/No	None Detected	CT-2
46-007	Corridor Outside BC-41	12" x 12" Floor Tile	Misc	Cream Specks	1	Miscellaneous	Good	Little/No	None Detected	FT-4
46-008	BB-96	2' x 4' Ceiling Tile	Misc	Random Fissure	1	Miscellaneous	Good	Little/No	None Detected	CT-3
46-009	Corridor Outside 1C-17	12" x 12" Floor Tile	Misc	White w/Black Specks	1	Miscellaneous	Good	Little/No	None Detected	FT-5
46-010	Corridor by 1C-11	2' x 2' Ceiling Tile	Misc	Random Fissure (Drop in)	1	Miscellaneous	Good	Little/No	None Detected	CT-4
46-011	1C-06	2' x 4' Ceiling Tile	Misc	Widthwise Fissure	1	Miscellaneous	Good	Little/No	None Detected	CT-5
46-012	1B-128B	2' x 2' Ceiling Tile	Misc	Vinyl Covered Sheetrock Look	1	Miscellaneous	Good	Little/No	None Detected	CT-6
46-013	2B-10	12" x 12" Floor Tile	Misc	White w/Red Streaks	1	Miscellaneous	Good	Little/No	None Detected	FT-6
46-014	3C-10	2' x 2' Ceiling Tile	Misc	Rough Texture	1	Miscellaneous	Good	Little/No	None Detected	CT-7
46-015A-G	BC-20 Throughout	Spray On Fireproofing	Misc	White/Gray	1	Surfacing Material	Good	Little/No	None Detected	
46-016	4C-05	12" x 12" Vinyl Floortile	Misc	Brn/Green/Red/Blk Specks (stick down)	1	Miscellaneous	Good	Little/No	None Detected	FT-7
46-017	BC-20	Sheetrock/Tape/Compound	Misc	White	1	Surfacing Material	Good	Little/No	None Detected	

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Table 2 – Room by Room

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BA-01	B	Black Wall Mastic	Misc		Black	300 sf	Good	None Detected		46-001	
BA-01A	B	No Suspect Material									
BA-01B	B	No Suspect Material									
BA-01 Corridor	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	250 sf	Good	None Detected		46-005	FT-3
BC-01	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
BC-01	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
BC-02	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
BC-02	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
BC-05	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	1,100 sf	Good	None Detected		46-002	CT-1
BC-05A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-05B	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-05C	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-10	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	410 sf	Good	None Detected		46-002	CT-1
BC-11	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	200 sf	Good	None Detected		46-002	CT-1
BC-11A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-12	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-13	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-15	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	1,000 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BC-15A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	125 sf	Good	None Detected		46-002	CT-1
BC-20	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	3,100 sf	Good	None Detected		46-002	CT-1
BC-20A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-20B	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-20 Corridor	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	1,200 sf	Good	None Detected		46-006	CT-2
BC-20 Corridor	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	1,200 sf	Good	None Detected		46-005	FT-3
BC-24	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	25 sf	Good	None Detected		46-006	CT-2
BC-24	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	25 sf	Good	None Detected		46-005	FT-3
BC-30	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
BC-30 Corridor	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-30 Corridor	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
BC-32	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
BC-34	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
BC-41	B	No Suspect Material									
BC-43	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-44	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-44	B	12" x 12" Floortile	Misc	12"	Cream Specks	300 sf	Good	None Detected		46-007	FT-4
BC-45	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-45	B	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BC-46	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-46	B	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
BC-47	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	300 sf	Good	None Detected		46-002	CT-1
BC-47	B	12" x 12" Floortile	Misc	12"	Cream Specks	300 sf	Good	None Detected		46-007	FT-4
BC-47 Corridor	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	525 sf	Good	None Detected		46-002	CT-1
BC-47 Corridor	B	12" x 12" Floortile	Misc	12"	Cream Specks	525 sf	Good	None Detected		46-007	FT-4
BC-50	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	450 sf	Good	None Detected		46-002	CT-1
BC-50	B	12" x 12" Floortile	Misc	12"	Cream Specks	450 sf	Good	None Detected		46-007	FT-4
BC-50A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	250 sf	Good	None Detected		46-002	CT-1
BC-50A	B	12" x 12" Floortile	Misc	12"	Cream Specks	250 sf	Good	None Detected		46-007	FT-4
BC-52	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-54	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-54A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	200 sf	Good	None Detected		46-002	CT-1
BC-56	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-56	B	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
BC-58	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
BC-58	B	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
BC-59	B	No Suspect Material									
BC-60	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	450 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-72A	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
BB-72A	B	12" x 12" Floortile	Misc	12"	White w/Gold	120 sf	Good	None Detected		46-003	FT-1
BB-75	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	500 sf	Good	None Detected		46-002	CT-1
BB-75	B	12" x 12" Floortile	Misc	12"	White w/Gray Streaks	500 sf	Good	None Detected		46-004	FT-2
BB-76	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	330 sf	Good	None Detected		46-002	CT-1
BB-76	B	12" x 12" Floortile	Misc	12"	Cream Specks	330 sf	Good	None Detected		46-007	FT-4
BB-78	B	Sheet Vinyl Floor	Misc		Gray	200 sf	Good			Non-Suspect	New
BB-79	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
BB-79	B	12" x 12" Floortile	Misc	12"	White w/Gold	150 sf	Good	None Detected		46-003	FT-1
BB-80	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	2,100 sf	Good	None Detected		46-002	CT-1
BB-80	B	12" x 12" Floortile	Misc	12"	White w/Gold	2,100 sf	Good	None Detected		46-003	FT-1
BB-80A	B	12" x 12" Floortile	Misc	12"	White w/Gold	120 sf	Good	None Detected		46-003	FT-1
BB-80B	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	40 sf	Good	None Detected		46-012	CT-6
BB-80B	B	2" Ceramic Flooring	Misc	2"	Gray	40 sf	Good			Non-Suspect	New
BB-80B	B	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
BB-80C	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	30 sf	Good	None Detected		46-002	CT-1
BB-80C	B	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	30 sf	Good	None Detected		46-005	FT-3
BB-90	B	Sheet Vinyl Floor	Misc		Gray	140 sf	Good			Non-Suspect	New
BB-90A	B	Sheet Vinyl Floor	Misc		Gray	200 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-90B	B	Sheet Vinyl Floor	Misc		Gray	150 sf	Good			Non-Suspect	New
BB-91	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	25 sf	Good	None Detected		46-006	CT-2
BB-91	B	12" x 12" Floortile	Misc	12"	Cream Specks	25 sf	Good	None Detected		46-007	FT-4
BB-92	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
BB-92	B	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
BB-93	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	200 sf	Good	None Detected		46-006	CT-2
BB-93	B	12" x 12" Floortile	Misc	12"	Cream Specks	200 sf	Good	None Detected		46-007	FT-4
BB-93 Corridor	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	400 sf	Good	None Detected		46-006	CT-2
BB-93 Corridor	B	12" x 12" Floortile	Misc	12"	Cream Specks	400 sf	Good	None Detected		46-007	FT-4
BB-94	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	145 sf	Good	None Detected		46-006	CT-2
BB-94	B	12" x 12" Floortile	Misc	12"	Cream Specks	145 sf	Good	None Detected		46-007	FT-4
BB-95	B	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	1,650 sf	Good	None Detected		46-008	CT-3
BB-95	B	Rubber Floor	Misc		Black	1,650 sf	Good			Non-Suspect	New
BB-95A	B	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	265 sf	Good	None Detected		46-008	CT-3
BB-95A	B	2" Ceramic Flooring	Misc	2"	Gray	265 sf	Good			Non-Suspect	New
BB-95A	B	4" Ceramic Wall Tile	Misc	4"	Cream	400 sf	Good			Non-Suspect	New
BB-95B	B	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	265 sf	Good	None Detected		46-008	CT-3
BB-95B	B	2" Ceramic Flooring	Misc	2"	Gray	265 sf	Good			Non-Suspect	New
BB-95B	B	4" Ceramic Wall Tile	Misc	4"	Cream	400 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
BB-96	B	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	670 sf	Good	None Detected		46-008	CT-3
BB-96	B	Rubber Floor	Misc		Black	670 sf	Good			Non-Suspect	New
BB-97	B	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
BB-97	B	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
BB-100	B	No Suspect Material									
1A-01	1	No Suspect Material									
1A-01 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	300 sf	Good	None Detected		46-002	CT-1
1A-01 Corridor	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	300 sf	Good	None Detected		46-005	FT-3
1C-01	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-01	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-02	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-02	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-03	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-03	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-04	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	115 sf	Good	None Detected		46-002	CT-1
1C-05	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
1C-05	1	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
1C-05	1	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
1C-06	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	40 sf	Good	None Detected		46-011	CT-5

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-06	1	2" Ceramic Flooring	Misc	2"	Gray	40 sf	Good			Non-Suspect	New
1C-06	1	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
1C-07	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-07	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-08	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-08	1	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
1C-09	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	50 sf	Good	None Detected		46-008	CT-3
1C-09	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	50 sf	Good	None Detected		46-009	FT-5
1C-10	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	120 sf	Good	None Detected		46-010	CT-4
1C-10	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	120 sf	Good	None Detected		46-009	FT-5
1C-10 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	300 sf	Good	None Detected		46-010	CT-4
1C-10 Corridor	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	300 sf	Good	None Detected		46-009	FT-5
1C-11	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	100 sf	Good	None Detected		46-010	CT-4
1C-11	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-11 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	300 sf	Good	None Detected		46-010	CT-4
1C-11 Corridor	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	300 sf	Good	None Detected		46-009	FT-5
1C-13	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	100 sf	Good	None Detected		46-010	CT-4
1C-13	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-14	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-14	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	120 sf	Good	None Detected		46-005	FT-3
1C-14A	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
1C-14A	1	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
1C-14A	1	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
1C-15	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	100 sf	Good	None Detected		46-010	CT-4
1C-15	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-16	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	180 sf	Good	None Detected		46-002	CT-1
1C-16	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	180 sf	Good	None Detected		46-005	FT-3
1C-17	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	75 sf	Good	None Detected		46-002	CT-1
1C-17	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	75 sf	Good	None Detected		46-009	FT-5
1C-18	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	80 sf	Good	None Detected		46-002	CT-1
1C-18	1	Sheet Vinyl Floor	Misc		Blue/Pink/Gray/White	80 sf	Good			Non-Suspect	New
1C-19	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	130 sf	Good	None Detected		46-002	CT-1
1C-19	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	130 sf	Good	None Detected		46-005	Under Carpet
1C-20	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	115 sf	Good	None Detected		46-002	CT-1
1C-20	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	115 sf	Good	None Detected		46-005	FT-3
1C-20	1	4" Ceramic Wall Tile	Misc	4"	Cream	150 sf	Good			Non-Suspect	New
1C-21	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-21	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-22	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
1C-22	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
1C-23	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	300 sf	Good	None Detected		46-006	CT-2
1C-23	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	300 sf	Good	None Detected		46-009	FT-5
1C-23A	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	50 sf	Good	None Detected		46-006	CT-2
1C-23A	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	50 sf	Good	None Detected		46-009	FT-5
1C-23 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	450 sf	Good	None Detected		46-010	CT-4
1C-23 Corridor	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	450 sf	Good	None Detected		46-009	FT-5
1C-24	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	300 sf	Good	None Detected		46-010	CT-4
1C-24	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	300 sf	Good	None Detected		46-005	FT-3
1C-25	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	350 sf	Good	None Detected		46-010	CT-4
1C-26	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	100 sf	Good	None Detected		46-010	CT-4
1C-26	1	12" x 12" Floortile	Misc	12"	Cream Specks	100 sf	Good	None Detected		46-007	FT-4
1C-32	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	545 sf	Good	None Detected		46-008	CT-3
1C-33	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	200 sf	Good	None Detected		46-008	CT-3
1C-33	1	18" Ceramic Floortile	Misc	18"	Gray	200 sf	Good			Non-Suspect	New
1C-33	1	2" x 6" Ceramic Wall Tile	Misc	2" x 6"	Gray	250 sf	Good			Non-Suspect	New
1C-34	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	200 sf	Good	None Detected		46-008	CT-3
1C-34	1	18" Ceramic Floortile	Misc	18"	Gray	200 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1C-34	1	2" x 6" Ceramic Wall Tile	Misc	2" x 6"	Gray	250 sf	Good			Non-Suspect	New
1C-35	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	250 sf	Good	None Detected		46-006	CT-2
1C-35A	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
1C-35B	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	25 sf	Good	None Detected		46-006	CT-2
1C-35C	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	35 sf	Good	None Detected		46-006	CT-2
1C-35D	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	150 sf	Good	None Detected		46-006	CT-2
1C-35E	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	150 sf	Good	None Detected		46-006	CT-2
1C-35F	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
1C-35FA	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	50 sf	Good	None Detected		46-006	CT-2
1C-36	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	7,500 sf	Good	None Detected		46-006	CT-2
1C-36	1	18" Ceramic Floortile	Misc	18"	Gray	7,000 sf	Good			Non-Suspect	New
1C-38	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	115 sf	Good	None Detected		46-006	CT-2
1C-38	1	18" Ceramic Floortile	Misc	18"	Gray	115 sf	Good			Non-Suspect	New
1C-39	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	40 sf	Good	None Detected		46-006	CT-2
1C-39	1	18" Ceramic Floortile	Misc	18"	Gray	40 sf	Good			Non-Suspect	New
1C-40	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	115 sf	Good	None Detected		46-006	CT-2
1C-100	1	18" Ceramic Floortile	Misc	18"	Gray	1,200 sf	Good			Non-Suspect	New
1C-101	1	18" Ceramic Floortile	Misc	18"	Gray	125 sf	Good			Non-Suspect	New
1B-82	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-82	1	Sheet Vinyl Floor	Misc		Gray	100 sf	Good			Non-Suspect	New
1B-90	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	2,260 sf	Good	None Detected		46-002	CT-1
1B-90	1	Sheet Vinyl Floor	Misc		Gray	2,260 sf	Good			Non-Suspect	New
1B-90C	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	140 sf	Good	None Detected		46-002	CT-1
1B-90C	1	Sheet Vinyl Floor	Misc		Gray	140 sf	Good			Non-Suspect	New
1B-90D	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	25 sf	Good	None Detected		46-002	CT-1
1B-90D	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	25 sf	Good	None Detected		46-009	FT-5
1B-90E	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	140 sf	Good	None Detected		46-002	CT-1
1B-90E	1	Sheet Vinyl Floor	Misc		Gray	140 sf	Good			Non-Suspect	New
1B-90F	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
1B-90F	1	Sheet Vinyl Floor	Misc		Gray	150 sf	Good			Non-Suspect	New
1B-90 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	600 sf	Good	None Detected		46-002	CT-1
1B-90 Corridor	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	600 sf	Good	None Detected		46-009	FT-5
1B-97	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	160 sf	Good	None Detected		46-008	CT-3
1B-98	1	12" x 12" Floortile	Misc	12"	White w/Black Specks	25 sf	Good	None Detected		46-009	FT-5
1B-98	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	25 sf	Good	None Detected		46-008	CT-3
1B-99	1	No Suspect Material									
1B-99 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	225 sf	Good	None Detected		46-006	CT-2
1B-99 Corridor	1	12" x 12" Floortile	Misc	12"	Cream Specks	225 sf	Good	None Detected		46-007	FT-4

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-100	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	300 sf	Good	None Detected		46-008	CT-3
1B-100	1	Sheet Vinyl Floor	Misc		Cream	300 sf	Good			Non-Suspect	New
1B-100A	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	100 sf	Good	None Detected		46-006	CT-2
1B-100A	1	Sheet Vinyl Floor	Misc		Cream	100 sf	Good			Non-Suspect	New
1B-100 Corridor	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	450 sf	Good	None Detected		46-006	CT-2
1B-100 Corridor	1	Sheet Vinyl Floor	Misc		Cream	450 sf	Good			Non-Suspect	New
1B-101	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	165 sf	Good	None Detected		46-008	CT-3
1B-101	1	Sheet Vinyl Floor	Misc		Cream	165 sf	Good			Non-Suspect	New
1B-102	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	125 sf	Good	None Detected		46-006	CT-2
1B-102	1	Sheet Vinyl Floor	Misc		Cream	125 sf	Good			Non-Suspect	New
1B-103	1	Sheet Vinyl Floor	Misc		Cream	125 sf	Good			Non-Suspect	New
1B-104	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	200 sf	Good	None Detected		46-012	CT-6
1B-104	1	Sheet Vinyl Floor	Misc		Cream	200 sf	Good			Non-Suspect	New
1B-106	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	150 sf	Good	None Detected		46-012	CT-6
1B-106	1	Sheet Vinyl Floor	Misc		Cream	150 sf	Good			Non-Suspect	New
1B-107	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	150 sf	Good	None Detected		46-012	CT-6
1B-107	1	Sheet Vinyl Floor	Misc		Cream	150 sf	Good			Non-Suspect	New
1B-107A	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	50 sf	Good	None Detected		46-012	CT-6
1B-107A	1	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
1B-107A	1	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
1B-108	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	50 sf	Good	None Detected		46-008	CT-3
1B-108	1	2" Ceramic Flooring	Misc	2"	Gray	50 f	Good			Non-Suspect	New
1B-108	1	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
1B-109	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	120 sf	Good	None Detected		46-006	CT-2
1B-109	1	12" x 12" Floortile	Misc	12"	Cream Specks	120 sf	Good	None Detected		46-007	FT-4
1B-110	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	50 sf	Good	None Detected		46-012	CT-6
1B-110	1	Sheet Vinyl Floor	Misc		Cream	50 sf	Good			Non-Suspect	New
1B-112	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	40 sf	Good	None Detected		46-006	CT-2
1B-112	1	2" Ceramic Flooring	Misc	2"	Gray	40 sf	Good			Non-Suspect	New
1B-112	1	4" Ceramic Wall Tile	Misc	4"	Cream	80 sf	Good			Non-Suspect	New
1B-114	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	150 sf	Good	None Detected		46-008	CT-3
1B-114	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	150 sf	Good	None Detected		46-005	FT-3
1B-115	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	100 sf	Good	None Detected		46-008	CT-3
1B-116	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	240 sf	Good	None Detected		46-012	CT-6
1B-116	1	4" Ceramic Wall Tile	Misc	4"	Cream	300 sf	Good			Non-Suspect	New
1B-120	1	No Suspect Material									
1B-121A	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	50 sf	Good	None Detected		46-005	FT-3
1B-121B	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
	1	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	50 sf	Good	None Detected		46-005	FT-3
1B-122	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	50 sf	Good	None Detected		46-012	CT-6
1B-122	1	Sheet Vinyl Floor	Misc		Cream	50 sf	Good			Non-Suspect	New
1B-124	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	100 sf	Good	None Detected		46-012	CT-6
1B-124	1	Sheet Vinyl Floor	Misc		Cream	100 sf	Good			Non-Suspect	New
1B-125	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	120 sf	Good	None Detected		46-008	CT-3
1B-125	1	Sheet Vinyl Floor	Misc		Cream	120 sf	Good			Non-Suspect	New
1B-126	1	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	120 sf	Good	None Detected		46-008	CT-3
1B-126	1	Sheet Vinyl Floor	Misc		Cream	120 sf	Good			Non-Suspect	New
1B-127	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	244 sf	Good	None Detected		46-012	CT-6
1B-127	1	Sheet Vinyl Floor	Misc		Cream	244 sf	Good			Non-Suspect	New
1B-128	1	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	244 sf	Good	None Detected		46-012	CT-6
1B-128	1	Sheet Vinyl Floor	Misc		Cream	244 sf	Good			Non-Suspect	New
2A-01	2	No Suspect Material									
2D-12	2	No Suspect Material									
2A-04	2	Sheet Vinyl Floor	Misc		Cream	250 sf	Good			Non-Suspect	New
2A-26	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	250 sf	Good	None Detected		46-002	CT-1
2A-27	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	200 sf	Good	None Detected		46-002	CT-1
2B-03	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-03	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	60 sf	Good	None Detected		46-005	FT-3
2B-03	2	4" Ceramic Wall Tile	Misc	4"	Cream	80 sf	Good			Non-Suspect	New
2B-05	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	75 sf	Good	None Detected		46-011	CT-5
2B-05	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	75 sf	Good	None Detected		46-005	FT-3
2B-05	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2B-06	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	30 sf	Good	None Detected		46-011	CT-5
2B-06	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	30 sf	Good	None Detected		46-005	FT-3
2B-08	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5
2B-09	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	40 sf	Good	None Detected		46-011	CT-5
2B-09	2	2" Ceramic Flooring	Misc	2"	Cream	40 sf	Good			Non-Suspect	New
2B-09	2	4" Ceramic Wall Tile	Misc	4"	Cream	80 sf	Good			Non-Suspect	New
2B-10	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	1,200 sf	Good	None Detected		46-011	CT-5
2B-10	2	12" x 12" Floortile	Misc	12"	White w/Red Streaks	1,200 sf	Good	None Detected		46-013	FT-6
2B-10	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	120 sf	Good	None Detected		46-005	FT-3
2B-13	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	40 sf	Good	None Detected		46-011	CT-5
2B-13	2	2" Ceramic Flooring	Misc	2"	Gray	40 sf	Good			Non-Suspect	New
2B-13	2	4" Ceramic Wall Tile	Misc	4"	Cream	80 sf	Good			Non-Suspect	New
2B-14	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	100 sf	Good	None Detected		46-011	CT-5
2B-15	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	120 sf	Good	None Detected		46-011	CT-5

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2B-15 Corridor	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	420 sf	Good	None Detected		46-002	CT-1
2B-15 Corridor	2	12" x 12" Floortile	Misc	12"	Cream Specks	420 sf	Good	None Detected		46-007	FT-4
2C-05	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	200 sf	Good	None Detected		46-002	CT-1
2C-05 Corridor	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	900 sf	Good	None Detected		46-002	CT-1
2C-05 Corridor	2	12" x 12" Floortile	Misc	12"	Cream Specks	900 sf	Good	None Detected		46-007	FT-4
2C-06	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
2C-06	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	150 sf	Good	None Detected		46-005	FT-3
2C-06A	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	30 sf	Good	None Detected		46-002	CT-1
2C-06A	2	2" Ceramic Flooring	Misc	2"	Gray	30 sf	Good			Non-Suspect	New
2C-06A	2	4" Ceramic Wall Tile	Misc	4"	Cream	60 sf	Good			Non-Suspect	New
2C-07	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	250 sf	Good	None Detected		46-012	CT-6
2C-07	2	Sheet Vinyl Floor	Misc		Gray	250 sf	Good			Non-Suspect	New
2C-08	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-08	2	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
2C-08	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2C-10	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	300 sf	Good	None Detected		46-012	CT-6
2C-10	2	Sheet Vinyl Floor	Misc		Gray	300 sf	Good			Non-Suspect	New
2C-11	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	250 sf	Good	None Detected		46-012	CT-6
2C-11	2	Sheet Vinyl Floor	Misc		Gray	250 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-12	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	130 sf	Good	None Detected		46-002	CT-1
2C-12	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	130 sf	Good	None Detected		46-005	FT-3
2C-14	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	120 sf	Good	None Detected		46-008	CT-2
2C-14	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	120 sf	Good	None Detected		46-011	FT-4
2C-15	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	250 sf	Good	None Detected		46-012	CT-6
2C-15	2	Sheet Vinyl Floor	Misc		Gray	250 sf	Long Fissures			Non-Suspect	New
2C-17	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	80 sf	Good	None Detected		46-012	CT-6
2C-17	2	Sheet Vinyl Floor	Misc		Gray	80 sf	Good			Non-Suspect	New
2C-18	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
2C-18	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	120 sf	Good	None Detected		46-005	FT-3
2C-19	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	40 sf	Good	None Detected		46-012	CT-6
2C-19	2	Sheet Vinyl Floor	Misc		Gray	40 sf	Good			Non-Suspect	New
2C-19A	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	20 sf	Good	None Detected		46-012	CT-6
2C-19A	2	Sheet Vinyl Floor	Misc		Gray	20 sf	Good			Non-Suspect	New
2C-20	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
2C-21	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	75 sf	Good	None Detected		46-002	CT-1
2C-21	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	75 sf	Good	None Detected		46-005	FT-3
2C-21A	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-21A	2	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-21A	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2C-23	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	85 sf	Good	None Detected		46-002	CT-1
2C-23	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	85 sf	Good	None Detected		46-005	FT-3
2C-23A	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-23A	2	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
2C-23A	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2C-25	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	300 sf	Good	None Detected		46-005	FT-3
2C-28	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	270 sf	Good	None Detected		46-002	CT-1
2C-28	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	270 sf	Good	None Detected		46-005	FT-3
2C-29	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	290 sf	Good	None Detected		46-008	CT-1
2C-29	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	290 sf	Good	None Detected		46-011	FT-4
2C-30	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	75 sf	Good	None Detected		46-002	CT-1
2C-31	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	125 sf	Good	None Detected		46-002	CT-1
2C-32	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	125 sf	Good	None Detected		46-002	CT-1
2C-33	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
2C-33	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	120 sf	Good	None Detected		46-005	FT-3
2C-34	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
2C-34	2	2" Ceramic Flooring	Misc	2"	Gray	100 sf	Good			Non-Suspect	New
2C-34	2	4" Ceramic Wall Tile	Misc	4"	Cream	150 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-35	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	
2C-36	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
2C-36	2	2" Ceramic Flooring	Misc	2"	Gray	100 sf	Good			Non-Suspect	New
2C-36	2	4" Ceramic Wall Tile	Misc	4"	Cream	150 sf	Good			Non-Suspect	New
2C-37	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-37	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	50 sf	Good	None Detected		46-011	FT-4
2C-38	2	No Suspect Material									
2C-39	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	75 sf	Good	None Detected		46-002	CT-1
2C-39	2	2" Ceramic Flooring	Misc	2"	Gray	75 sf	Good			Non-Suspect	New
2C-39	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2C-40	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	30 sf	Good	None Detected		46-002	CT-1
2C-40	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	30 sf	Good	None Detected		46-011	FT-4
2C-40A	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	25 sf	Good	None Detected		46-002	CT-1
2C-40A	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	25 sf	Good	None Detected		46-011	FT-4
2C-41	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	100 sf	Good	None Detected		46-011	CT-5
2C-41	2	12" x 12" Floortile	Misc	12"	White w/Red Streaks	100 sf	Good	None Detected		46-013	FT-6
2C-41A	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
2C-41A	2	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
2C-41A	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-42	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-42	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	50 sf	Good	None Detected		46-011	FT-4
2C-43	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
2C-43	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	150 sf	Good	None Detected		46-011	FT-4
2C-44	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
2C-44	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	150 sf	Good	None Detected		46-011	FT-4
2C-45	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	300 sf	Good	None Detected		46-002	CT-1
2C-45	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	300 sf	Good	None Detected		46-011	FT-4
2C-46	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	100 sf	Good	None Detected		46-011	CT-5
2C-46	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-005	FT-3
2C-47	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	225 sf	Good	None Detected		46-011	CT-5
2C-47	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	225 sf	Good	None Detected		46-011	FT-4
2C-48	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
2C-48	2	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
2C-48	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2C-49	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-49	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	50 sf	Good	None Detected		46-011	FT-4
2C-51	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	150 sf	Good	None Detected		46-012	CT-6
2C-51	2	2" Ceramic Flooring	Misc	2"	Gray	150 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-51	2	4" Ceramic Wall Tile	Misc	4"	Cream	200 sf	Good			Non-Suspect	New
2C-52	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	50 sf	Good	None Detected		46-002	CT-1
2C-52	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	50 sf	Good	None Detected		46-011	FT-4
2C-55	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	700 sf	Good	None Detected		46-008	CT-1
2C-55	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	700 sf	Good	None Detected		46-011	FT-4
2C-55A	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
2C-55A	2	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
2C-55A	2	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
2C-56	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
2C-57	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	40 sf	Good	None Detected		46-002	CT-1
2C-57	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	40 sf	Good	None Detected		46-011	FT-4
2C-58	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	180 sf	Good	None Detected		46-002	CT-1
2C-58A	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	25 sf	Good	None Detected		46-002	CT-1
2C-58A	2	2" Ceramic Flooring	Misc	2"	Gray	25 sf	Good			Non-Suspect	New
2C-58A	2	4" Ceramic Wall Tile	Misc	4"	Cream	50 sf	Good			Non-Suspect	New
2C-59	2	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	40 sf	Good	None Detected		46-011	CT-5
2C-59	2	2" Ceramic Flooring	Misc	2"	Gray	40 sf	Good			Non-Suspect	New
2C-59	2	4" Ceramic Wall Tile	Misc	4"	Cream	80 sf	Good			Non-Suspect	New
2C-60	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	200 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
2C-60 Corridor	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	700 sf	Good	None Detected		46-002	CT-1
2C-60 Corridor	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	700 sf	Good	None Detected		46-011	FT-4
2C-61	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
2C-63	2	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
2C-63	2	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	100 sf	Good	None Detected		46-011	FT-4
3A-03	3	No Suspect Material									
3A-03 Corridor	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	250 sf	Good	None Detected		46-008	CT-1
3A-03 Corridor	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	250 sf	Good	None Detected		46-009	FT-5
3C-01	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	110 sf	Good	None Detected		46-011	CT-5
3C-01 Corridor	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	300 sf	Good	None Detected		46-002	CT-1
3C-01 Corridor	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	300 sf	Good	None Detected		46-011	CT-5
3C-03	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5
3C-03	3	2" Ceramic Flooring	Misc	2"	Gray	60 sf	Good			Non-Suspect	New
3C-03	3	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
3C-04	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	150 sf	Good	None Detected		46-002	CT-1
3C-04A	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	120 sf	Good	None Detected		46-002	CT-1
3C-04B	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissures	120 sf	Good	None Detected		46-002	CT-1
3C-05	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	40 sf	Good	None Detected		46-011	CT-5
3C-05	3	2" Ceramic Flooring	Misc	2"	Gray	40 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-05	3	4" Ceramic Wall Tile	Misc	4"	Cream	80 sf	Good			Non-Suspect	New
3C-07	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5
3C-07	3	2" Ceramic Flooring	Misc	2"	Gray	60 sf	Good			Non-Suspect	New
3C-07	3	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
3C-09	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5
3C-09	3	2" Ceramic Flooring	Misc	2"	Gray	60 sf	Good			Non-Suspect	New
3C-09	3	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
3C-10	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure (Drop In)	240 sf	Good	None Detected		46-010	
3C-10	3	Spray On Texture	Surface		White	400 sf	Good		Non-Friable	Assumed	To High to Sample
3C-12	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	85 sf	Good	None Detected		46-002	CT-1
3C-13	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	75 sf	Good	None Detected		46-011	CT-5
3C-13	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	75 sf	Good	None Detected		46-005	FT-3
3C-14	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	95 sf	Good	None Detected		46-002	CT-1
3C-15	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	100 sf	Good	None Detected		46-002	CT-1
3C-15	3	12" x 12" Floortile	Misc	12"	White w/Gold	100 sf	Good	None Detected		46-003	FT-1
3C-16	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	275 sf	Good	None Detected		46-011	CT-5
3C-16	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	275 sf	Good	None Detected		46-005	FT-3
3C-17	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	75 sf	Good	None Detected		46-002	CT-1
3C-17	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	75 sf	Good	None Detected		46-005	FT-3

ASBESTOS SURVEY – 2022

Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-20	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	125 sf	Good	None Detected		46-011	CT-5
3C-20	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	125 sf	Good	None Detected		46-009	FT-5
3C-21	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	120 sf	Good	None Detected		46-011	CT-5
3C-22	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	300 sf	Good	None Detected		46-011	CT-5
3C-22	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	300 sf	Good	None Detected		46-005	FT-3
3C-23	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	70 sf	Good	None Detected		46-011	CT-5
3C-23	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	70 sf	Good	None Detected		46-009	FT-5
3C-24	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	70 sf	Good	None Detected		46-011	CT-5
3C-24	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	70 sf	Good	None Detected		46-009	FT-5
3C-25	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	250 sf	Good	None Detected		46-002	CT-1
3C-25	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	250 sf	Good	None Detected		46-009	FT-5
3C-26	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	150 sf	Good	None Detected		46-011	CT-5
3C-26	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	150 sf	Good	None Detected		46-005	FT-3
3C-26A	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	40 sf	Good	None Detected		46-011	CT-5
3C-26A	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	40 sf	Good	None Detected		46-005	FT-3
3C-28	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	250 sf	Good	None Detected		46-011	CT-5
3C-28	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	250 sf	Good	None Detected		46-009	FT-5
3C-29	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	160 sf	Good	None Detected		46-011	CT-5
3C-29	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	160 sf	Good	None Detected		46-009	FT-5

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-30	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	150 sf	Good	None Detected		46-011	CT-5
3C-30	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	150 sf	Good	None Detected		46-005	FT-3
3C-32	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	110 sf	Good	None Detected		46-011	CT-5
3C-32	3	12" x 12" Floortile	Misc	12"	Cream/Tan/Brown	110 sf	Good	None Detected		46-005	FT-3
3C-34	3	No Suspect Material									
3C-37	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	270 sf	Good	None Detected		46-002	CT-1
3C-38	3	No Suspect Material									
3C-40	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	250 sf	Good	None Detected		46-008	CT-3
3C-40A	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	140 sf	Good	None Detected		46-008	CT-3
3C-41	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	180 sf	Good	None Detected		46-008	CT-3
3C-41 Corridor	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	450 sf	Good	None Detected		46-006	CT-2
3C-41 Corridor	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	450 sf	Good	None Detected		46-009	FT-5
3C-42	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	250 sf	Good	None Detected		46-012	CT-6
3C-42	3	Sheet Vinyl Floor	Misc		Gray	250 sf	Good			Non-Suspect	New
3C-43	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	285 sf	Good	None Detected		46-008	CT-3
3C-43	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	285 sf	Good	None Detected		46-009	FT-5
3C-44	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	130 sf	Good	None Detected		46-012	CT-6
3C-44	3	Sheet Vinyl Floor	Misc		Gray	130 sf	Good			Non-Suspect	New
3C-44 Corridor	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	900 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-44 Corridor	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	900 sf	Good	None Detected		46-009	FT-5
3C-48	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	40 sf	Good	None Detected		46-006	CT-2
3C-48	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	40 sf	Good	None Detected		46-009	FT-5
3C-50	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	1,200 sf	Good	None Detected		46-006	CT-2
3C-50	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	1,200 sf	Good	None Detected		46-009	FT-5
3C-50A	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	275 sf	Good	None Detected		46-006	CT-2
3C-50A	3	12" x 12" Floortile	Misc	12"	White w/Black Specks	275 sf	Good	None Detected		46-009	Under Carpet
3C-51	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	275 sf	Good	None Detected		46-006	CT-2
3C-51	3	Sheet Vinyl Floor	Misc		Gray	275 sf	Good			Non-Suspect	New
3C-52	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Vinyl Covered Sheetrock Look	330 sf	Good	None Detected		46-012	CT-6
3C-52	3	Sheet Vinyl Floor	Misc		Gray	330 sf	Good			Non-Suspect	New
3C-52A	3	2' x 4' Ceiling Tile	Misc	2' x 4'	Random Fissure	100 sf	Good	None Detected		46-008	CT-3
3C-52A	3	Sheet Vinyl Floor	Misc		Gray	100 sf	Good			Non-Suspect	New
3C-53	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	430 sf	Good	None Detected		46-006	CT-2
3C-53	3	Sheet Vinyl Floor	Misc		Gray	430 sf	Good			Non-Suspect	New
3C-54	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	430 sf	Good	None Detected		46-006	CT-2
3C-54	3	Sheet Vinyl Floor	Misc		Gray	430 sf	Good			Non-Suspect	New
3C-55	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	275 sf	Good	None Detected		46-006	CT-2
3C-55	3	Sheet Vinyl Floor	Misc		Gray	275 sf	Good			Non-Suspect	New

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
3C-56	3	2' x 2' Ceiling Tile	Misc	2' x 2'	Random Fissure	50 sf	Good	None Detected		46-006	CT-2
3C-56	3	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
3C-56	3	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
3C-72	3	No Suspect Material									
3D-04	3	No Suspect Material									
3D-04A	3	No Suspect Material									
4C-01	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	10 sf	Good	None Detected		46-002	CT-1
4C-01	4	Sheet Vinyl Floor	Misc		Gray	10 sf	Good			Non-Suspect	New
4C-02	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	40 sf	Good	None Detected		46-002	CT-1
4C-02	4	Sheet Vinyl Floor	Misc		Gray	40 sf	Good			Non-Suspect	New
4C-03	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
4C-03	4	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
4C-03	4	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
4C-05	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	75 sf	Good	None Detected		46-011	CT-5
4C-05	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	75 sf	Good	None Detected		46-016	FT-7
4C-06	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
4C-06	4	Sheet Vinyl Floor	Misc		Brown	50 sf	Good			Non-Suspect	New
4C-07	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	220 sf	Good	None Detected		46-011	CT-5
4C-07 Corridor	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	350 sf	Good	None Detected		46-002	CT-1

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4C-07 Corridor	4	Sheet Vinyl Floor	Misc		Multi-color Mosaic	350 sf	Good			Non-Suspect	New
4C-08	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
4C-08	4	Sheet Vinyl Floor	Misc		Brown	50 sf	Good			Non-Suspect	New
4C-10	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-10	4	Sheet Vinyl Floor	Misc		Gray	115 sf	Good			Non-Suspect	New
4C-11	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5
4C-11	4	Sheet Vinyl Floor	Misc		Gray	140 sf	Good			Non-Suspect	New
4C-12	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5
4C-12	4	Sheet Vinyl Floor	Misc		Brown	140 sf	Good			Non-Suspect	New
4C-13	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5
4C-13	4	Sheet Vinyl Floor	Misc		Brown	140 sf	Good			Non-Suspect	New
4C-14	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5
4C-14	4	Sheet Vinyl Floor	Misc		Brown	140 sf	Good			Non-Suspect	New
4C-15	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	300 sf	Good	None Detected		46-002	CT-1
4C-15 Corridor	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	300 sf	Good	None Detected		46-002	CT-1
4C-15 Corridor	4	Sheet Vinyl Floor	Misc		Multi-color Mosaic	300 sf	Good			Non-Suspect	New
4C-16	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5
4C-16	4	Sheet Vinyl Floor	Misc		Brown	140 sf	Good			Non-Suspect	New
4C-17	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	140 sf	Good	None Detected		46-011	CT-5

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4C-17	4	Sheet Vinyl Floor	Misc		Brown	140 sf	Good			Non-Suspect	New
4C-18	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-18	4	Sheet Vinyl Floor	Misc		Brown	115 sf	Good			Non-Suspect	New
4C-20	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-20	4	Sheet Vinyl Floor	Misc		Brown	115 sf	Good			Non-Suspect	New
4C-21	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-21	4	Sheet Vinyl Floor	Misc		Brown	115 sf	Good			Non-Suspect	New
4C-22	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-22	4	Sheet Vinyl Floor	Misc		Brown	115 sf	Good			Non-Suspect	New
4C-23	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	125 sf	Good	None Detected		46-011	CT-5
4C-23	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	125 sf	Good	None Detected		46-016	FT-7
4C-23A	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
4C-23A	4	2" Ceramic Flooring	Misc	2"	Gray	50 sf	Good			Non-Suspect	New
4C-23A	4	4" Ceramic Wall Tile	Misc	4"	Cream	100 sf	Good			Non-Suspect	New
4C-24	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	100 sf	Good	None Detected		46-011	CT-5
4C-24	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	100 sf	Good	None Detected		46-016	FT-7
4C-24 Corridor	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	900 sf	Good	None Detected		46-002	CT-1
4C-24 Corridor	4	Sheet Vinyl Floor	Misc		Multi-color Mosaic	900 sf	Good			Non-Suspect	New
4C-25	4	No Suspect Material									2' x 2' Metal Ceiling

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4C-26	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	120 sf	Good	None Detected		46-011	CT-5
4C-27	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	120 sf	Good	None Detected		46-016	FT-7
4C-28	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	120 sf	Good	None Detected		46-011	CT-5
4C-29	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	120 sf	Good	None Detected		46-011	CT-5
4C-30	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	350 sf	Good	None Detected		46-002	CT-1
4C-31	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5
4C-32	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5
4C-33	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	60 sf	Good	None Detected		46-011	CT-5
4C-34	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	130 sf	Good	None Detected		46-011	CT-5
4C-35	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	130 sf	Good	None Detected		46-011	CT-5
4C-39	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	250 sf	Good	None Detected		46-002	CT-1
4C-40	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	480 sf	Good	None Detected		46-002	CT-1
4C-40 Corridor	4	2' x 2' Ceiling Tile	Misc	2' x 2'	Long Fissures	1,030 sf	Good	None Detected		46-002	CT-1
4C-40 Corridor	4	Sheet Vinyl Floor	Misc		Multi-color Mosaic	1,030 sf	Good			Non-Suspect	New
4C-44	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	150 sf	Good	None Detected		46-011	CT-5
4C-45	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	250 sf	Good	None Detected		46-011	CT-5
4C-46	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5
4C-46	4	Sheet Vinyl Floor	Misc		Brown	50 sf	Good			Non-Suspect	New
4C-47	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	50 sf	Good	None Detected		46-011	CT-5

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46

Room Number	Floor	Suspect Material Present	Material Identification	Size	Exterior Description	Quantity	Condition	Asbestos Content	Friability	Sample Reference	Notes
4C-47	4	Sheet Vinyl Floor	Misc		Brown	50 sf	Good			Non-Suspect	New
4C-48	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	240 sf	Good	None Detected		46-011	CT-5
4C-49	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	155 sf	Good	None Detected		46-011	CT-5
4C-49	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	155 sf	Good	None Detected		46-016	FT-7
4C-50	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	155 sf	Good	None Detected		46-011	CT-5
4C-50	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	155 sf	Good	None Detected		46-016	FT-7
4C-51	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	130 sf	Good	None Detected		46-011	CT-5
4C-51	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	130 sf	Good	None Detected		46-016	FT-7
4C-52	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	100 sf	Good	None Detected		46-011	CT-5
4C-52	4	12" x 12" Vinyl Floortile	Misc	12"	Brn/Green/Red/Blk Specks (stick down)	100 sf	Good	None Detected		46-016	FT-7
4C-55	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-55	4	2" Ceramic Flooring	Misc	2"	Gray	115 sf	Good			Non-Suspect	New
4C-55	4	4" Ceramic Wall Tile	Misc	4"	Cream	200 sf	Good			Non-Suspect	New
4C-56	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	115 sf	Good	None Detected		46-011	CT-5
4C-56	4	2" Ceramic Flooring	Misc	2"	Gray	115 sf	Good			Non-Suspect	New
4C-56	4	4" Ceramic Wall Tile	Misc	4"	Cream	200 sf	Good			Non-Suspect	New
4D-04	4	2' x 4' Ceiling Tile	Misc	2' x 4'	Widthwise Fissures	75 sf	Good	None Detected		46-011	CT-5
4D-04	4	2" Ceramic Flooring	Misc	2"	Gray	75 sf	Good			Non-Suspect	New
4D-04	4	4" Ceramic Wall Tile	Misc	4"	Cream	150 sf	Good			Non-Suspect	New

4.2 – Additional Observations

No additional observations were noted.

4.3 – Cost Estimate for Asbestos Abatement

Material	Sample Reference	Location	Low End Price Per sq/ln ft	High End Price per ln/sq ft	Total Square/Linear Feet of ACM	Low End Removal Cost	High End Removal Cost
Spray on Texture	Assumed	3C-10	\$12.00	\$19.00	400	\$4,800.00	\$7,600.00

5.0 – RECOMMENDATIONS

5.1 – Recommendations for Regulated ACM (RACM)

None observed during this inspection.

If present, these materials must be removed prior to any activity that would release asbestos fibers from this material. Specifically, any renovation or demolition activity that will crush, abrade, or dissolve the matrix of this material must be performed by a North Dakota licensed Asbestos Contractor. If these materials are in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

5.2 – Recommendations for Category I Non-Friable ACM (C1NF)

None observed during this inspection.

If present, these materials identified as Category I Non-Friable ACM are required to be removed by a North Dakota licensed asbestos contractor if proposed renovations or demolition will impact these materials in such a manner as to render them friable and thus RACM. Specifically, any renovation or demolition activity that will crush, abrade, or dissolve the matrix of these materials then they must first be removed by a North Dakota-licensed Asbestos Contractor. If these materials are in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

5.3 – Recommendations for Category II Non-Friable ACM (C2NF)

Spray-on Texture:

If present, these materials identified as Category II Non-friable ACM must be removed prior to any renovation or demolition activity that will crush, abrade, or dissolve the matrix of this material. The removal of this material must be performed by a North Dakota licensed Asbestos Contractor. If this material is in good condition and not impacted by the renovation/demolition and will remain on/in the facility, no other special handling, or action is required.

5.4 – General Recommendations

Based on the asbestos survey and sampling results, TRINE has the following recommendations:

- Each type of asbestos that will need to be removed as part of any renovation or demolition project in North Dakota are required to be removed, handled, and disposed of as ACM waste by a licensed North Dakota asbestos abatement contractor regardless if the material is a RACM, C1NF, or C2NF in accordance with the North Dakota Department of Environmental Quality (DEQ).
- The VA employ an independent industrial hygienist (VPIH/CPIH) consultant and/or use its own IH to perform various services of the VA. The VPIH/CPIH will perform the necessary monitoring, inspection, testing, and other support services to ensure that VA patients, employees, and visitors will not be adversely affected by the abatement work in accordance with ***Veterans Administration (VA), Section 02 82 11, Traditional Asbestos Abatement***
- TRINE recommends final air testing in addition to final visual inspection of abatement areas prior to deregulation of contained work areas.
- Suspect materials discovered after this inspection should be sampled and analyzed to determine asbestos content and to initiate appropriate responses.

North Dakota DEQ and the US Environmental Protection Agency require notification of intent to renovate or demolish when asbestos is present. Notification must be sent at least 10 working days prior to the start of any construction activities. The general contractor should also keep a copy of this survey at the construction site during the entire construction project as proof of compliance with 40 CFR 61 (NESHAP).


Submitted by:

6.0 – SIGNATURE PAGE



John R Rogers
President

Asbestos Building Inspector (NY) 16-11678

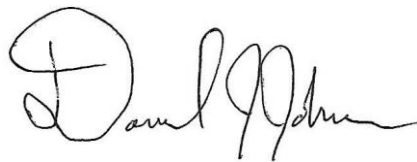

Dan Johnson

Asbestos Building Inspector (ND) 6804

APPENDIX A – LABORATORY CERTIFICATE OF ANALYSIS

NOTE: Results for the above referenced samples are located on the following pages.

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46



EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427
 Tel/Fax: (763) 449-4922 / (763) 449-4924
<http://www.EMSL.com/minneapolislab@emsl.com>

EMSL Order: 352203414
 Customer ID: TREV42
 Customer PO:
 Project ID:

Attention: John Rogers
 Trine Environmental
 6678 Morningdale Drive
 Brighton, MI 48116

Phone: (810) 986-0536
 Fax:
 Received Date: 04/14/2022 1:30 PM
 Analysis Date: 04/21/2022 - 04/22/2022
 Collected Date:

Project: Fargo VA Inspection

**Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized
 Light Microscopy**

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
46-001 352203414-0001	Black Wall Mastic - BA-01	Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-002 352203414-0002	2"x2" Ceiling Tile (Long Fissures) - BB-80	Gray/White Fibrous Heterogeneous	60% Cellulose 20% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
46-003-Floor Tile 352203414-0003	12"x12" Floor tile (White w/Gold) - BB-80	Gray/White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-003-Mastic 352203414-0003A	12"x12" Floor tile (White w/Gold) - BB-80	Tan/Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-004-Floor Tile 352203414-0004	12"x12" Floor tile (White w/Gray Streaks) - BB-75	Gray/White Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-004-Mastic 352203414-0004A	12"x12" Floor tile (White w/Gray Streaks) - BB-75	Tan/Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-005-Floor Tile 352203414-0005	12"x12" Floor tile (cream/Tan/Brown) - Corridor outside stairwell #15	Gray/White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-005-Mastic 352203414-0005A	12"x12" Floor tile (cream/Tan/Brown) - Corridor outside stairwell #15	Tan/Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-006 352203414-0006	2"x2" Ceiling Tile (Random Fissures) - Corridor outside BB-70	Gray/White Fibrous Heterogeneous	50% Cellulose 30% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
46-007-Floor Tile 352203414-0007	12"x12" Floor tile (cream specks) - Corridor Outside BC-41	Gray/White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-007-Mastic 352203414-0007A	12"x12" Floor tile (cream specks) - Corridor Outside BC-41	Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Initial report from: 04/22/2022 17:07:25

ASB_PLM_0008_0001 - 1.78 Printed: 4/22/2022 4:07 PM

Page 1 of 6

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46



EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427
 Tel/Fax: (763) 449-4922 / (763) 449-4924
<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203414
 Customer ID: TREV42
 Customer PO:
 Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
46-008 352203414-0008	12"x12" Ceiling Tile (Random Fissure) - BB-06	Gray/White Fibrous Heterogeneous	40% Cellulose 40% Min. Wool	10% Perlite 10% Non-Fibrous (Other)	None Detected
46-009-Floor Tile 352203414-0009	12"x12" Floor tile (white w/Black specks) - Corridor Outside 1C-17	Gray/White Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
46-009-Mastic 352203414-0009A	12"x12" Floor tile (white w/Black specks) - Corridor Outside 1C-17	Tan Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
46-010 352203414-0010	2"x2" Ceiling Tile (Random Fissure(Drop in)) - Corridor by 1C-11	Gray/White Fibrous Heterogeneous	60% Cellulose 20% Min. Wool	10% Perlite 10% Non-Fibrous (Other)	None Detected
46-011 352203414-0011	2"x4" Ceiling Tile (widthwise Fissure) - 1C-06	Gray/White Fibrous Heterogeneous	60% Cellulose 20% Min. Wool	10% Perlite 10% Non-Fibrous (Other)	None Detected
46-012 352203414-0012	2"x2" Ceiling Tile (Vinyl Covered Sheetrock Look) - 1B-12BB	Gray/White Fibrous Heterogeneous	40% Cellulose 40% Min. Wool	10% Perlite 10% Non-Fibrous (Other)	None Detected
46-013-Floor Tile 352203414-0013	12"x12" Floor tile (White w/Red Streaks) - 2B-10	Gray/White Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
46-013-Mastic 352203414-0013A	12"x12" Floor tile (White w/Red Streaks) - 2B-10	Tan/Black Non-Fibrous Homogeneous		100% Non-Fibrous (Other)	None Detected
46-014 352203414-0014	2"x2" Ceiling Tile (Rough Texture) - 3C-10	Brown/White Fibrous Heterogeneous	30% Cellulose 50% Min. Wool	10% Perlite 10% Non-Fibrous (Other)	None Detected
46-015A 352203414-0015	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-Fibrous (Other)	None Detected
46-015B 352203414-0016	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-Fibrous (Other)	None Detected
46-015C 352203414-0017	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-Fibrous (Other)	None Detected
46-015D 352203414-0018	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-Fibrous (Other)	None Detected
46-015E 352203414-0019	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-Fibrous (Other)	None Detected

Initial report from: 04/22/2022 17:07:25

ASB_PLM_0008_0001 - 1.78 Printed: 4/22/2022 4:07 PM

Page 2 of 6

ASBESTOS SURVEY – 2022
Fargo VAMC – Building 46



EMSL Analytical, Inc.

3410 Winnetka Avenue North New Hope, MN 55427
 Tel/Fax: (763) 449-4922 / (763) 449-4924
<http://www.EMSL.com / minneapolislab@emsl.com>

EMSL Order: 352203414
 Customer ID: TREV42
 Customer PO:
 Project ID:

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
46-015F 352203414-0020	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-fibrous (Other)	None Detected
46-015G 352203414-0021	Spray-on Fireproofing (white/gray) - BC-20	Gray/White Fibrous Homogeneous	50% Cellulose 10% Glass	40% Non-fibrous (Other)	None Detected
46-016 352203414-0022	12"x12" Vinyl Floor tile (Brown/Green/Red/Black Specks (Stick Down)) - 4C-05	Brown/Black/Green Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
46-017 352203414-0023	Sheetrock/Tape/compound (white) - BC-20 <i>This is a composite result of sheetrock, ft. compound, and tape</i>	Brown/White Fibrous Heterogeneous	10% Cellulose 2% Glass	88% Non-fibrous (Other)	None Detected
03-001 352203414-0024	2"x2" Ceiling Tile (Long Fissure)	Gray/White Fibrous Heterogeneous	50% Cellulose 30% Min. Wool	10% Perlite 10% Non-fibrous (Other)	None Detected
03-002-Floor Tile 352203414-0025	12"x12" Floor tile (cream)	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
03-002-Mastic 352203414-0025A	12"x12" Floor tile (cream)	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
03-003-Light Gray Layer 352203414-0026	Exterior Window Caulking (Gray)	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
03-003-Dark Gray Layer 352203414-0026A	Exterior Window Caulking (Gray)	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
03-004 352203414-0027	Sheetrock/Tape/Compound (white) <i>This is a composite result of sheetrock, ft. compound, and tape</i>	Brown/White Fibrous Heterogeneous	10% Cellulose 2% Glass	88% Non-fibrous (Other)	None Detected
03-005A 352203414-0028	Spray-on Fireproofing (white Fluffy)	White Fibrous Homogeneous	90% Cellulose	10% Non-fibrous (Other)	None Detected
03-005B 352203414-0029	Spray-on Fireproofing (white Fluffy)	White Fibrous Homogeneous	90% Cellulose	10% Non-fibrous (Other)	None Detected
03-005C 352203414-0030	Spray-on Fireproofing (white Fluffy)	White Fibrous Homogeneous	90% Cellulose	10% Non-fibrous (Other)	None Detected

Initial report from: 04/22/2022 17:07:25

ASB_PLM_0008_0001 - 1.78 Printed: 4/22/2022 4:07 PM

Page 3 of 6

APPENDIX B – ASBESTOS INSPECTOR CERTIFICATION

Certificate No: 5LM02152202IR

Expiration Date: February 15, 2023

This is to certify that
Daniel J. Johnson
has attended and successfully completed an
**ASBESTOS INSPECTOR
REFRESHER TRAINING COURSE**
permitted by
the State of Minnesota under Minnesota Rules 4620.3702 to 4620.3722
and meets the requirements of
Section 206 of Title II of the Toxic Substances Control Act (TSCA)
conducted by
Lake States Environmental, Ltd.
in
White Bear Lake, MN on February 15, 2022
Examination Date: February 15, 2022

Lake States Environmental, Ltd.
P. O. Box 645, Rice Lake, WI 54868
(800) 254-9811


57


North Dakota Department of
Environmental Quality
Certificate of No. 0004
Asbestos Abatement

This is to certify that Daniel James Johnson has met the
requirements of Chapter 33.1-15-13 of the North Dakota Air Pollution Control
Rules for certification in the following asbestos abatement discipline(s):

Supervisor
Worker
Inspector
Management Planner
Project Designer
Project Monitor

Exp: 2/15/2023 Jane Krizan
Asbestos Control Program

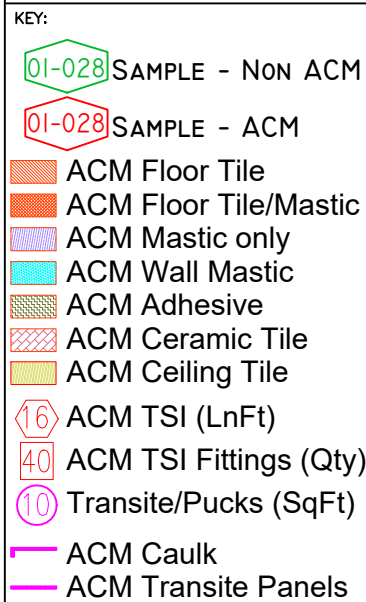



BUILDING
1, 9, 46


FACILITY/LOCATION
FARGO VAHCS 210 ELM STREET FARGO, ND 58102

DATE 6/14/22

DRAWING NO
ACM-02A

KEY:

-  SAMPLE - Non ACM
-  SAMPLE - ACM
-  ACM Floor Tile
-  ACM Floor Tile/Mastic
-  ACM Wall only
-  ACM Wall Mastic
-  ACM Adhesive
-  ACM Ceiling Tile
-  ACM TSI (LnFt)
-  ACM TSI Fittings (Qty)
-  Transite/Pucks (SqFt)
-  ACM Caulk
-  ACM Transite Panels



BUILDING
1, 9, 46

FACILITY/LOCATION	FARGO VAHCS 210 ELM STREET FARGO, ND 58102
-------------------	--

DATE 6/14/22

DRAWING NO
ACM-03A

01-028 SAMPLE - ACM

 ACM Mastic only

 ACM Wall Mastic
 ACM Adhesive

ACM Ceiling Tile


16 ACM TSI (LnFt)


40 ACM TSI Fittings (Qt)


⑩ Transite/Pucks (SqF)



ACM Caulk

— ACM Transit Panels

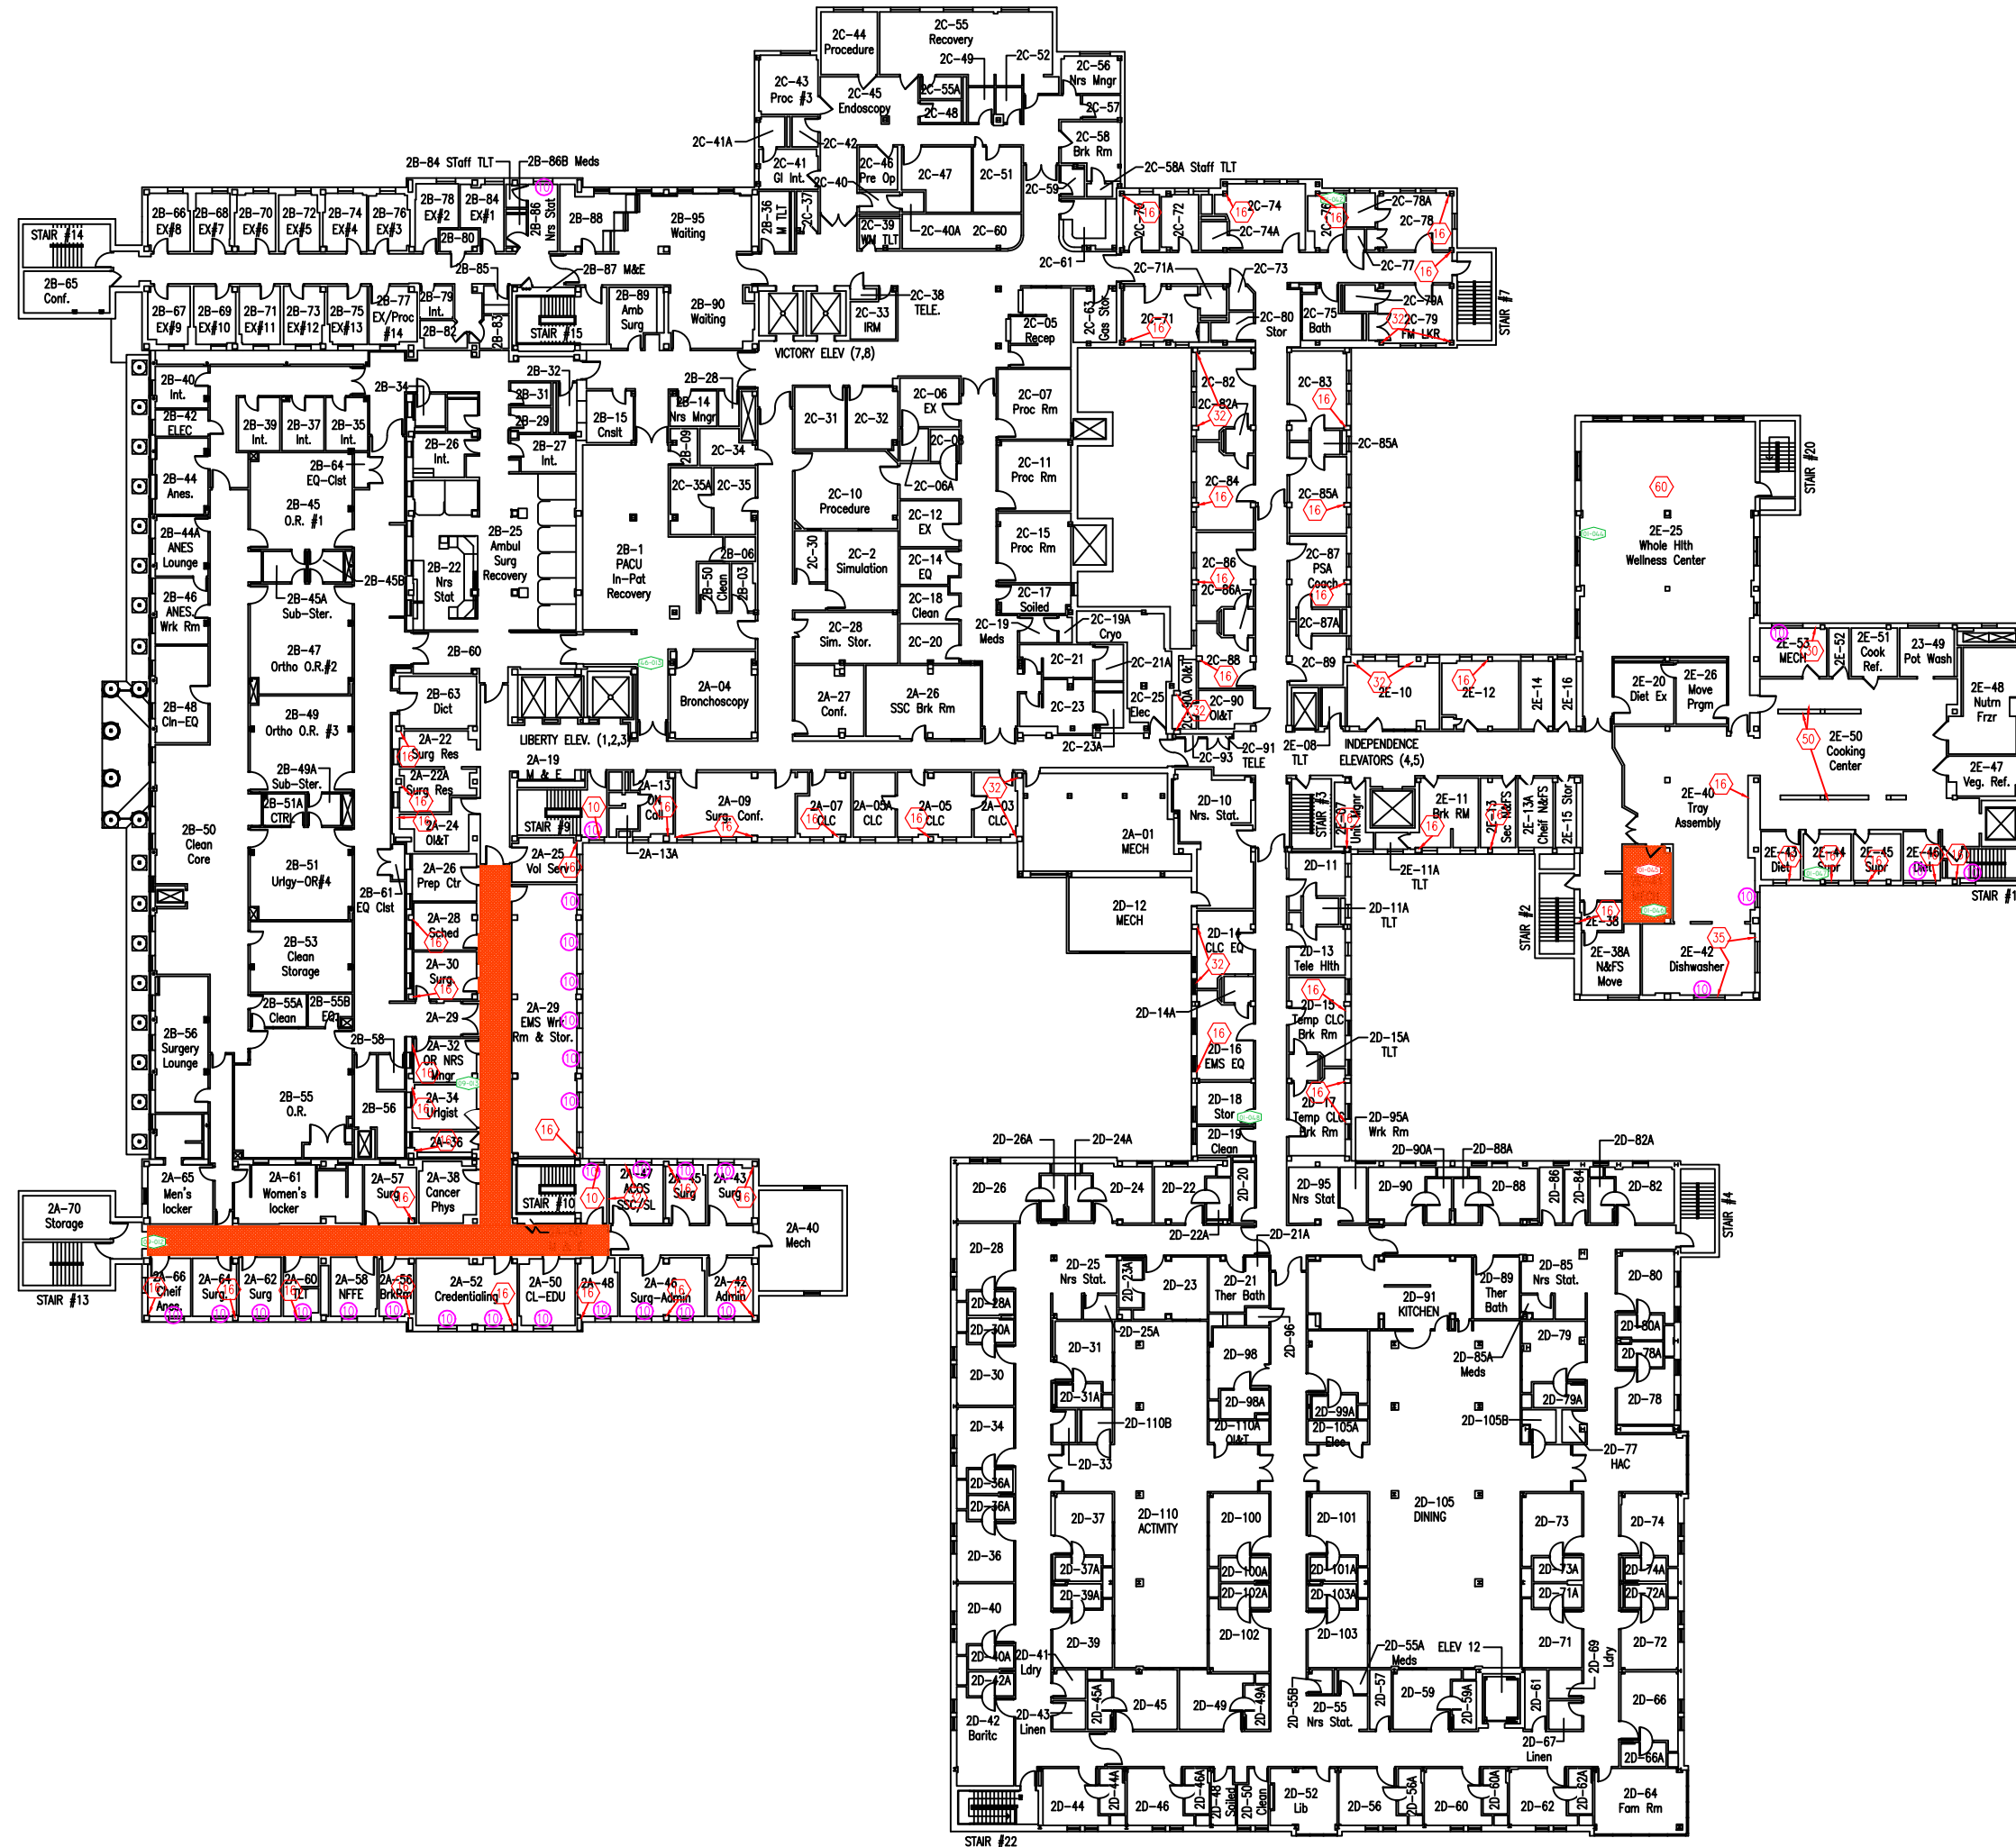

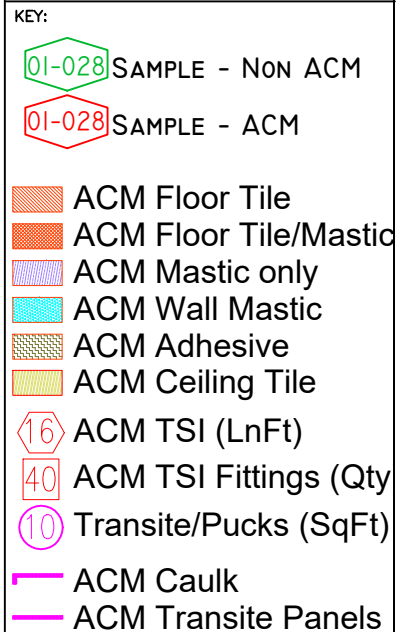

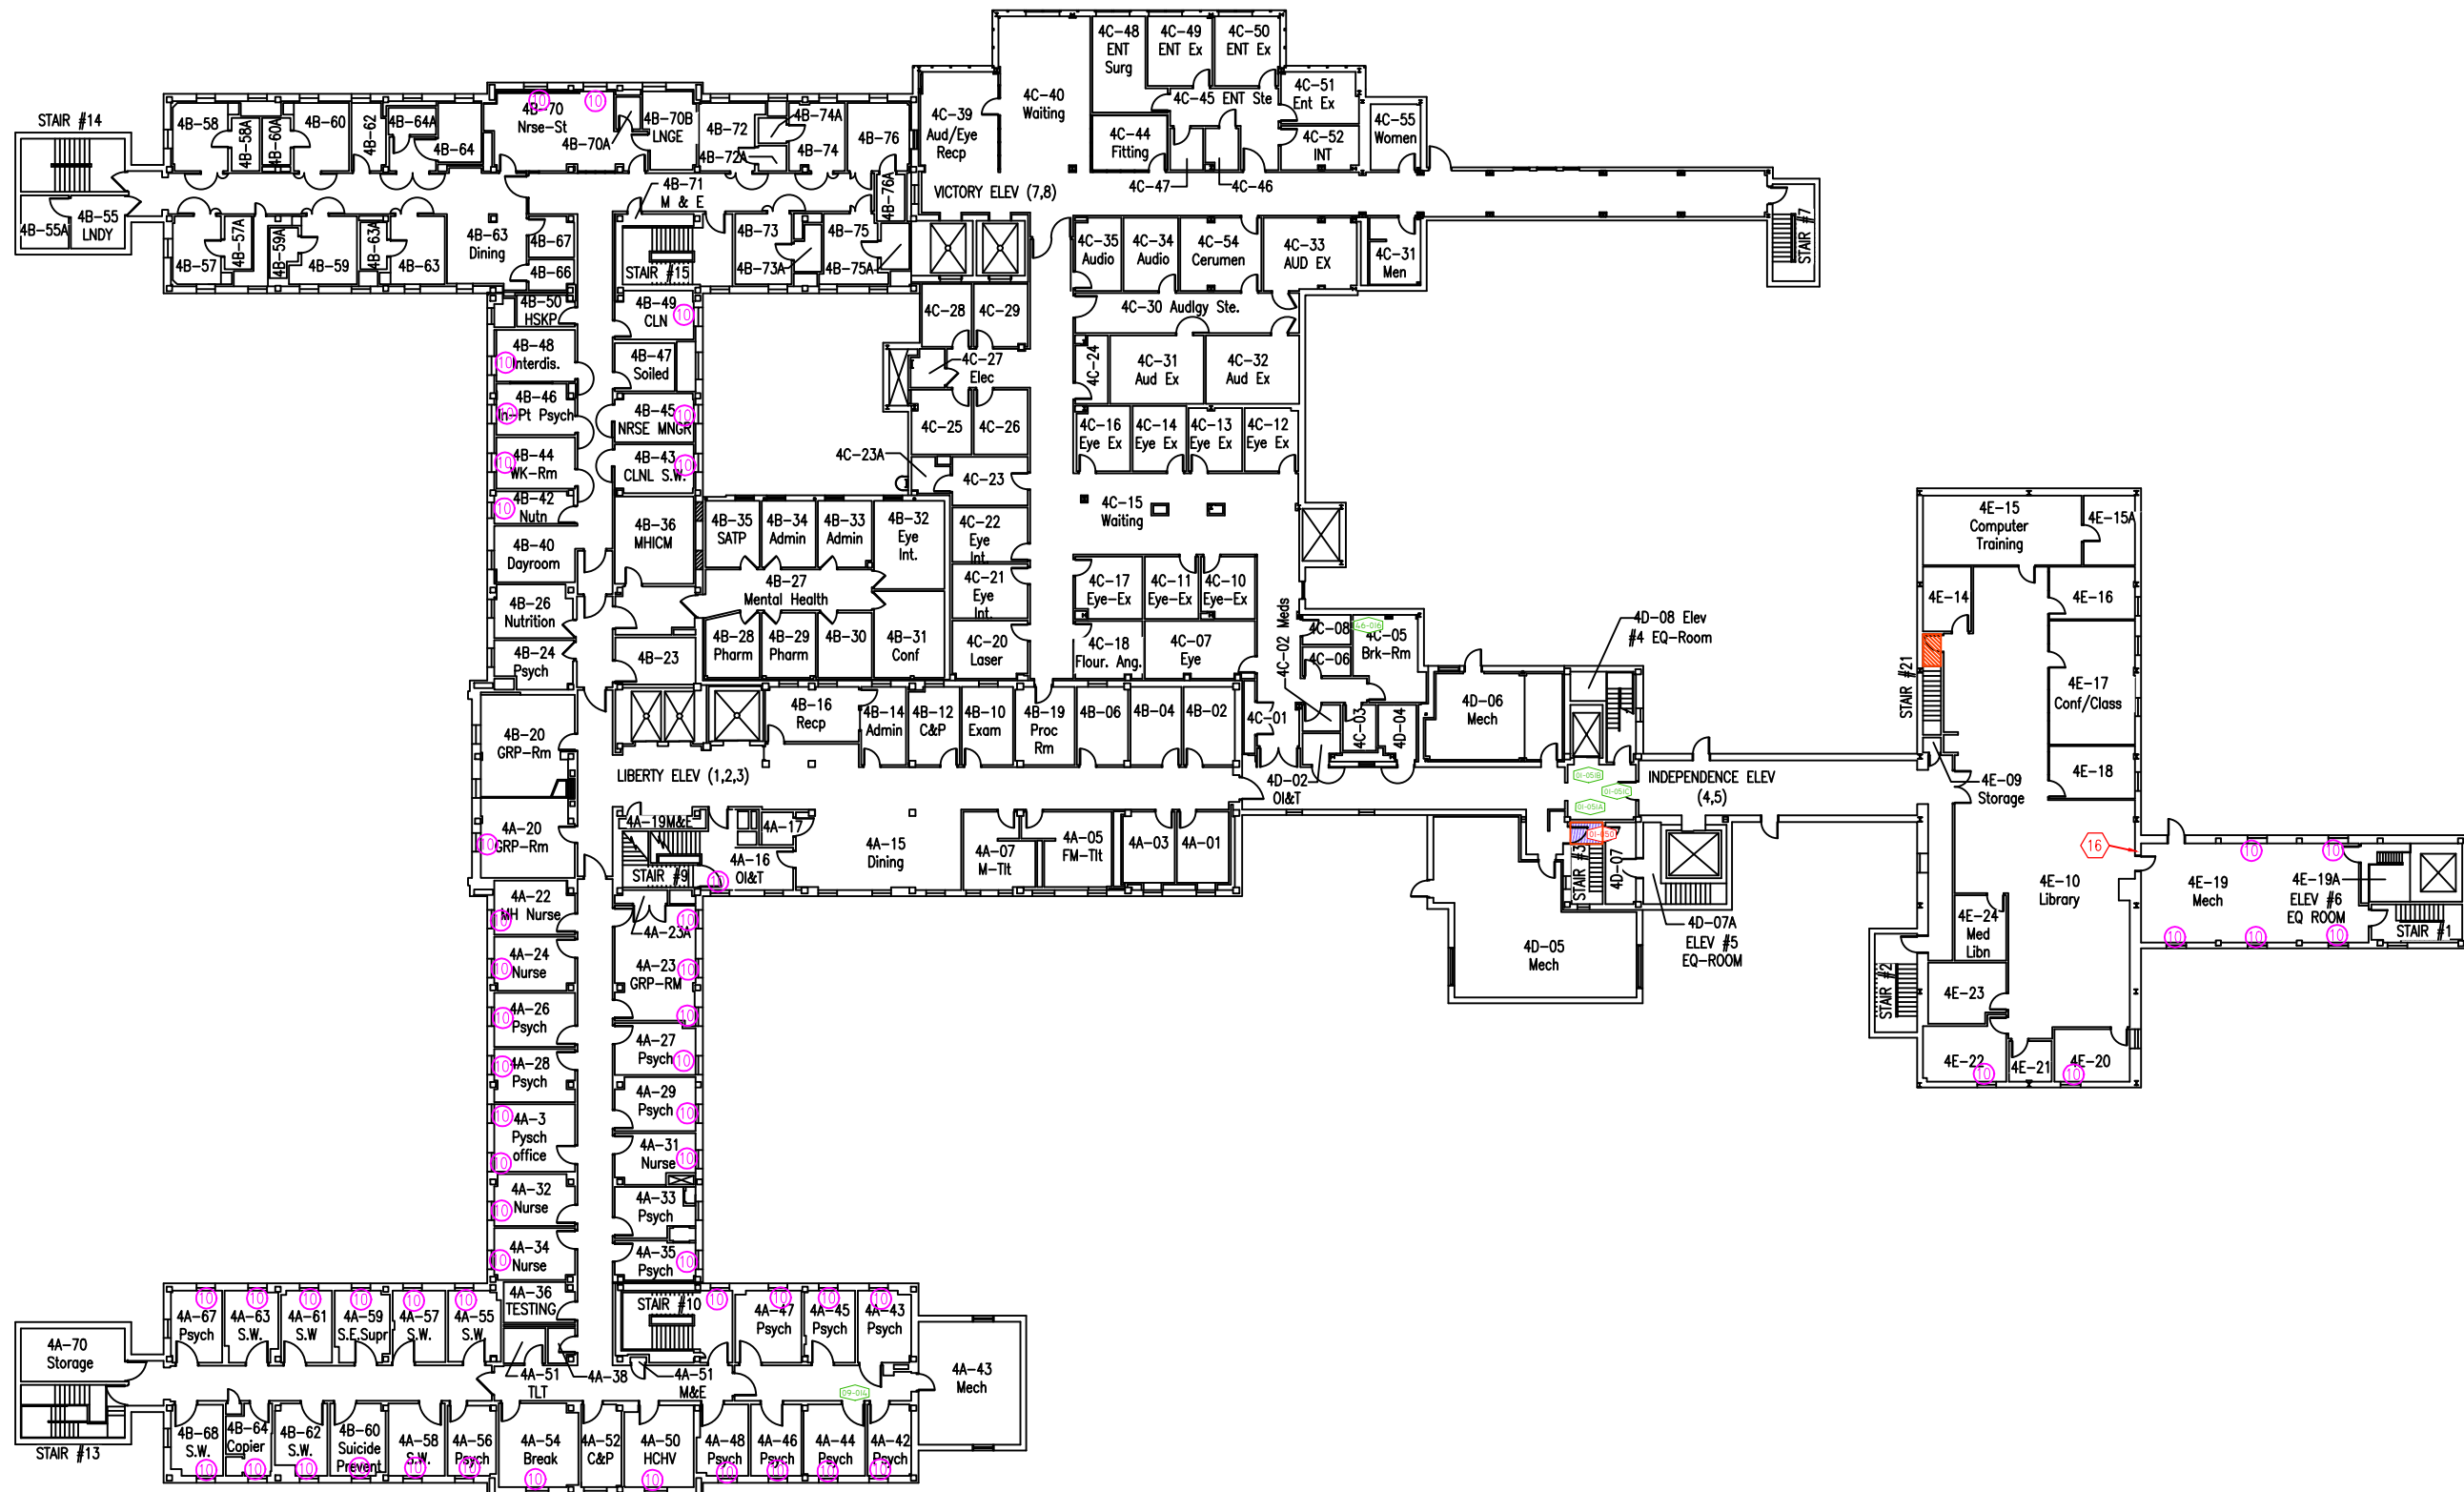

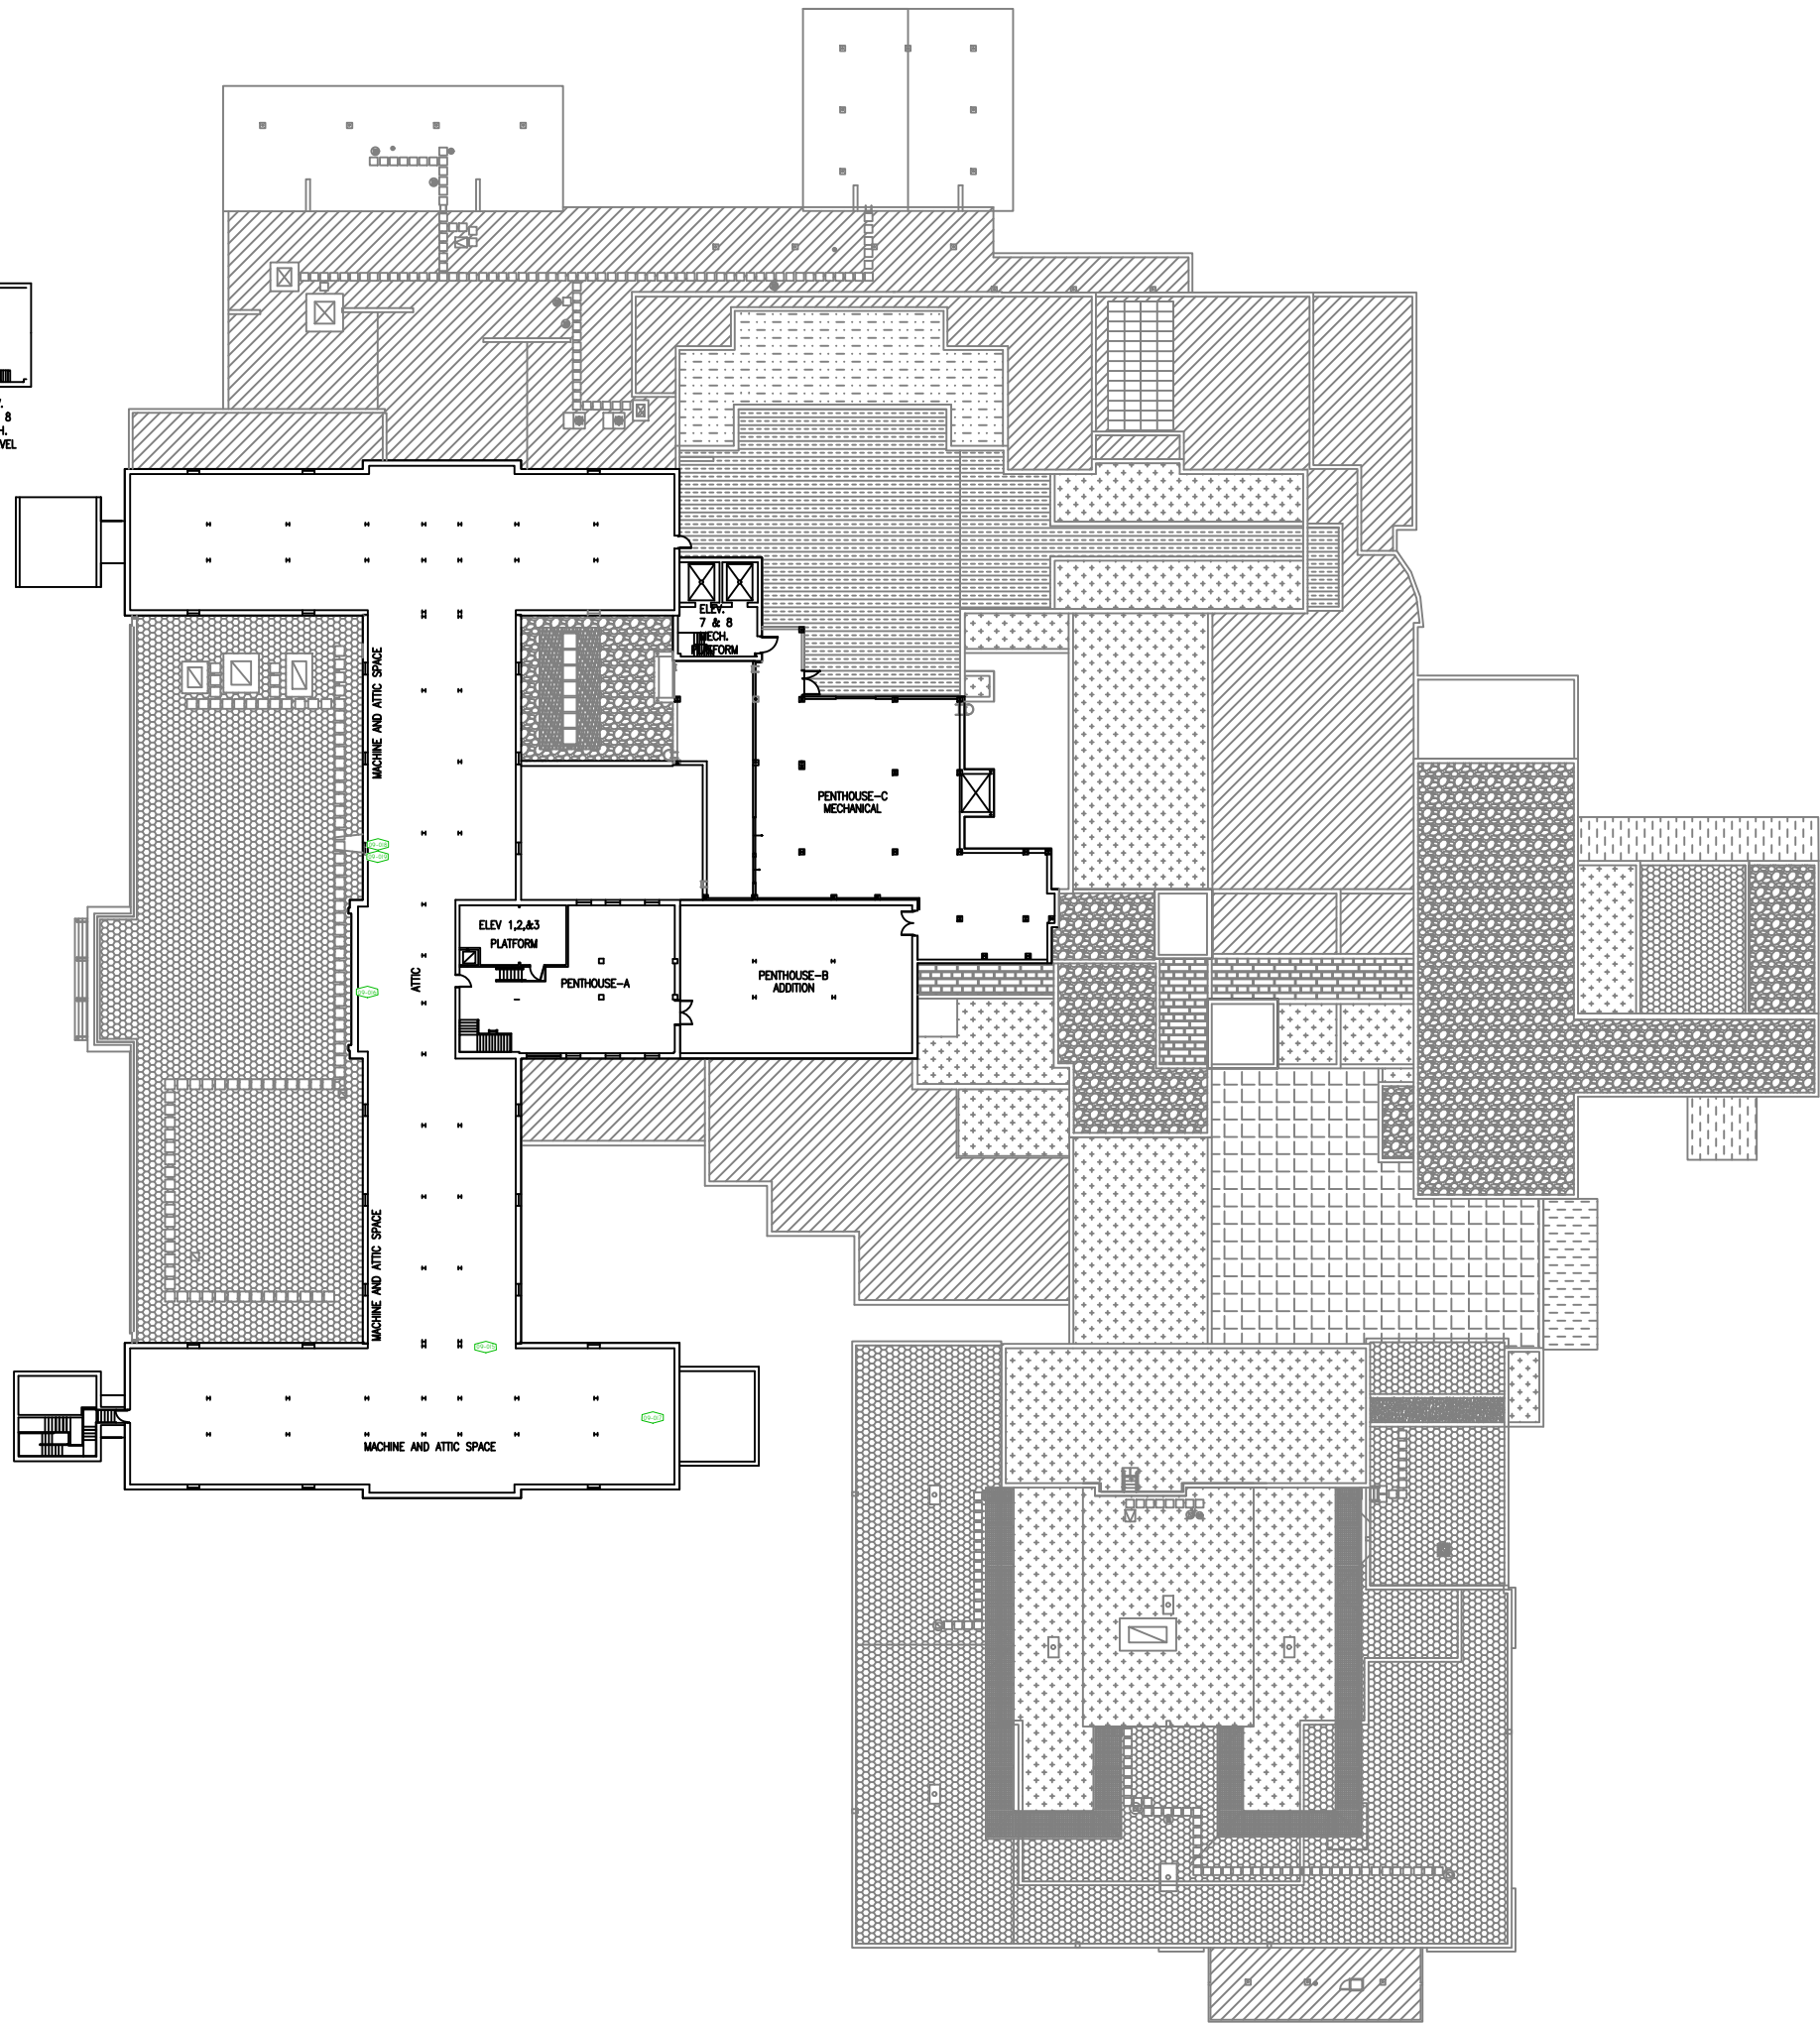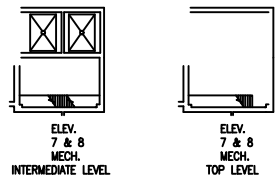

6678 Morningdale Dr
Brighton, MI 48116
(810) 986-0536

DRAWING NAME
SAMPLE &
ASBESTOS LOCATIONS

BUILDING
1, 9, 46

FLOOR/LOCATION
PENTHOUSE

FACILITY/LOCATION
FARGO VAHCS
210 ELM STREET
FARGO, ND 58102

SCALE/ORIENTATION
NOT TO SCALE

N

REFERENCE DRAWINGS ONLY - NOT FOR CONSTRUCTION USE

DATE
6/14/22

REVISION NO 2	SIZE C
------------------	-----------

DRAWING NO
ACM-06

- KEY:
- 01-028 SAMPLE - Non ACM
 - 01-028 SAMPLE - ACM