



Contractor shall replace existing accordion wall at 401
check-in room with new wood fold accordion wall.
Contractor shall demolish existing and provide and install
new accordion wall. Contractor shall be responsible for
working with vendor to procure accurate size accordion
wall with locking capabilities and installing in
accordance with manufactures recommendations.

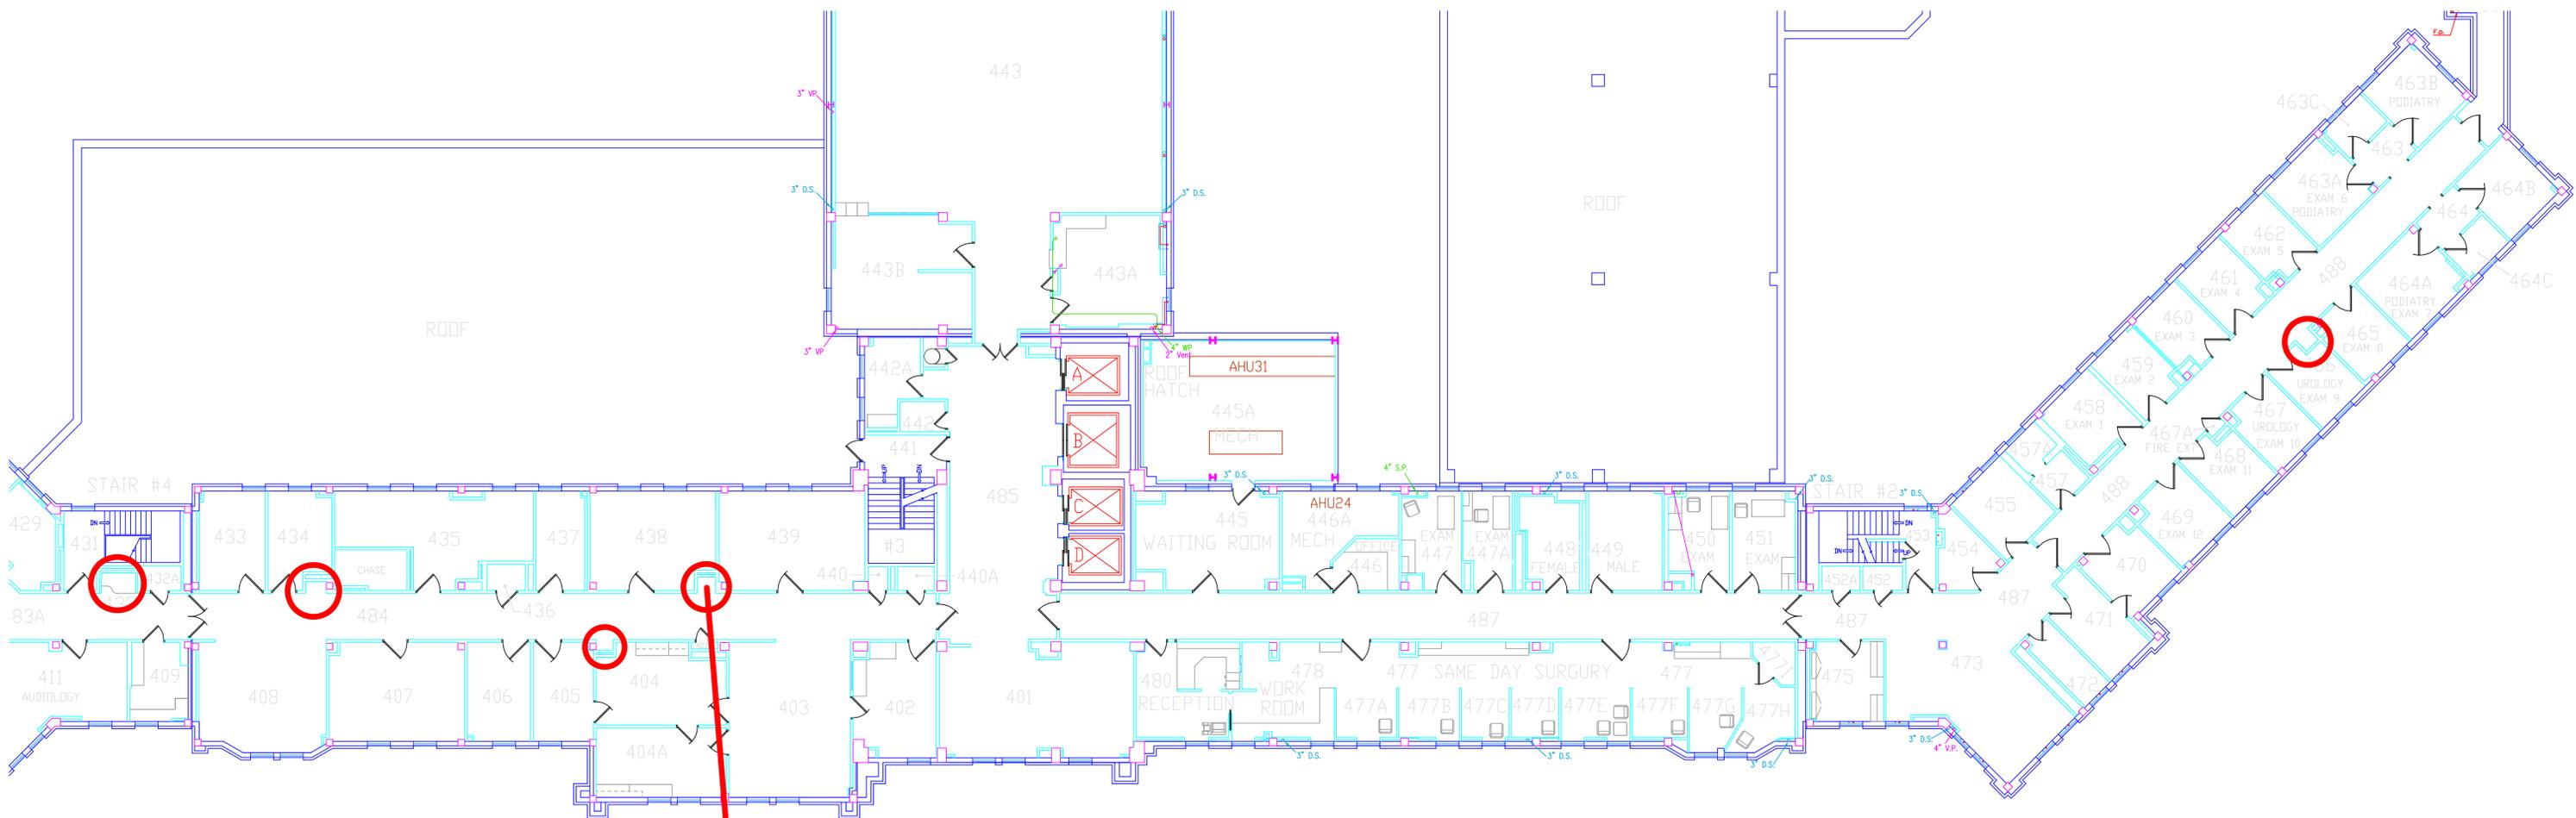


Contractor shall refurbish approximately 5 existing tile alcoves in the 4th floor corridors. See attached 4th floor alcove refurbish drawing for locations of alcoves. Contractor shall demolish existing tile in each alcove and replace with new tile as specified in finish schedule. Contractor shall refinish existing cabinetry with 3M Di-NOC product as indicated in attached finish schedule. Contractor shall replace existing solid surface counters in each alcove with new solid surface as referenced in attached finish schedule.

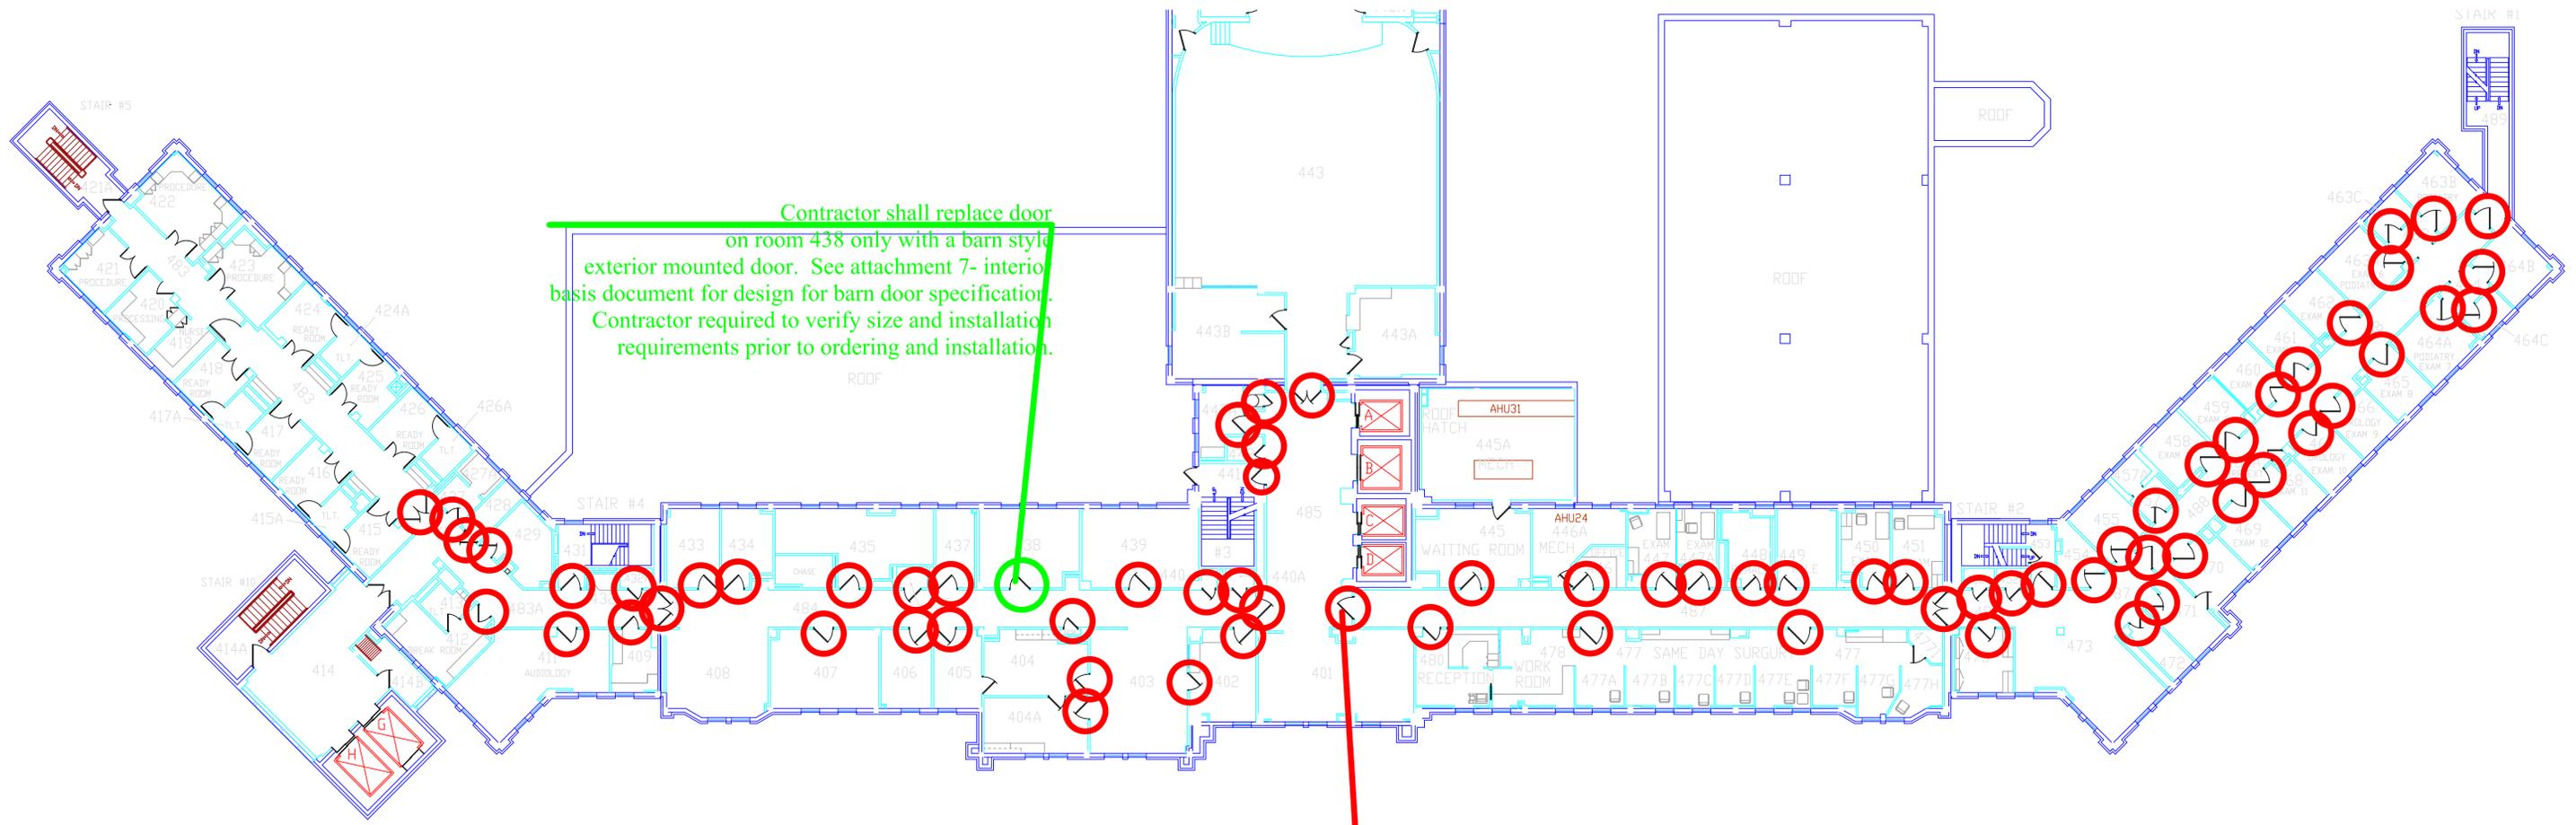

Contractor shall replace door on room 438 only with a barn style exterior mounted door. See attachment 7- interior basis document for design for barn door specification. Contractor required to verify size and installation requirements prior to ordering and installation.


Contractor shall refinish all identified doors circled in red with 3M Di-NOC product. See attached SOW and finish schedule for product specifications. There are approximately 74 doors requiring refinishing. Contractor is required to sand and repaint all door frames. See finish schedule for door frame refinish specifications.



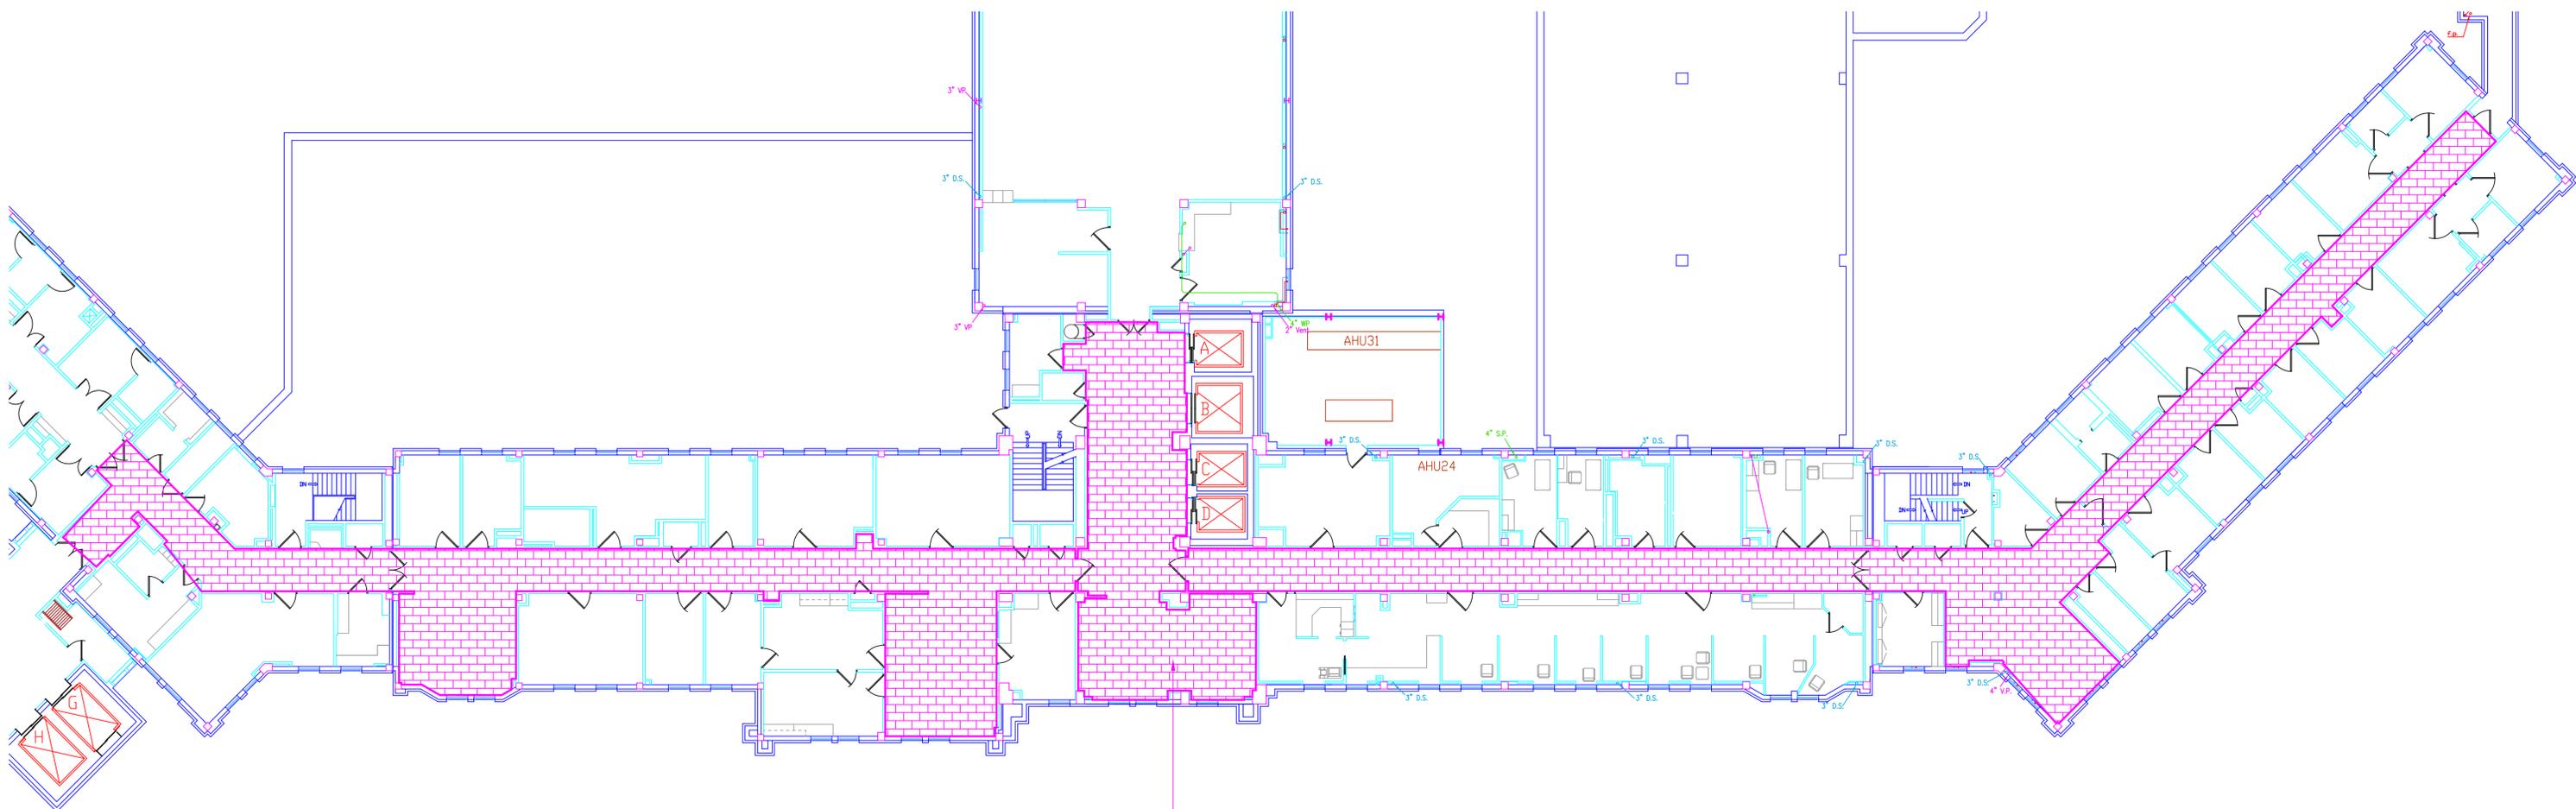

Contractor shall demo existing, prep floor and install new flooring for all areas identified in above hatch. Flooring specifications are listed in attached finish schedule. Contractor shall demo and install new ceiling grid and ceiling tile in areas identified. See attached finish schedule for ceiling tile and grid specifications. Contractor shall replace all lights in hatched area with new LED lights, see attached lighting plan for specifications.



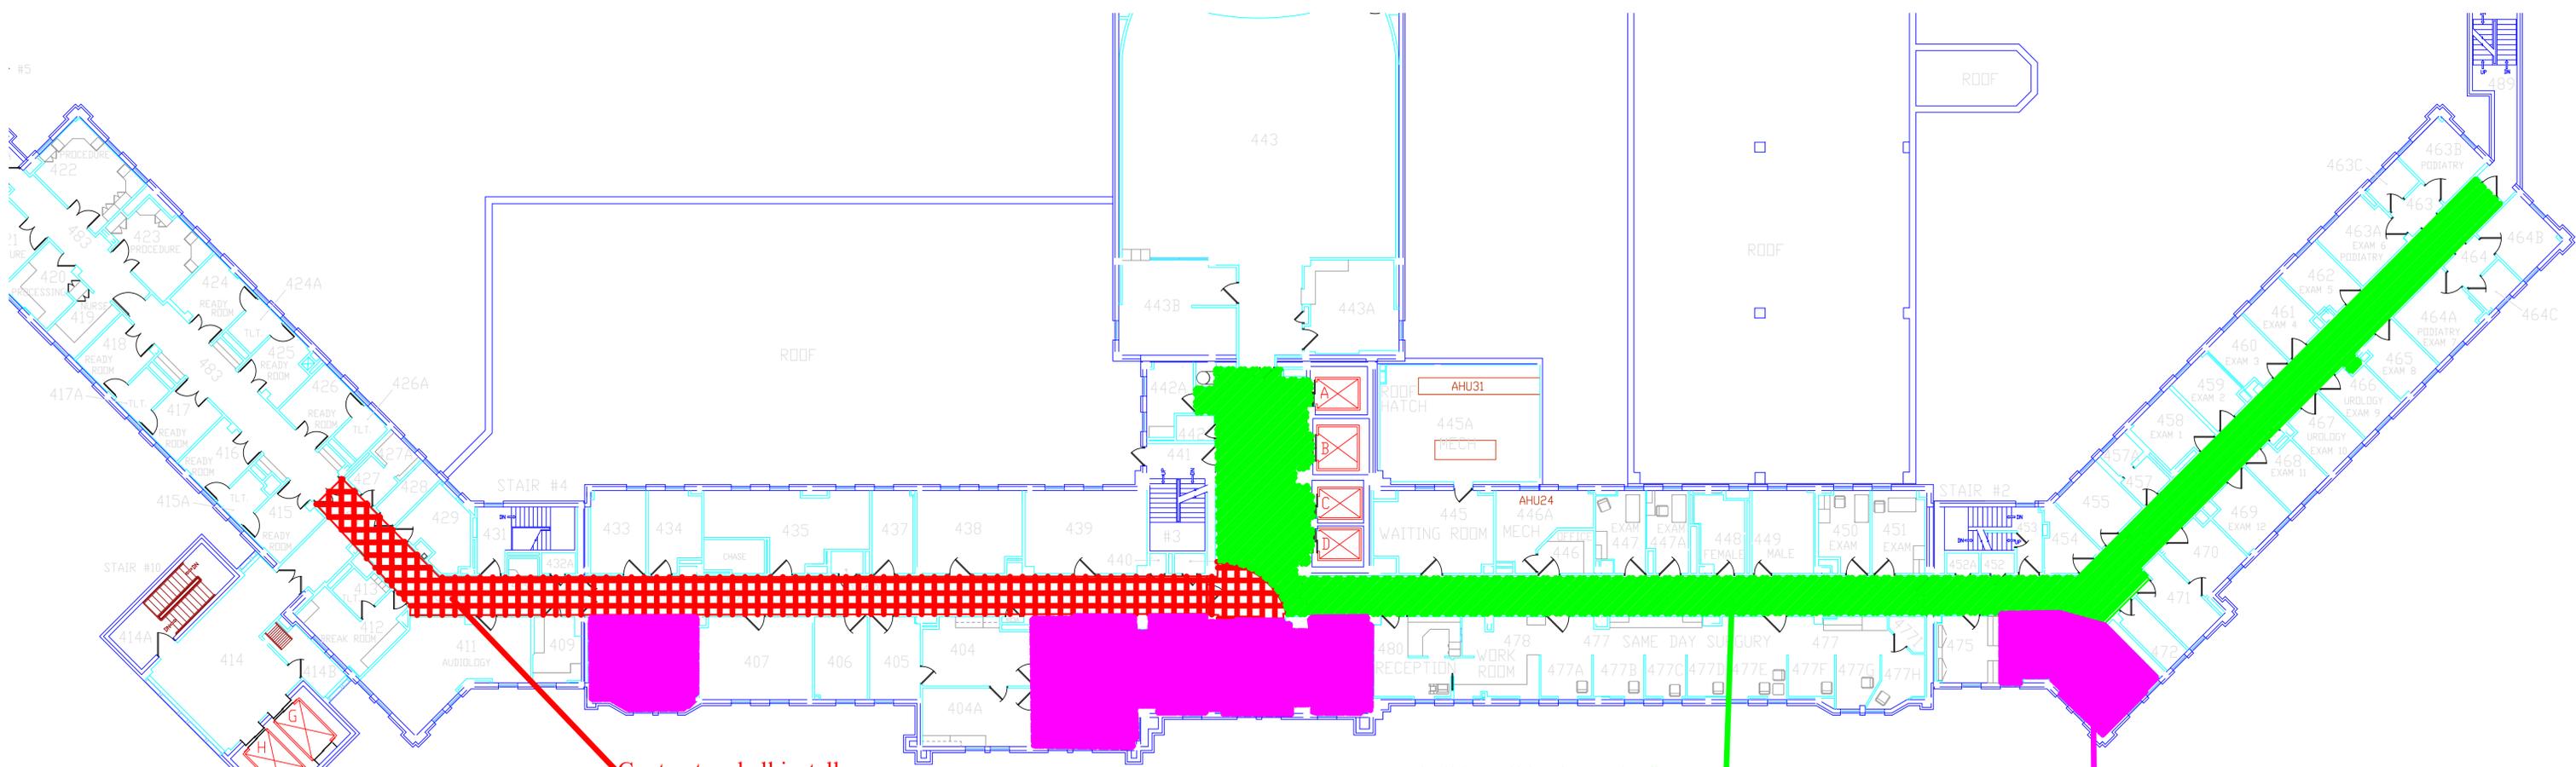


Contractor shall install
venue stone for area hatched in
red. Flooring specification in
attached finish schedule.
See SOW for design transition
from 484-5 corridor to 485 lobby.

Contractor shall install in the grain flaxseed
flooring for area hatched in green. Flooring
specification in attached finish schedule.

Contractor to install
carpet as indicated in
attached finish schedule in
all areas hatched in pink.




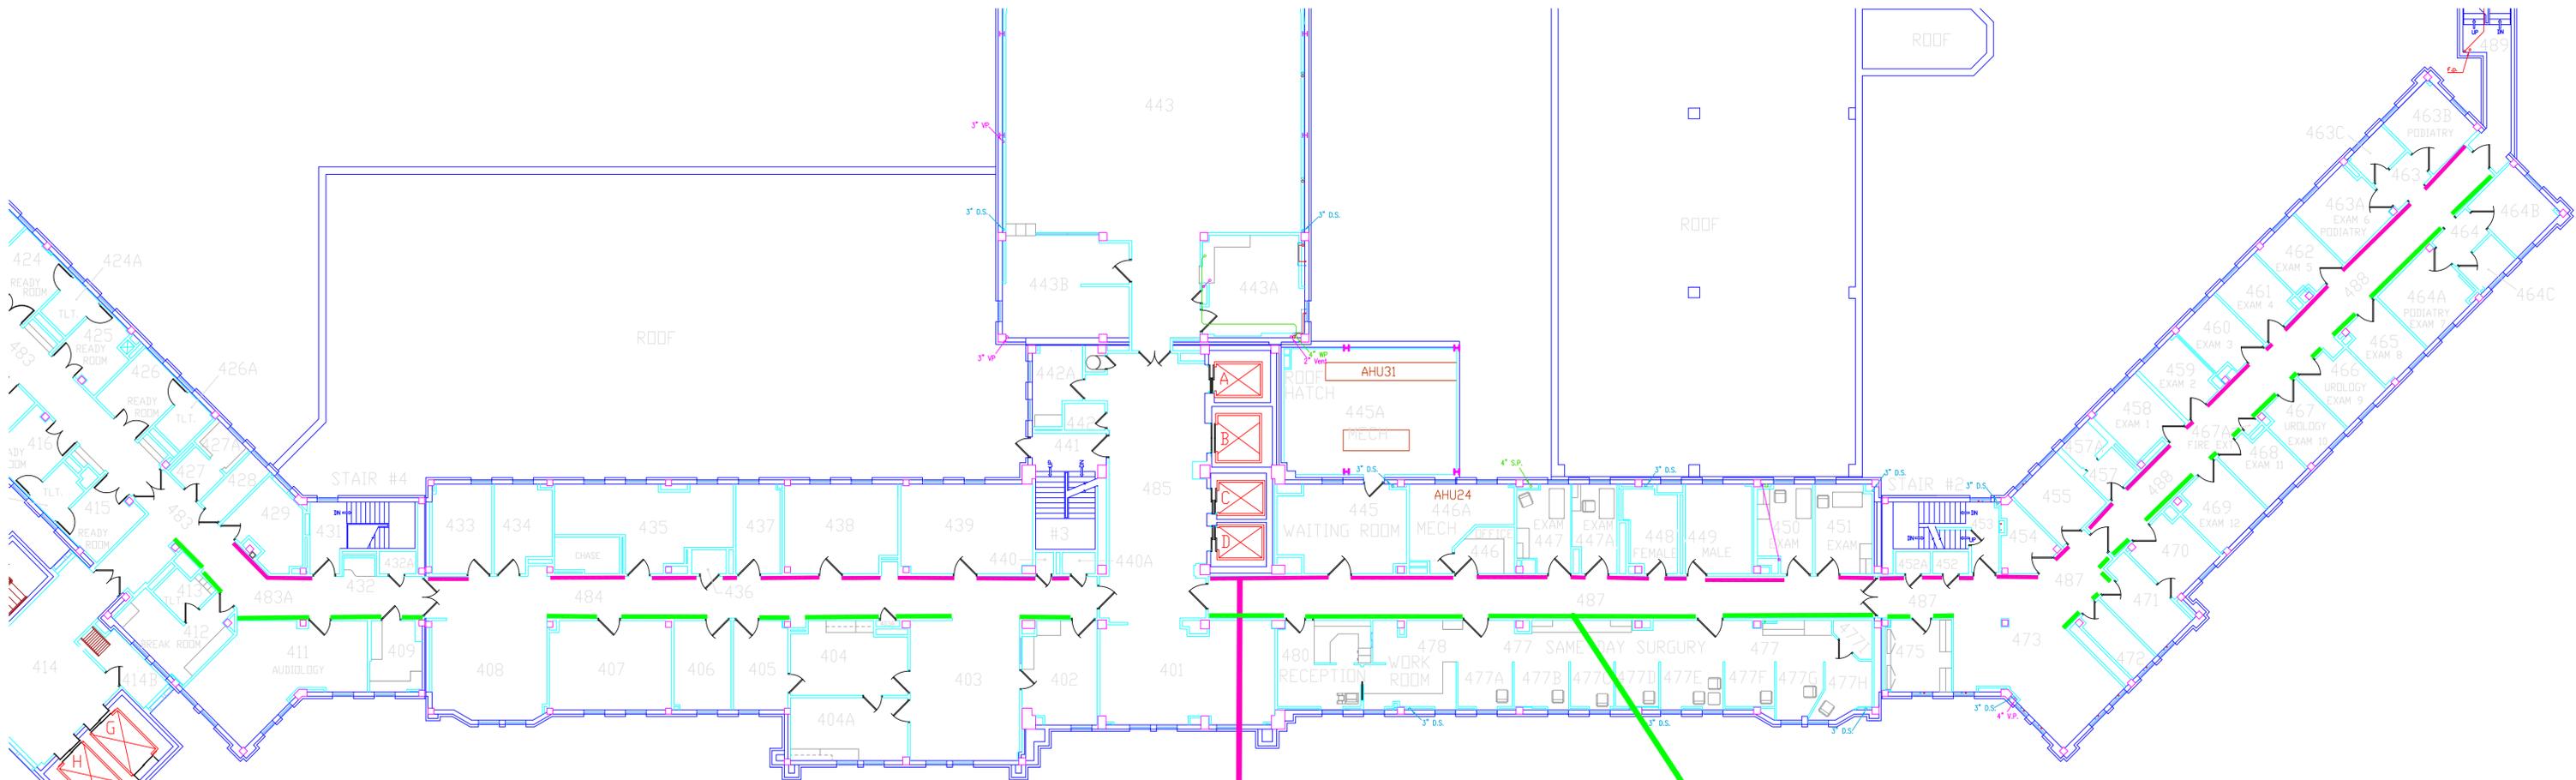

Contractor shall demolish existing crash rail and handrail and provide and install new handrail and crash rail. The West side of the 4th floor corridor shall have both handrail and crash rail installed.


Contractor shall demolish existing crash rail and handrail and install crash rail only on East Side of 4th floor corridor.



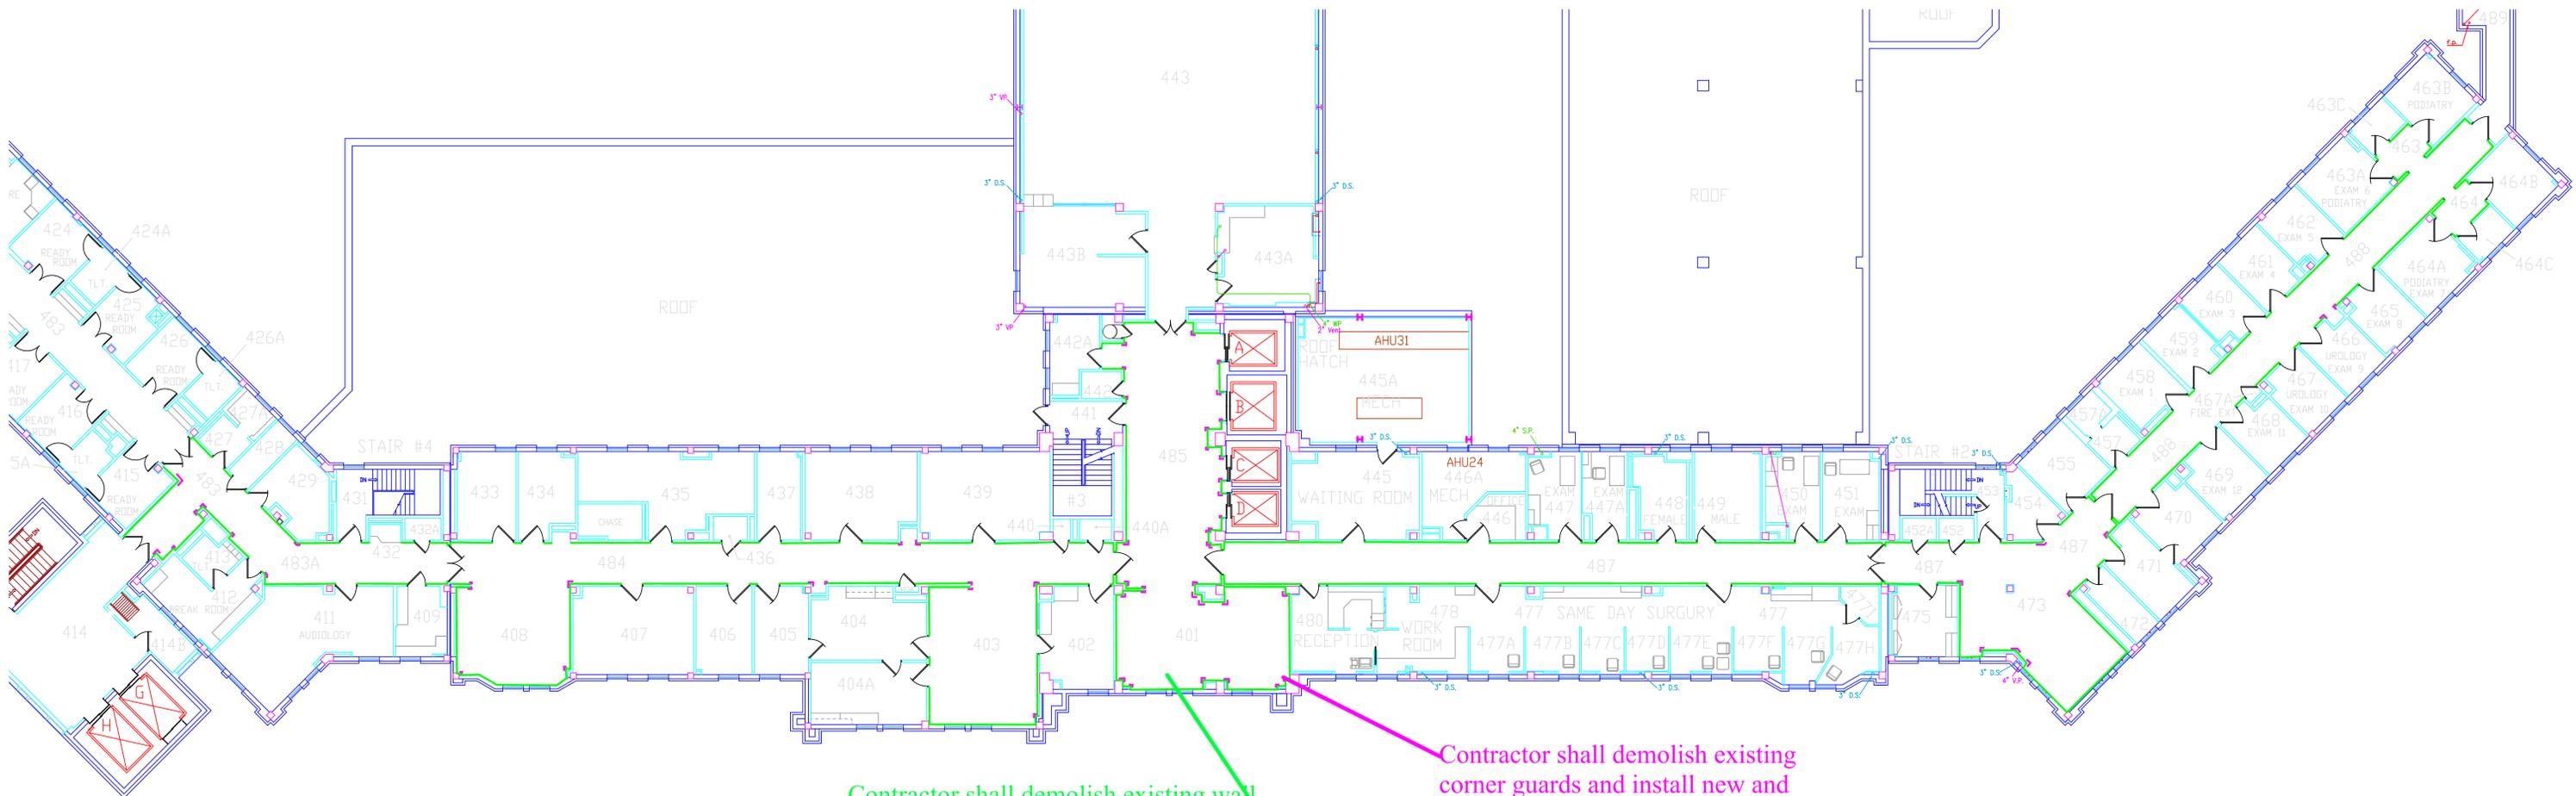

Contractor shall demolish existing wall covering, prepare walls and provide new wall protection, paint or wall covering to all walls shown in green. Wall protection shall be 48" from floor. Wall protection shall have a top 2" trim cap. From top of wall protection to ceiling contractor shall paint or provide and install wall covering as indicated in attached finish schedule,

Contractor shall demolish existing corner guards and install new and additional corner guards in all locations shown on drawing in pink. See finish schedule for corner guard specifications.

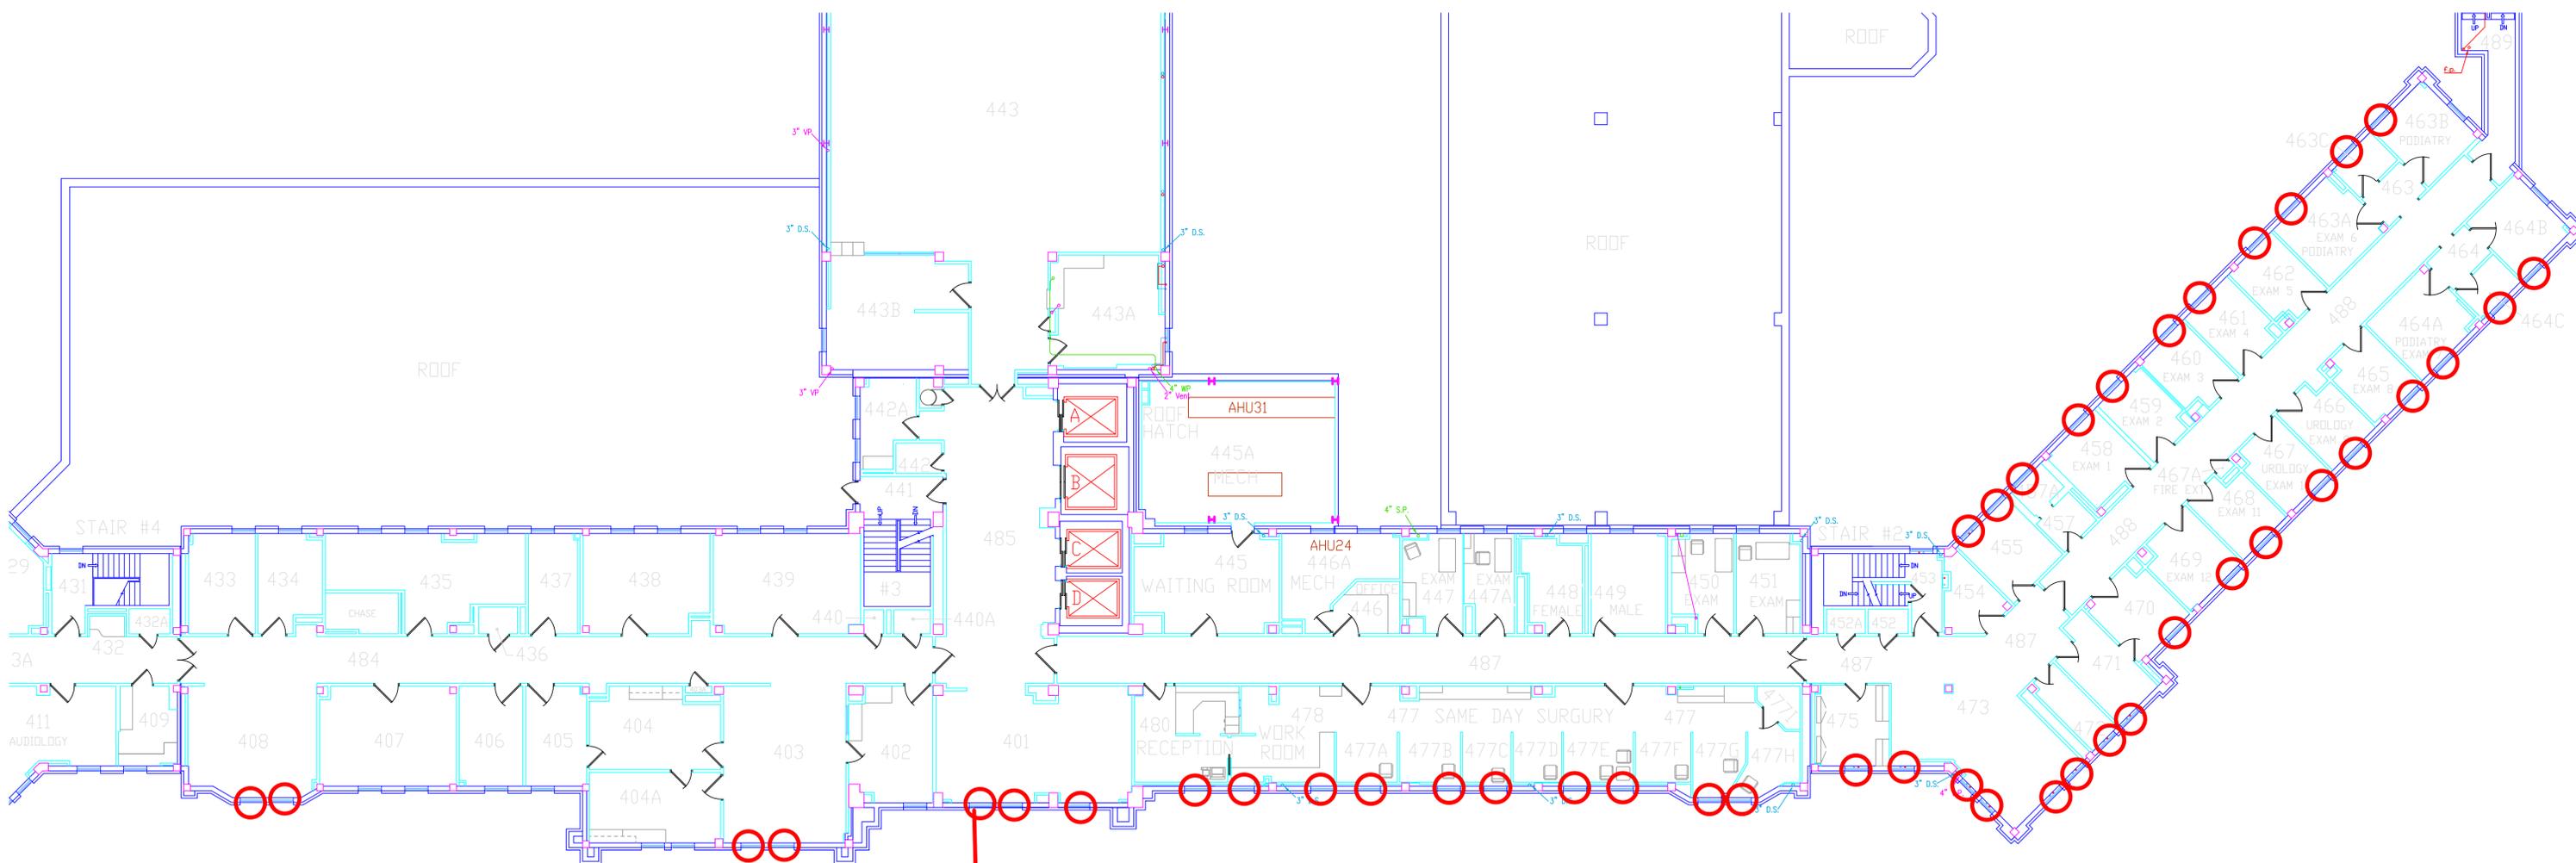

Contractor shall demolish existing window sill and window covering and provide new window sill and window covering in accordance with attached finish schedule. Contractor shall repair and refinish any wall damage as result of window sill demo and replacement.

